# Rexroth IndraDyn A Series Asynchronous Motors MAD/MAF

**R911295781** Edition 03

**Project Planning Manual** 



Title Rexroth IndraDyn A Series

Asynchronous Motors MAD/MAF

Type of Documentation Project Planning Manual

**Document Typecode** DOK-MOTOR\*-MAD/MAF\*\*\*\*-PR03-EN-P

Internal File Reference • 29578103 Book.doc

Document Number 120-1500-B321-03/EN

#### Purpose of Documentation This documentation

- explains product features and applications, technical data as well as conditions and limits for operation.
- provides guidelines for product selection, application, handling and operation.

#### **Record of Revisions**

Description	Release Date	Notes
DOK-MOTOR*-MAD/MAF****-PR01-EN-P	11.2003	1 <sup>st</sup> edition
DOK-MOTOR*-MAD/MAF****-PR02-EN-P	02.2005	1 <sup>st</sup> reprint
DOK-MOTOR*-MAD/MAF****-PR03-EN-P	08.2006	2 <sup>nd</sup> reprint

#### Copyright © Bosch Rexroth AG, 2006

Copying this document, giving it to others and the use or communication of the contents thereof without express authority, are forbidden. Offenders are liable for the payment of damages. All rights are reserved in the event of the grant of a patent or the registration of a utility model or design (DIN 34-1).

Validity The specified data is for product description purposes only and may not

be deemed to be guaranteed unless expressly confirmed in the contract. All rights are reserved with respect to the content of this documentation and the quality of the product.

and the availability of the product.

Published by Bosch Rexroth Electric Drives and Controls GmbH

Bgm.-Dr.-Nebel-Str. 2 • 97816 Lohr a. Main, Germany

Tel +49 (0)93 52 / 40-0 • Fax +49 (0)93 52 / 40-48 85

http://www.boschrexroth.com/

Dept. EDM1 (FS)

Note This document has been printed on chlorine-free bleached paper.

## **Table of Contents**

1	Intr	oduction to the Product	1-1
	1.1	About this Documentation	1-2
		Additional Components	1-3
		Feedback	1-3
		Standards	1-3
2	Imp	ortant directions for use	2-1
	2.1	Appropriate use	2-1
		Introduction	2-1
		Areas of use and application	2-2
	2.2	Inappropriate use	2-2
3	Safe	ety Instructions for Electric Drives and Controls	3-1
	3.1	General Information	3-1
		Using the Safety Instructions and Passing them on to Others	3-1
		Instructions for Use	3-1
		Explanation of Warning Symbols and Degrees of Hazard Seriousness	3-3
		Hazards by Improper Use	3-4
	3.2	Instructions with Regard to Specific Dangers	3-5
		Protection Against Contact with Electrical Parts	3-5
		Protection Against Electric Shock by Protective Low Voltage (PELV)	3-6
		Protection Against Dangerous Movements	3-7
		Protection Against Magnetic and Electromagnetic Fields During Operation and Mounting	3-9
		Protection Against Contact with Hot Parts	
		Protection During Handling and Mounting	
		Battery Safety	
		Protection Against Pressurized Systems	3-12
4	Tec	hnical Data	4-1
	4.1	Operating Modes	4-1
	4.2	Operating Behavior	4-2
	4.3	Data Sheet MAD100B	4-5
		Characteristic Curves of MAD100B Motors	4-6
	4.4	Data Sheet MAD100C	4-9
		Characteristic Curves of MAD100C Motors	4-10
	4.5	Data Sheet MAD100D	4-13
		Characteristic Curves of MAD100D Motors	4-14
	4.6	Data Sheet MAD130B	4-17

	Characteristic Curves of MAD130B Motors	4-18
4.7	Data Sheet MAD130C	4-21
	Characteristic Curves of MAD130C Motors	4-22
4.8	Data Sheet MAD130D	4-25
	Characteristic Curves of MAD130D Motors	4-26
4.9	Data Sheet MAD160B	4-29
	Characteristic Curves of MAD160B Motors	4-30
4.10	Data Sheet MAD160C	4-32
	Characteristic Curves of MAD160C Motors	4-33
4.11	Data Sheet MAD180C	4-35
	Characteristic Curves of MAD180C Motors	4-36
4.12	Data Sheet MAD180D	4-38
	Characteristic Curves of MAD180D Motors	4-39
4.13	Data Sheet MAD225C	4-41
	Characteristic Curve MAD225C Motor	4-42
4.14	Data Sheet MAF100B	4-43
	Characteristic Curves of MAD100B Motors	4-44
4.15	Data Sheet MAF100C	4-47
	Characteristic Curves of MAF100C Motors	
4.16	Data Sheet MAF100D	4-51
	Characteristic Curves of MAF100D Motors	4-52
4.17	Data Sheet MAF130B	4-55
	Characteristic Curves of MAF130B Motors	4-56
4.18	Data Sheet MAF130C	4-59
	Characteristic Curves of MAF130C Motors	4-60
4.19	Data Sheet MAF130D	4-63
	Characteristic Curves of MAF130D Motors	4-64
4.20	Data Sheet MAF160B	4-67
	Characteristic Curves of MAF160B Motors	4-68
4.21	Data Sheet MAF160C	4-70
	Characteristic Curves of MAF160C Motors	4-71
4.22	Data Sheet MAF180C	4-73
	Characteristic Curves of MAF180C Motors	4-74
4.23	Data Sheet MAF180D	4-76
	Characteristic Curves of MAF180D Motors	
4.24	Data Sheet MAF225C	4-79
	Characteristic Curves MAF225C Motors	4-80
Dim	ension Sheets IndraDyn A	5-1
5.1	Frame Size MAD100	5-1
	MAD100 without Holding Brake	
	MAD100 with Brake 1 or 5	
	MAD100 with Fan Cowl, without Holding Brake	
	MAD100 with Fan Cowl and Brake 1 or 5	
	MAD100 in Explosion-Protected Design, without Holding Brake	
	MAD100 in ATEX Design, with Brake 1 or 5	
	<b>J</b> ,	



5

5.2	Frame Size MAD130	5-7
	MAD130 without Holding Brake	5-7
	MAD130 with Brake 1 or 5	5-8
	MAD130 with Fan Cowl, without Holding Brake	5-9
	MAD130 with Fan Cowl and Brake 1 or 5	5-9
	MAD130 in ATEX Design, without Holding Brake	5-10
	MAD130 in ATEX Design, with Brake 1 or 5	5-11
5.3	Frame Size MAD160	5-12
	MAD160 without Holding Brake	5-12
	MAD160 with Brake 1 or 5	5-13
	MAD160 with Brake 3	5-14
	MAD160 with Fan Cowl, without Holding Brake	5-15
	MAD160 with Fan Cowl and Brake 1 or 5	5-15
	MAD160 with Fan Cowl and Brake 3	5-15
	MAD160 in ATEX Design, without Holding Brake	5-16
	MAD160 in ATEX Design, with Brake 1 or 5	5-17
	MAD160 in ATEX Design, with Brake 3	5-18
5.4	Frame Size MAD180	5-19
	MAD180 without Holding Brake	5-19
	MAD180 with Brake 2 or 5	5-20
	MAD180 with Fan Cowl, without Holding Brake	5-21
	MAD180 with Fan Cowl and Brake 2 or 5	5-21
	MAD180 in ATEX Design, without Holding Brake	
	MAD180 in ATEX Design, with Brake 2 or 5	5-23
5.5	Frame Size MAD225	5-24
	MAD225 (without Holding Brake)	5-24
5.6	Frame Size MAF100	5-25
	MAF100 without Holding Brake	5-25
	MAF100 with Brake 1 or 5	5-26
	MAF100 in ATEX Design, without Holding Brake	5-27
	MAF100 in ATEX Design, with Brake 1 or 5	5-28
5.7	Frame Size MAF130	5-29
	MAF130 without Holding Brake	
	MAF130 with Brake 1 or 5	5-30
	MAF130 in ATEX Design, without Holding Brake	
	MAF130 in ATEX Design, with Brake 1 or 5	5-32
5.8	Frame Size MAF160	
	MAF160 without Holding Brake	5-33
	MAF160 with Brake 1 or 5	5-34
	MAF160 in ATEX Design, without Holding Brake	5-35
	MAF160 in ATEX Design, with Brake 1 or 5	5-36
5.9	Frame Size MAF180	
	MAF180 without Holding Brake	5-37
	MAF180 with Brake 2 or 5	
	MAF180 in ATEX Design, without Holding Brake	
	MAF180 in ATEX Design, with Brake 2 or 5	5-40



	5.10	Frame Size MAF225	5-41
		MAF225 (without Holding Brake)	5-41
6	Тур	e Codes IndraDyn A	6-1
	6.1	Introduction	6-1
		Definition	
	6.2	Type Code MAD100	6-4
	6.3	Type Code MAD130	6-6
	6.4	Type Code MAD160	6-8
	6.5	Type Code MAD180	6-10
	6.6	Type Code MAD225	6-12
	6.7	Type Code MAF100	6-14
	6.8	Type Code MAF130	6-16
	6.9	Type Code MAF160	6-18
	6.10	Type Code MAF180	6-20
	6.11	Type Code MAF225	6-22
7	Acc	essories	7-1
	7.1	Labyrinth Seal	7-1
	7.2	Sealing Air Connection	
	7.3	Gearboxes	
	7.4	Thread Reducers	
	7.5	Fan Cowl	
_			
8		nection Techniques	8-1
	8.1	Notes	
	8.2	Power Connection	
		Overview	
		Additional Grounding Wire at MAF225C	
	8.3	Power Connection with Connector Socket	
	8.4	Power Connection with Terminal Box	
	8.5	Connection Designations at the Drive Control Device	8-7
	8.6	Double Cabling	
	8.7	Encoder Connection	
	8.8	Temperature sensor	8-12
	8.9	Holding Brake	
	8.10	Motor Cooling System	
		Fan Connection	8-12
		Coolant Connection	8-13
		Operating Pressure	8-15
9	App	lication Notes	9-1
	9.1	Operating Conditions	9-1
		Setup Elevation and Ambient Temperature	
	0.2	^ir ∐umidity	0.3



9.3	Vibration and Shock	9-2
	Vibration	9-2
	Shock	9-3
9.4	Compatibility with Foreign Material	9-3
9.5	Protection Class	9-4
9.6	Frame Shape and Installation Position	9-5
	Foot Assembly	9-6
	Vertical Installation Position	9-6
9.7	Housing Painting	9-8
9.8	Motor Cooling System	9-8
	Fan	9-8
	Radial Ventilation in Hazardous Areas	9-9
	Coolants	9-10
	Used Materials	9-12
	Coolant Inlet Temperature	9-12
9.9	Motor Temperature Overview	9-14
9.10	Holding Brake (Option)	9-16
	Selecting Holding Brakes	9-17
	Sizing of Holding Brakes (Application)	9-17
9.11	Motor Encoder	9-19
	Options	9-19
	Compatibility	9-19
	Accuracy	9-20
	Connection	9-21
9.12	Output Shaft	9-21
	Plain Shaft	9-21
	Output Shaft With Key	9-21
	Output Shaft with Shaft Sealing Ring	9-22
	Labyrinth Seal	9-23
9.13	Bearing and Shaft Loads	9-25
	Radial Load, Axial Load	9-25
9.14	Attachment of Drive Elements	9-29
	Couplings	9-30
	Skew Bevel Driving Pinions	9-31
	Bevel Gear Pinions	9-31
9.15	Bearing Lifetime	9-32
9.16	Grease Service Life	9-33
9.17	Bearing Variants	9-37
	Tips for Selection	
9.18	Vibration Severity Level	9-40
9.19	Explosion Protection	
9.20	Acceptances and Authorizations	9-41
	CE symbol	
	UR, cUR Listing	
	Certificate of Conformity for ATEX Motors	9-41



10	Han	dling and Transport	10-1
	10.1	Supplied Condition	10-1
		Factory Inspection	10-1
		Inspection by Customer	10-1
	10.2	Identification	10-2
	10.3	Designation	10-2
	10.4	Transport and Storage	10-3
		General Information	10-3
		Notes for Transport	10-3
		Information on Storage	10-4
11	Inst	allation	11-1
	11.1	Safety	11-1
	11.2	Mechanical Attachment	11-1
		Fastening Types	11-2
		Assembly Preparation	
		Motor Assembly	11-3
	11.3	Electrical Connection	11-4
		Additional Grounding Wire at MAF225C	11-4
12	Ope	rating IndraDyn A Motors	12-1
	12.1	Commissioning	12-1
		Preparation	12-1
		Execution	12-1
	12.2	Deactivation	12-2
	12.3	Dismantling	12-2
	12.4	Maintenance	12-2
		Measures	12-3
		MAD – Motor Fan	12-4
		MAF - Coolant Supply	12-4
		Maintaining Holding Brakes	12-5
	12.5	Troubleshooting	12-6
		Excess Temperature of Motor Housing	12-7
		High Motor Temperature Values, but Housing Temperature is Normal	12-7
		Motor or Machine Table Generate Vibrations	12-8
		Specified Position is not Attained	12-8
	Wast	e Disposal	12-9
13	Mote	ors for Hazardous Areas	13-1
	13.1	General Information	13-1
	13.2	Appropriate Use	
	13.3	Conditions for Application	
	13.4	Residual Risks	
	13.5	Selection and Labeling of Ex-Motors	
		Additional Components	
		Motor Fan	13-8



14	Inde	ex	14-1
	13.12	2 Declaration of Conformity	13-23
	13.11	Maintenance / Repairs	13-21
	13.10	) Dismantling	13-20
		Execution	
		Preparation	
	13.9	Commissioning	13-17
		Purging Connections	13-15
		Coolant Connection to MAF Motors	13-15
		Coolant Connection to MAD Motors	13-14
		Grounding Conductor	13-14
		Encoder Connection	13-13
		Power Connection	
	13.8	Connection Techniques	13-11
	13.7	Mechanical Attachment	13-9
		Connection cable	13-9
		EEx p Control Device for Motor Scavenging	13-8



## 1 Introduction to the Product

The Rexroth motor generation **IndraDyn A** consists of asynchronous box motors with squirrel-cage rotor; it is available as

**MAD series** with surface ventilation by solidly connected fan unit.



Fig. 1-1: Exemplary illustration MAD130

#### MAF series with liquid cooling.



Fig. 1-2: Exemplary illustration MAF130

IndraDyn A motors have compact dimensions and can be used as main and servo drives for all rotary driving.

The optimized design with safety class IP65 for motor and fan allows for operation in adverse conditions. Easy-to-service construction reduces maintenance frequency and allows maintenance during operation.

Furthermore, IndraDyn A motors with **ATEX design** can be used in hazardous areas under certain preconditions. Note, however, that the ATEX motors themselves are not certified as explosion-protected parts but only prepared for acceptance as part of an overall system. For more information, please observe the notes in Chapter 13 "ATEX Notes".

Combined with digital control devices from the IndraDrive, this results in intelligent drive solutions with a high power density and open functions.

#### 1.1 About this Documentation

#### **Document Structure**

This documentation includes safety regulations, technical data and operating instructions. The following table provides an overview of the contents of this documentation.

Sect.	Title	Contents		
1	Introduction	Introduction to the notes	product and	
2	Important Instructions on Use	Important safety notes		
3	Safety			
4	Technical Data			
5	Dimension Sheets	Product description		
6	Type Codes		for planners and	
7	Accessories		designers	
8	Connection Techniques			
9	Application Notes			
10	Handling & Transport	Practice for operating	for operating and	
11	Installation		maintenance	
12	Operation		personnel	
13	ATEX Notes	Product description	for planners and designers	
14	Service and Support	- Additional information		
15	Index			

Fig. 1-3: Chapter structure

#### **Additional documentation**

To project the drive-systems of the IndraDyn A motor type series, you may need additional documentation depending on the devices used in your case. Rexroth has made the entire product documentation available on DVD in PDF format or in the Internet under www.boschrexroth.com/BrcDoku/ (one-time registration required). You will not need all the documentation included on the DVD to project a system.

Note:	All documentation on the DVD are also available in a printed
	version. You can order the required product documentation via
	your Rexroth sales office.

MNR	Title / description
R911306531	-Produktdocumentation Electric Drives and Controls Version <u>xx</u> 1) DOK-GENERL-DRIVE*CONTR-GN <b>xx</b> -D0-V0G7
1) The index (e.g <u>02</u> ) identifies the version of the DVD.	

Fig. 1-4: Additional documentation

### **Additional Components**

Documentation for external systems which are connected to BOSCH REXROTH components are not included in the scope of delivery and must be ordered directly from the corresponding manufacturers.

For information on the manufacturers, see chapter 9 "Application Notes".

#### **Feedback**

Your experiences are an essential part of the process of improving both the product and the documentation.

Please do not hesitate to inform us of any mistakes you detect in this documentation or of any modifications you might desire. We would appreciate your feedback.

Please send your remarks to:

Fax +49 (0) 93 52 / 40-43 80

Bosch Rexroth Electric Drives and Controls GmbH Dep. BRC/EDM1 Buergermeister-Dr.-Nebel-Strasse 2 97816 Lohr, Germany

#### **Standards**

This documentation refers to German, European and international technical standards. Documents and sheets on standards are subject to copyright protection and may not be passed on to third parties by Rexroth. If necessary, please address the authorized sales outlets or, in Germany, directly to:

BEUTH Verlag GmbH Burggrafenstrasse 6 D-10787 Berlin

Phone +49-(0)30-26 01-22 60, Fax +49-(0)30-26 01-12 60 Internet: <a href="http://www.din.de/beuth\_postmaster@beuth.de">http://www.din.de/beuth\_postmaster@beuth.de</a>



## 2 Important directions for use

## 2.1 Appropriate use

#### Introduction

Bosch Rexroth products represent state-of-the-art developments and manufacturing. They are 100% tested prior to delivery to ensure operating safety and reliability.

The products may only be used in the manner that is defined as appropriate. If they are used in an inappropriate manner, then situations can develop that may lead to property damage or injury to personnel.

#### Note:

Bosch Rexroth, as manufacturer, is not liable for any damages resulting from inappropriate use. In such cases, the guarantee and the right to payment of damages resulting from inappropriate use are forfeited. The user alone carries all responsibility of the risks.

Before using Bosch Rexroth products, make sure that all the prerequisites for appropriate use of the products are satisfied:

- Personnel that in any way, shape or form uses our products must first read and understand the relevant safety instructions and be familiar with appropriate use.
- If the product takes the form of hardware, then they must remain in their original state. In other words, no structural changes are permitted. It is not permitted to decompile software products or alter source codes.
- Do not mount damaged or faulty products or use them in operation.
- Make sure that the products have been installed in the manner described in the relevant documentation.



## Areas of use and application

Asynchronous motors of the IndraDyn A line made by Bosch Rexroth are designed to be used as rotary main-spindle and servo-drive motors.

Typical applications are in:

- machine tools,
- printing and paper processing machines,
- · packaging and foodstuff machines and
- metal-forming machine tools.

Several types of motors with differing drive power and different interfaces are available for application-specific uses.

Control and monitoring of the motors may require additional sensors and actors.

#### Note:

The motors may only be used with the accessories and parts specified in this document. If a component has not been specifically named, then it may not be either mounted or connected. The same applies to cables and lines.

Operation is only permitted in the specified configurations and combinations of components using the software and firmware as specified in the relevant function descriptions.

Every drive controller has to be programmed before starting it up, making it possible for the motor to execute the specific functions of an application.

The motors may only be operated under the assembly, installation and ambient conditions as described here (temperature, IP-Class, humidity, EMC requirements, etc.) and in the position specified.

## 2.2 Inappropriate use

Inappropriate use is defined as using the motors outside of the abovereferenced areas of application or under operating conditions other than described in the document and the technical data specified.

IndraDyn A motors may not be used if

- they are subject to operating conditions that do not meet the above specified ambient conditions. This includes, for example, operation under water, in the case of extreme temperature fluctuations or extremely high maximum temperatures or if
- Bosch Rexroth has not specifically released them for that intended purpose. Please note the specifications outlined in the general Safety Guidelines!



## 3 Safety Instructions for Electric Drives and Controls

#### 3.1 General Information

## Using the Safety Instructions and Passing them on to Others

Do not attempt to install or commission this device without first reading all documentation provided with the product. Read and understand these safety instructions and all user documentation prior to working with the device. If you do not have the user documentation for the device, contact your responsible Bosch Rexroth sales representative. Ask for these documents to be sent immediately to the person or persons responsible for the safe operation of the device.

If the device is resold, rented and/or passed on to others in any other form, then these safety instructions must be delivered with the device.



Improper use of these devices, failure to follow the safety instructions in this document or tampering with the product, including disabling of safety devices, may result in material damage, bodily harm, electric shock or even death!

#### Instructions for Use

Read these instructions before the initial startup of the equipment in order to eliminate the risk of bodily harm or material damage. Follow these safety instructions at all times.

- Bosch Rexroth AG is not liable for damages resulting from failure to observe the warnings provided in this documentation.
- Read the operating, maintenance and safety instructions in your language before starting up the machine. If you find that you cannot completely understand the documentation for your product, please ask your supplier to clarify.
- Proper and correct transport, storage, assembly and installation as well as care in operation and maintenance are prerequisites for optimal and safe operation of this device.
- Only assign trained and qualified persons to work with electrical installations:
  - Only persons who are trained and qualified for the use and operation of the device may work on this device or within its proximity. The persons are qualified if they have sufficient knowledge of the assembly, installation and operation of the equipment as well as an understanding of all warnings and precautionary measures noted in these instructions.
  - Furthermore, they must be trained, instructed and qualified to switch electrical circuits and devices on and off in accordance with technical safety regulations, to ground them and to mark them according to the requirements of safe work practices. They must have adequate safety equipment and be trained in first aid.
- Only use spare parts and accessories approved by the manufacturer.
- Follow all safety regulations and requirements for the specific application as practiced in the country of use.

- The devices have been designed for installation in industrial machinery.
- The ambient conditions given in the product documentation must be observed.
- Only use safety-relevant applications that are clearly and explicitly approved in the Project Planning Manual. If this is not the case, they are excluded.
  - Safety-relevant are all such applications which can cause danger to persons and material damage.
- The information given in the documentation of the product with regard to the use of the delivered components contains only examples of applications and suggestions.

The machine and installation manufacturer must

- make sure that the delivered components are suited for his individual application and check the information given in this documentation with regard to the use of the components,
- make sure that his application complies with the applicable safety regulations and standards and carry out the required measures, modifications and complements.
- Startup of the delivered components is only permitted once it is sure that the machine or installation in which they are installed complies with the national regulations, safety specifications and standards of the application.
- Operation is only permitted if the national EMC regulations for the application are met.
- The instructions for installation in accordance with EMC requirements can be found in the documentation "EMC in Drive and Control Systems".
  - The machine or installation manufacturer is responsible for compliance with the limiting values as prescribed in the national regulations.
- Technical data, connections and operational conditions are specified in the product documentation and must be followed at all times.



## **Explanation of Warning Symbols and Degrees of Hazard Seriousness**

The safety instructions describe the following degrees of hazard seriousness. The degree of hazard seriousness informs about the consequences resulting from non-compliance with the safety instructions:

Warning symbol with signal word	Degree of hazard seriousness according to ANSI Z 535
DANGER	Death or severe bodily harm will occur.
WARNING	Death or severe bodily harm may occur.
CAUTION	Bodily harm or material damage may occur.

Fig. 3-1: Hazard classification (according to ANSI Z 535)

## **Hazards by Improper Use**



High electric voltage and high working current! Risk of death or severe bodily injury by electric shock!



Dangerous movements! Danger to life, severe bodily harm or material damage by unintentional motor movements!



High electric voltage because of incorrect connection! Risk of death or bodily injury by electric shock!



Health hazard for persons with heart pacemakers, metal implants and hearing aids in proximity to electrical equipment!



Hot surfaces on device housing! Danger of injury! Danger of burns!



Risk of injury by improper handling! Risk of bodily injury by bruising, shearing, cutting, hitting, or improper handling of pressurized lines!



Risk of injury by improper handling of batteries!

## 3.2 Instructions with Regard to Specific Dangers

## **Protection Against Contact with Electrical Parts**

Note:

This section only concerns devices and drive components with voltages of more than 50 Volt.

Contact with parts conducting voltages above 50 Volts can cause personal danger and electric shock. When operating electrical equipment, it is unavoidable that some parts of the devices conduct dangerous voltage.



## High electrical voltage! Danger to life, electric shock and severe bodily injury!

- ⇒ Only those trained and qualified to work with or on electrical equipment are permitted to operate, maintain and repair this equipment.
- ⇒ Follow general construction and safety regulations when working on electrical power installations.
- ⇒ Before switching on the device, the equipment grounding conductor must have been non-detachably connected to all electrical equipment in accordance with the connection diagram.
- ⇒ Do not operate electrical equipment at any time, even for brief measurements or tests, if the equipment grounding conductor is not permanently connected to the mounting points of the components provided for this purpose.
- ⇒ Before working with electrical parts with voltage potentials higher than 50 V, the device must be disconnected from the mains voltage or power supply unit. Provide a safeguard to prevent reconnection.
- ⇒ With electrical drive and filter components, observe the following:
  - Wait 30 minutes after switching off power to allow capacitors to discharge before beginning to work. Measure the voltage on the capacitors before beginning to work to make sure that the equipment is safe to touch.
- ⇒ Never touch the electrical connection points of a component while power is turned on.
- ⇒ Install the covers and guards provided with the equipment properly before switching the device on. Before switching the equipment on, cover and safeguard live parts safely to prevent contact with those parts.
- ⇒ A residual-current-operated circuit-breaker or r.c.d. cannot be used for electric drives! Indirect contact must be prevented by other means, for example, by an overcurrent protective device according to the relevant standards.
- ⇒ Secure built-in devices from direct touching of electrical parts by providing an external housing, for example a control cabinet.

European countries: according to EN 50178/ 1998, section 5.3.2.3.

USA: See National Electrical Code (NEC), National Electrical Manufacturers' Association (NEMA), as well as local engineering regulations. The operator must observe all the above regulations at any time.

With electrical drive and filter components, observe the following:



#### High housing voltage and large leakage current! Risk of death or bodily injury by electric shock!

- Before switching on, the housings of all electrical equipment and motors must be connected or grounded with the equipment grounding conductor to the grounding points. This is also applicable before short tests.
- ⇒ The equipment grounding conductor of the electrical equipment and the units must be non-detachably and permanently connected to the power supply unit at all times. The leakage current is greater than 3.5 mA.
- ⇒ Over the total length, use copper wire of a cross section of a minimum of 10 mm² for this equipment grounding connection!
- ⇒ Before start-up, also in trial runs, always attach the equipment grounding conductor or connect with the ground wire. Otherwise, high voltages may occur at the housing causing electric shock.

## Protection Against Electric Shock by Protective Low Voltage (PELV)

All connections and terminals with voltages between 5 and 50 Volt at Rexroth products are protective extra-low voltage systems which are provided with touch guard according to the product standards.



### High electric voltage by incorrect connection! Risk of death or bodily injury by electric shock!

- ⇒ To all connections and terminals with voltages between 0 and 50 Volt, only devices, electrical components, and conductors may be connected which are equipped with a PELV (Protective Extra-Low Voltage) system.
- ⇒ Connect only voltages and circuits which are safely isolated from dangerous voltages. Safe isolation is achieved for example by isolating transformers, safe optocouplers or battery operation without mains connection.

### **Protection Against Dangerous Movements**

Dangerous movements can be caused by faulty control of connected motors. Some common examples are:

- improper or wrong wiring of cable connections
- incorrect operation of the equipment components
- wrong input of parameters before operation
- malfunction of sensors, encoders and monitoring devices
- · defective components
- · software or firmware errors

Dangerous movements can occur immediately after equipment is switched on or even after an unspecified time of trouble-free operation.

The monitoring in the drive components will normally be sufficient to avoid faulty operation in the connected drives. Regarding personal safety, especially the danger of bodily harm and material damage, this alone cannot be relied upon to ensure complete safety. Until the integrated monitoring functions become effective, it must be assumed in any case that faulty drive movements will occur. The extent of faulty drive movements depends upon the type of control and the state of operation.





## Dangerous movements! Danger to life, risk of injury, severe bodily harm or material damage!

⇒ For the above reasons, ensure personal safety by means of qualified and tested higher-level monitoring devices or measures integrated in the installation.

They have to be provided for by the user according to the specific conditions within the installation and a hazard and fault analysis. The safety regulations applicable for the installation have to be taken into consideration. Unintended machine motion or other malfunction is possible if safety devices are disabled, bypassed or not activated.

## To avoid accidents, bodily harm and/or material damage:

- ⇒ Keep free and clear of the machine's range of motion and moving parts. Possible measures to prevent people from accidentally entering the machine's range of motion:
  - use safety fences
  - use safety guards
  - use protective coverings
  - install light curtains or light barriers
- ⇒ Fences and coverings must be strong enough to resist maximum possible momentum.
- ⇒ Mount the emergency stop switch in the immediate reach of the operator. Verify that the emergency stop works before startup. Don't operate the device if the emergency stop is not working.
- ⇒ Isolate the drive power connection by means of an emergency stop circuit or use a safety related starting lockout to prevent unintentional start.
- ⇒ Make sure that the drives are brought to a safe standstill before accessing or entering the danger zone.
- ⇒ Additionally secure vertical axes against falling or dropping after switching off the motor power by, for example:
  - mechanically securing the vertical axes,
  - adding an external braking/ arrester/ clamping mechanism or
  - ensuring sufficient equilibration of the vertical axes.

The standard equipment motor brake or an external brake controlled directly by the drive controller are not sufficient to guarantee personal safety!



- ⇒ Disconnect electrical power to the equipment using a master switch and secure the switch against reconnection for:
  - maintenance and repair work
  - cleaning of equipment
  - long periods of discontinued equipment use
- Prevent the operation of high-frequency, remote control and radio equipment near electronics circuits and supply leads. If the use of such devices cannot be avoided, verify the system and the installation for possible malfunctions in all possible positions of normal use before initial startup. If necessary, perform a special electromagnetic compatibility (EMC) test on the installation.

## **Protection Against Magnetic and Electromagnetic Fields During Operation and Mounting**

Magnetic and electromagnetic fields generated by current-carrying conductors and permanent magnets in motors represent a serious personal danger to those with heart pacemakers, metal implants and hearing aids.



## Health hazard for persons with heart pacemakers, metal implants and hearing aids in proximity to electrical equipment!

- ⇒ Persons with heart pacemakers and metal implants are not permitted to enter following areas:
  - Areas in which electrical equipment and parts are mounted, being operated or commissioned.
  - Areas in which parts of motors with permanent magnets are being stored, repaired or mounted.
- ⇒ If it is necessary for somebody with a pacemaker to enter such an area, a doctor must be consulted prior to doing so. The interference immunity of present or future implanted heart pacemakers differs greatly, so that no general rules can be given.
- ⇒ Those with metal implants or metal pieces, as well as with hearing aids must consult a doctor before they enter the areas described above. Otherwise health hazards may occur.

## **Protection Against Contact with Hot Parts**



## Hot surfaces at motor housings, on drive controllers or chokes! Danger of injury! Danger of burns!

- ⇒ Do not touch surfaces of device housings and chokes in the proximity of heat sources! Danger of burns!
- ⇒ Do not touch housing surfaces of motors! Danger of burns!
- ⇒ According to operating conditions, temperatures can be higher than 60 °C, 140 °F during or after operation.
- ⇒ Before accessing motors after having switched them off, let them cool down for a sufficiently long time. Cooling down can require **up to 140 minutes!** Roughly estimated, the time required for cooling down is five times the thermal time constant specified in the Technical Data.
- ⇒ After switching drive controllers or chokes off, wait 15 minutes to allow them to cool down before touching them.
- ⇒ Wear safety gloves or do not work at hot surfaces.
- ⇒ For certain applications, the manufacturer of the end product, machine or installation, according to the respective safety regulations, has to take measures to avoid injuries caused by burns in the end application. These measures can be, for example: warnings, guards (shielding or barrier), technical documentation.



## **Protection During Handling and Mounting**

In unfavorable conditions, handling and assembling certain parts and components in an improper way can cause injuries.



## Risk of injury by improper handling! Bodily injury by bruising, shearing, cutting, hitting!

- ⇒ Observe the general construction and safety regulations on handling and assembly.
- ⇒ Use suitable devices for assembly and transport.
- ⇒ Avoid jamming and bruising by appropriate measures.
- ⇒ Always use suitable tools. Use special tools if specified.
- ⇒ Use lifting equipment and tools in the correct manner.
- ⇒ If necessary, use suitable protective equipment (for example safety goggles, safety shoes, safety gloves).
- ⇒ Do not stand under hanging loads.
- ⇒ Immediately clean up any spilled liquids because of the danger of skidding.

## **Battery Safety**

Batteries consist of active chemicals enclosed in a solid housing. Therefore, improper handling can cause injury or damages.



#### Risk of injury by improper handling!

- ⇒ Do not attempt to reactivate low batteries by heating or other methods (risk of explosion and cauterization).
- ⇒ Do not recharge the batteries as this may cause leakage or explosion.
- ⇒ Do not throw batteries into open flames.
- ⇒ Do not dismantle batteries.
- Do not damage electrical parts installed in the devices.

#### Note:

Environmental protection and disposal! The batteries installed in the product are considered dangerous goods during land, air, and sea transport (risk of explosion) in the sense of the legal regulations. Dispose of used batteries separate from other waste. Observe the local regulations in the country of assembly.



## **Protection Against Pressurized Systems**

According to the information given in the Project Planning Manuals, motors cooled with liquid and compressed air, as well as drive controllers, can be partially supplied with externally fed, pressurized media, such as compressed air, hydraulics oil, cooling liquids, and cooling lubricating agents. In these cases, improper handling of external supply systems, supply lines, or connections can cause injuries or damages.



## Risk of injury by improper handling of pressurized lines!

- ⇒ Do not attempt to disconnect, open, or cut pressurized lines (risk of explosion).
- Observe the respective manufacturer's operating instructions.
- Before dismounting lines, relieve pressure and empty medium.
- ⇒ Use suitable protective equipment (for example safety goggles, safety shoes, safety gloves).
- Immediately clean up any spilled liquids from the floor.

#### Note:

Environmental protection and disposal! The agents used to operate the product might not be economically friendly. Dispose of ecologically harmful agents separate from other waste. Observe the local regulations in the country of assembly.




Rexroth IndraDyn A Technical Data 4-1

## 4 Technical Data

## 4.1 Operating Modes

Bosch Rexroth motors are documented according to the test criteria and measuring methods of EN 60034-1. Stated technical data refer to operating modes S1 (continuous operation) and S6 (periodic operation), each with surface cooling through direct-connected fan units or liquid cooling.

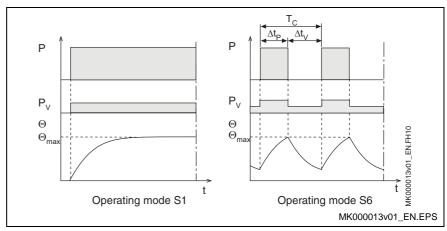

P: Load

 $P_V$ : Electric losses  $\Theta$ : Temperature

 $\Theta_{\text{max}}$ : Highest temperature (stator)

t: Time T<sub>C</sub>: Cycle time

 $\Delta t_P$ : Operating time with constant load

 $\Delta t_V$ : Idling time

Fig. 4-1: Operating modes according to EN 60034-1:1998

#### **ON Time**

Operating mode S6 is supplemented by specification of the ON time (ED) in %. The operating time is calculated as follows:

$$ED = \frac{\Delta t_p}{T_c} \cdot 100\%$$

ED: Cyclic duration factor in %

T<sub>C</sub>: Cycle time

 $\Delta t_P$ : Operating time with constant load

Fig. 4-2: Cyclic duration factor

## 4.2 Operating Behavior

In the following, parameters and characteristic curves of the IndraDyn A series and specifications of the motor data sheet are explained.

#### **Parameters**

Rated torque M<sub>N</sub>

Available torque that can be output at the rated speed in operating mode S1 (continuous operation). Unit = Newton meters (Nm).

Rated performance P<sub>N</sub>

Mechanical power output of the motor while running at the rated speed and rated torque. Unit = kilowatts (kW).

Rated current I<sub>N</sub>

Phase current of the motor while running at the rated speed and rated torque, specified as a root-mean-squared value in amps (A).

Rated speed n<sub>N</sub>

Typical working speed defined by the manufacturer. Depending on the particular application, other working speeds are possible (see speed-torque curve).

Maximum torque M<sub>max</sub>

Maximum torque that can be output at peak current  $I_{\text{max}}$ , given in Newton-meters (Nm).

 $\Rightarrow$  The maximum torque that can be attained depends on the drive control device used. Only the specified maximum torque  $M_{max}$  in the selection lists is binding.

Maximum output P<sub>max</sub>

Maximum power output of the motor at 540V<sub>DC</sub>, given in kilowatts (kW).

⇒ The maximum output that can be attained depends on the drive controller that is used and on the power supply. Only the maximum output specified in the selection data is binding.

Maximum current I<sub>max</sub>

Maximum short-term branch current of the motor permitted without damaging the winding, given as a root-mean-square value in amperes (A).

⇒ To avoid a thermal overload when operating the motor with external controllers, note that the current is to be reduced after 400 ms to 2.2x the rated current and that I<sub>max</sub> may be reapplied only if the winding temperature is in the permitted range if the degree of relief of the motor permits this.

Maximum speed n<sub>max</sub>

The maximum permissible speed of the motor in (min-1) in dependence on the bearing type according to type code. Usually, the maximum speed is limited by mechanical factors as e.g. centrifugal forces, bearing strain, or use of a holding brake.

Torque constant in nominal point  $K_{M_N}$  at 20° C

Ratio of torque increase to motor torque-forming current. Unit = Nm/A. Valid up to rated current  $I_N$ .

Discharge capacity Cab

Capacity of short-circuited power connections U, V, W against the motor housing. Unit = nF.

Power wire cross-section A

Rated for cable assemblies with current carrying capacity according to VDE0298-4 (1992) and installation type B2 according to EN 60204-1 (1993) at 40°C ambient temperature. The power wire cross section in (mm²) can deviate depending on the selected type of connection - plug or terminal box. Therefore, when selecting the appropriate power cable, pay attention to the information in Chapter 8 "Connection Techniques" and to the documentation "Rexroth Connection Cable" (MNR R911282688).

Rexroth IndraDyn A Technical Data 4-3

Rotor moment of inertia J<sub>rot</sub>


The moment of inertia of the rotor without bearing, brake and encoder. Unit = kgm<sup>2</sup>.

Motor mass m

Mass of the motor in standard version, without holding brake, specified in kilograms (kg).

Thermal time constant Tth

Duration of the temperature rise to 63% of the final temperature of the motor under load with rated torque in S1 operation and surface ventilation by direct-connected fan units.

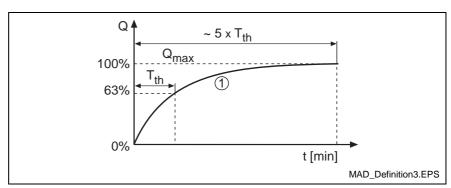

(1): Curve of the motor temperature over time

T<sub>th</sub>: Thermal time constant


Fig. 4-3: Thermal time constant

Cycle time T<sub>C</sub>

Duration of the cycle in S6 operating mode until the thermally steady-state condition is reached when the maximum temperature equals the end temperature in S1 operation (see Fig. 4-1).

**Number of pole pairs p** Number of pole pairs of the motor.

#### **Characteristic Curve**

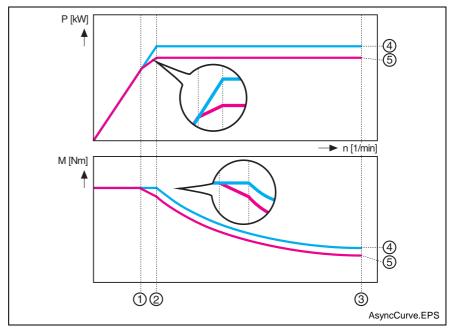

- P: mechanical output in kilowatts [kW]
- M: torque available on the output shaft, in Newton meters [Nm]
- n: motor speed, in revolutions per minute [min<sup>-1</sup>]
- (1): key speed ( $n_1$  in data sheet)
- (2): rated speed (n<sub>N</sub>)
- (3):  $\max$  torque  $(n_{max})$
- (4): characteristic curve without de-rating
- (5): characteristic curve with de-rating

Fig. 4-4: IndraDyn A sample characteristic curves

Note:

The achievable torque depends on the drive controller used. The reference value for the characteristic curves of the motor is an unregulated intermediate circuit voltage of 540V<sub>DC</sub>.

#### **Explanation:**

(1) Key speed

Start of a drop in speed and power before reaching the rated speed  $n_N$ . This behavior is called **de-rating** and occurs only with some versions of motor windings. Without de-rating, the key speed equals the rated speed.

Until the key speed is reached, continuous current at standstill  $I_1$  applies (root-mean-square value). With no de-rating, the continuous current at standstill equals the rated current  $I_N$ .

Until the key speed is reached, continuous torque at standstill  $M_1$  is available for S1 operation. Without de-rating, the continuous torque at standstill equals rated torque  $M_N$ .

With an effective de-rating, torque is reduced when the key speed is reached. Fig. 4-4 shows to characteristics curves starting at the key speed.

(2) Rated speed

Without de-rating effect, induction motors provide a constant torque up to the rated speed (rated torque); starting at the rated speed, constant rated power  $P_N$  is available.

(3) Maximum speed

The speed limit up to which a motor can be safely operated. This is usually limited by the mechanical construction (bearing) or by using a holding brake.

**Technical Data 4-5** Rexroth IndraDyn A

#### 4.3 **Data Sheet MAD100B**

Description	Symbol	Unit	MAD100B					
Motor data 1)		l.						
Winding			0050	0100	0150	0200	0250	
Rated torque	M <sub>N</sub>	Nm	34	31	30	28	25	
Rated power	P <sub>N</sub>	kW	1.8	3.2	4.7	5.9	6.5	
Rated current	I <sub>N</sub>	Α	5.3	8.9	12.9	14.6	16.2	
Rated speed	n <sub>N</sub>	rpm	500	1000	1500	2000	2500	
Key speed	n <sub>1</sub>	rpm	500	500	1000	1500	2000	
Maximum torque	M <sub>max</sub>	Nm	75	75	68	66	61	
Maximum output	P <sub>max</sub>	kW	3.7	6.6	9	12.1	13.3	
Maximum current	I <sub>max</sub>	Α	10.2	18	23.5	28.9	28.3	
N	n <sub>max</sub>	rpm	3000	6000	20.0	9000		
Maximum speed R	n <sub>max</sub>	rpm	3000	6000				
with bearing V	n <sub>max</sub>	rpm	not available					
	n <sub>max</sub>	rpm	3000	6000	9000	7		
Continuous torque at standstill	M <sub>n1</sub>	Nm	34	34	31	30	28	
Continuous current at standstill	I <sub>n1</sub>	A	5.3	9.4	12.5	15.3	16.2	
Torque constant at 20° C	K <sub>M_N</sub>	Nm/A	7.66	4.31	3.03	2.41	2.11	
Thermal time constant	T <sub>th</sub>	min	7.00 4.51 5.03 2.41 2.11					
Duty cycle time (S6-44%)	T <sub>C</sub>	min	10					
Discharge capacity	C <sub>ab</sub>	nF	6	5.7	6	6	6	
Number of pole pairs	р			5.7	3	U	U	
Power wire cross-section <sup>2</sup> )	A	mm²	1	1	1 1	1.5	2.5	
Moment of inertia <sup>3</sup> )	J <sub>rot</sub>	kgm²	0.019					
Mass <sup>4</sup> )	m	kg	43					
Sound pressure level <sup>5</sup> )	L <sub>P</sub>	dB(A)	70 (+3)					
Ambient temperature in operation	T <sub>um</sub>	°C	0+40					
Insulation class according to DIN EN 60034-1	- 4111		F					
Motor protection class			IP65					
Holding brake (optional)			Electrically clamping Electrically releasing					
Transmittable torque	M <sub>4</sub>	Nm	30 24					
Connection voltage	U <sub>Br</sub>	V	DC 24 ± 10 %					
Rated current	I <sub>Br</sub>	Α	0.9					
Moment of inertia	$J_{Br}$	kgm²	0.00056					
Max. permissible braking energy	W <sub>max</sub>	Ws	20000					
Disconnection time	t <sub>2</sub>	ms	50 90					
Connection time	t <sub>1</sub>	ms		42		30		
Maximum speed brake	n <sub>Br_max</sub>	rpm		10000		10000		
Mass	m	kg	2 1.6					
Fan		-	Axial fan					
Air current			$B \rightarrow A$ , blowing					
Connection voltage	U <sub>N</sub>	V	3 x 400V ±15 %, 50/60Hz 3 x 480V ±10 %, 50/60 Hz					
Power consumption	S <sub>N</sub>	VA	83 100					
			0.12					
Fan flow <sup>6</sup> )	I <sub>N</sub>	Α			0.12			

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values. Reference value =  $540 \text{ V}_{DC}$  intermediate circuit.

Fig. 4-5: Data sheet MAD100B

Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Value without holding brake.
Value without holding brake, with fan.
At 1m distance, with PWM = 4 kHz

With  $I_N + 20\%$  and higher, fans should be monitored.

Value without holding brake. Observe maximum speed of holding brake.

## **Characteristic Curves of MAD100B Motors**

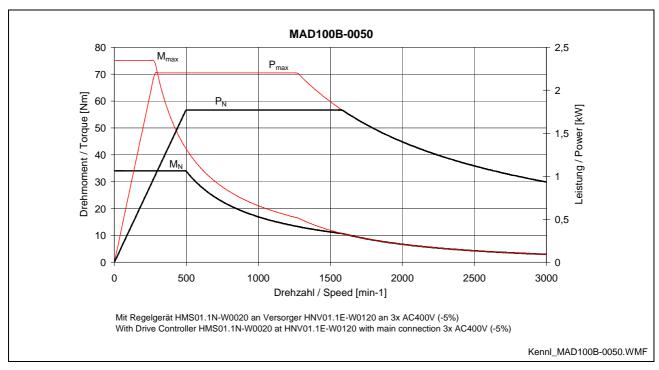


Fig. 4-6: Characteristic curve of MAD100B-0050 motors

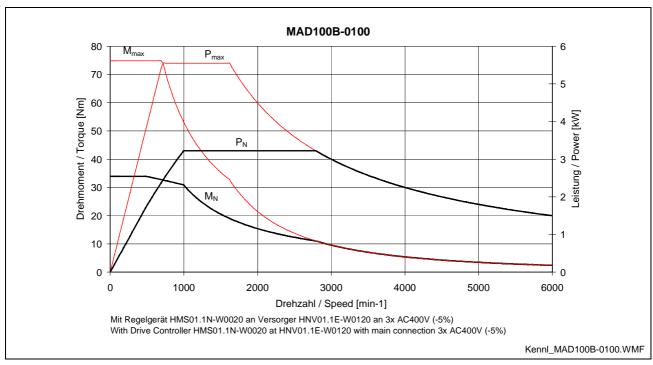


Fig. 4-7: Characteristic curve of MAD100B-0100 motors

Rexroth IndraDyn A Technical Data 4-7

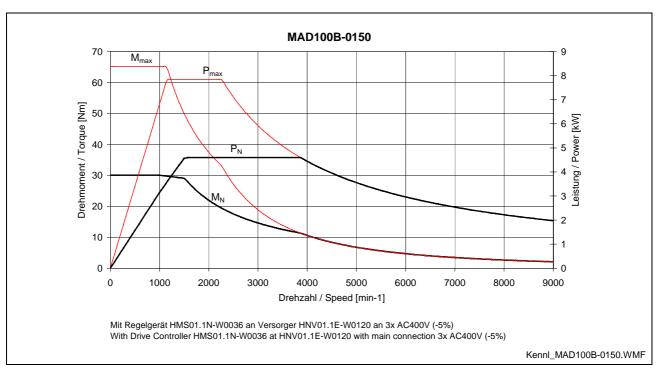


Fig. 4-8: Characteristic curve of MAD100B-0150 motors

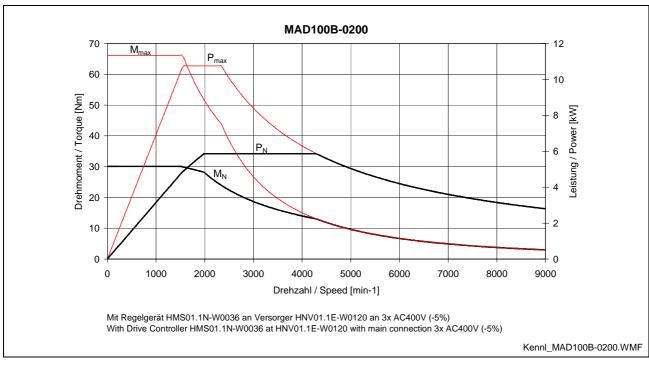


Fig. 4-9: Characteristic curve of MAD100B-0200 motors

4-8 Technical Data Rexroth IndraDyn A

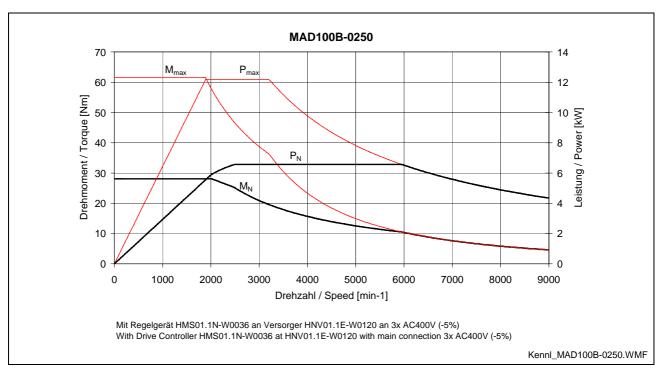


Fig. 4-10: Characteristic curve of MAD100B-0250 motors

**Technical Data 4-9** Rexroth IndraDyn A

#### **Data Sheet MAD100C** 4.4

Description	Symbol	Unit			MAD100C					
Motor data 1)	•									
Winding			0050	0100	0150	0200	0250			
Rated torque	M <sub>N</sub>	Nm	51	50	48	45	40			
Rated power	P <sub>N</sub>	kW	2.7	5.2	7.5	9.4	10.5			
Rated current	I <sub>N</sub>	Α	8.2	13.2	19.7	25.7	27.8			
Rated speed	n <sub>N</sub>	rpm	500	1000	1500	2000	2500			
Key speed	n <sub>1</sub>	rpm	500	500	1000	1500	2000			
Maximum torque	M <sub>max</sub>	Nm	112	119	110	105	99			
Maximum output	P <sub>max</sub>	kW	5.5	10.6	15.4	19.3	21.5			
Maximum current	I <sub>max</sub>	Α	15.9	25.4	39	47.3	44.9			
١	N n <sub>max</sub>	rpm	3000	6000		9000				
Maximum speed F	R n <sub>max</sub>	rpm	3000 6000 6300							
with bearing	/ n <sub>max</sub>	rpm		•	not available					
		rpm	3000	6000	9000	110	00 <sup>7</sup> )			
Continuous torque at standstil		Nm	51	54	50	48	45			
Continuous current at standsti	ill I <sub>n1</sub>	Α	8.2	13.8	20.3					
Torque constant at 20° C	K <sub>M_N</sub>	Nm/A	7.4	4.94	2.94					
Thermal time constant	T <sub>th</sub>	min		•	30					
Duty cycle time (S6-44%)	T <sub>C</sub>	T <sub>C</sub> min				10				
Discharge capacity	C <sub>ab</sub>	nF	9	8.5	8.13	8.5	8.5			
Number of pole pairs	р			3						
Power wire cross-section <sup>2</sup> )	A	mm²	1	1.5	2.5	4	4			
Moment of inertia 3)	$J_{rot}$	kgm²								
Mass <sup>4</sup> )	m	kg			59					
Sound pressure level <sup>5</sup> )	L <sub>P</sub>	dB(A)			70 (+3)					
Ambient temperature in opera	tion T <sub>um</sub>	°C			0+40					
Insulation class according to E EN 60034-1	DIN				F					
Motor protection class					IP65					
Holding brake (optional)			Electri	cally clampin	g E	Electrically re	leasing			
Transmittable torque	M <sub>4</sub>	Nm		30		24				
Connection voltage	$U_Br$	V			DC 24 ± 10 %					
Rated current	$I_{Br}$	Α		0.9		1.1				
Moment of inertia	$J_{Br}$	kgm²			0.00056					
Max. permissible braking ener	gy W <sub>max</sub>	Ws			20000					
Disconnection time	t <sub>2</sub>	ms		50		90				
Connection time	t <sub>1</sub>	ms		42		30				
Maximum speed brake	n <sub>Br_max</sub>	rpm		10000		10000				
Mass	m	kg		2		1.6				
Fan					Axial fan					
Air current					$B \rightarrow A$ , blowing					
Connection voltage	U <sub>N</sub>	V	3 x 400V ±15 %, 50/60Hz 3 x 480V ±10 %, 50/60 Hz							
Power consumption	S <sub>N</sub>	VA			83 100					
Fan flow <sup>6</sup> )	I <sub>N</sub>	Α			0.12					

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values. Reference value = 540 V<sub>DC</sub> intermediate circuit.

Fig. 4-11: Data sheet MAD100C

Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Value without holding brake.

Value without holding brake, with fan. At 1m distance, with PWM = 4 kHz

With  $I_N$  + 20% and higher, fans should be monitored.

Value without holding brake. Observe maximum speed of holding brake.

# **Characteristic Curves of MAD100C Motors**

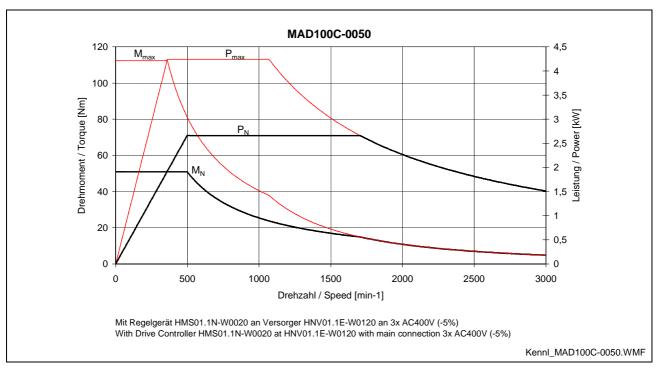


Fig. 4-12: Characteristic curve of MAD100C-0050 motors

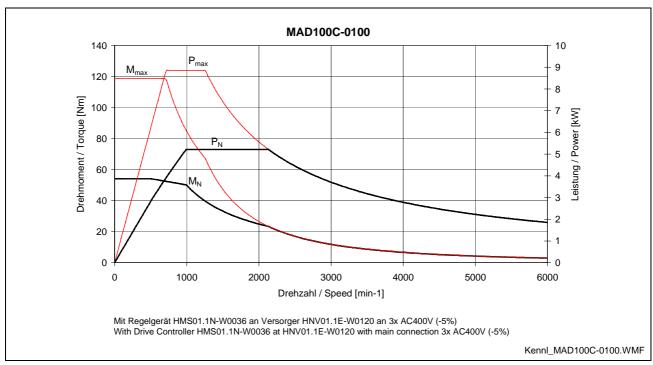


Fig. 4-13: Characteristic curve of MAD100C-0100 motors

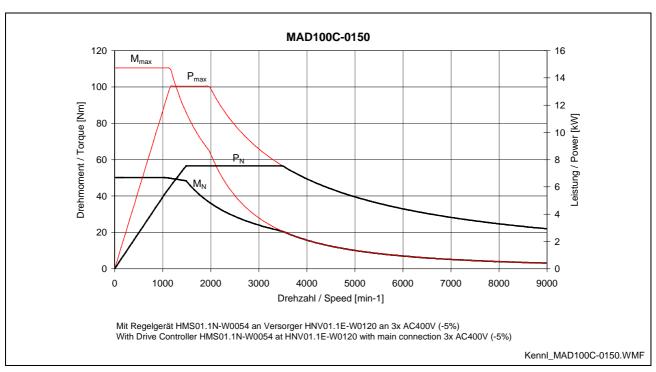


Fig. 4-14: Characteristic curve of MAD100C-0150 motors

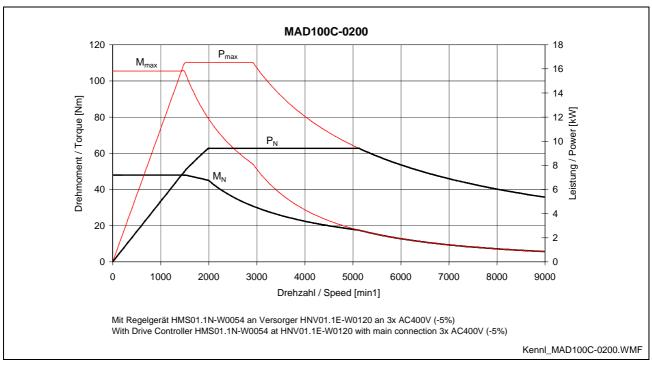


Fig. 4-15: Characteristic curve of MAD100C-0200 motors

4-12 Technical Data Rexroth IndraDyn A

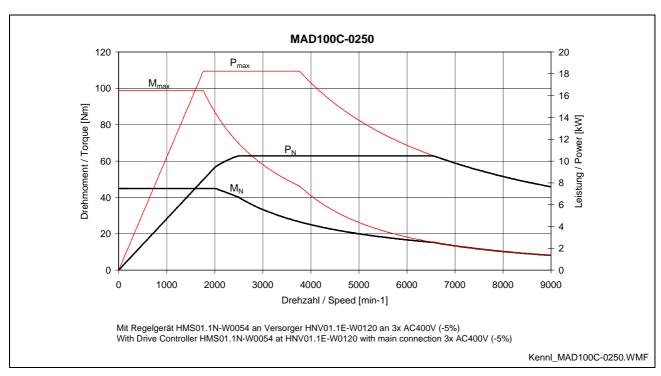


Fig. 4-16: Characteristic curve of MAD100C-0250 motors

**Technical Data 4-13** Rexroth IndraDyn A

#### 4.5 **Data Sheet MAD100D**

Symbo	ol Unit			MAD100D				
•	•							
		0050	0100	0150	0200	0250		
M <sub>N</sub>	Nm	70	64	59	54	50		
P <sub>N</sub>	kW	3.7	6.7	9.3	11.3	13.1		
I <sub>N</sub>	Α	10.1	19.3	25.6	27.2	32.4		
n <sub>N</sub>	rpm	500	1000	1500	2000	2500		
n <sub>1</sub>	rpm	500	500	1000	1500	2000		
M <sub>max</sub>	Nm	154	146	141	130	119		
		7.6	13.7	19.1	23.2	26.9		
I <sub>max</sub>	Α	19.1	34.3	47.6	47.6 52.7 64			
N n <sub>max</sub>	rpm	3000	6000 9000					
R n <sub>max</sub>	rpm	3000 6000 6300						
V n <sub>max</sub>	rpm		1	not available				
H n <sub>max</sub>	rpm	3000	6000	9000	110	00 <sup>7</sup> )		
	Nm	70	70	64		54		
till I <sub>n1</sub>	Α	10.1	20.4	26.8	28.7	34.7		
	Nm/A	8.52	4.5	3.19				
T <sub>th</sub>	min		1	30	30			
T <sub>C</sub>	min			10				
C <sub>ab</sub>	nF	11	11	1 10.2 11.5				
р								
A	mm²	1	2.5	4	4	6		
$J_{rot}$	kgm²		1	0.0392		•		
m	kg			72				
L <sub>P</sub>	dB(A)			70 (+3)				
ation T <sub>um</sub>	°C			0+40				
DIN				F				
				IP65				
		Electri	cally clamping	g E	lectrically re	leasing		
M <sub>4</sub>	Nm		30		24			
U <sub>Br</sub>	V			DC 24 ± 10 %				
I <sub>Br</sub>	Α		0.9		1.1			
$J_{Br}$	kgm²			0.00056				
rgy W <sub>max</sub>	Ws			20000				
t <sub>2</sub>	ms		50		90			
t <sub>1</sub>	ms		42		30			
n <sub>Br_ma</sub>	<sub>x</sub> rpm		10000		10000			
m	kg		2		1.6			
				Axial fan				
		$B \rightarrow A$ , blowing						
				$D \rightarrow A$ , blowing				
U <sub>N</sub>	V	3 x	400V ±15 %, 50	$0/60$ Hz $3 \times 48$	0V ±10 %, 50/6	0 Hz		
U <sub>N</sub>	V VA	3 x	400V ±15 %, 50		0V ±10 %, 50/6	0 Hz		
		3 x	400V ±15 %, 50	0/60Hz 3 x 48	0V ±10 %, 50/6	0 Hz		
	MN	MN Nm	MN Nm 70	MN	MN Nm	MN		

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values. Reference value =  $540 \text{ V}_{DC}$  intermediate circuit.

Fig. 4-17: Data sheet MAD100D

Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Value without holding brake.
Value without holding brake, with fan.
At 1m distance, with PWM = 4 kHz

With  $I_N + 20\%$  and higher, fans should be monitored.

Value without holding brake. Observe maximum speed of holding brake.

### **Characteristic Curves of MAD100D Motors**

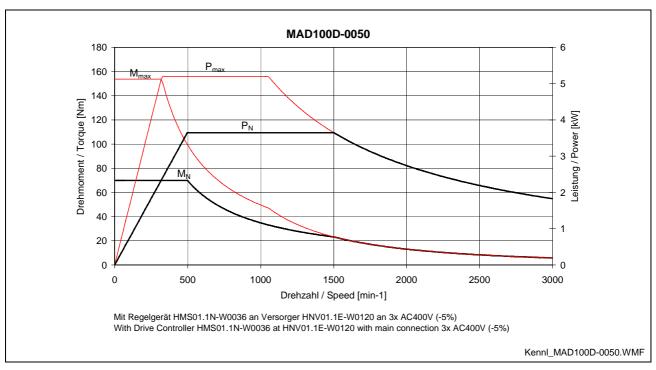


Fig. 4-18: Characteristic curve of MAD100D-0050 motor

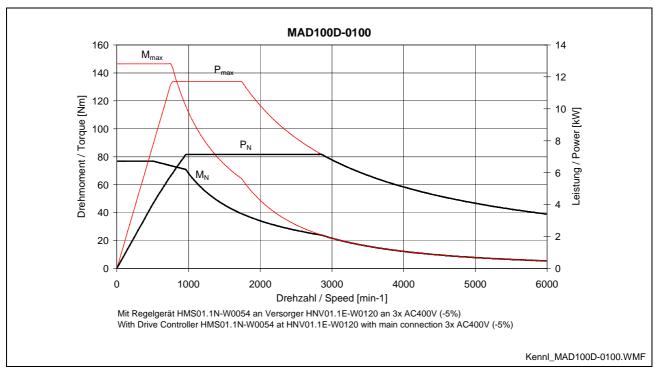


Fig. 4-19: Characteristic curve of MAD100D-0100 motors

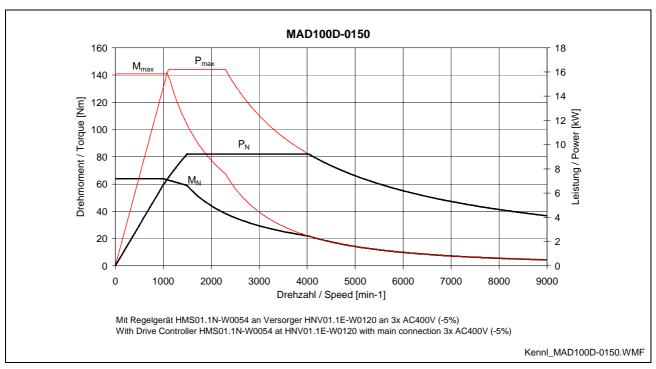


Fig. 4-20: Characteristic curve of MAD100D-0150 motors

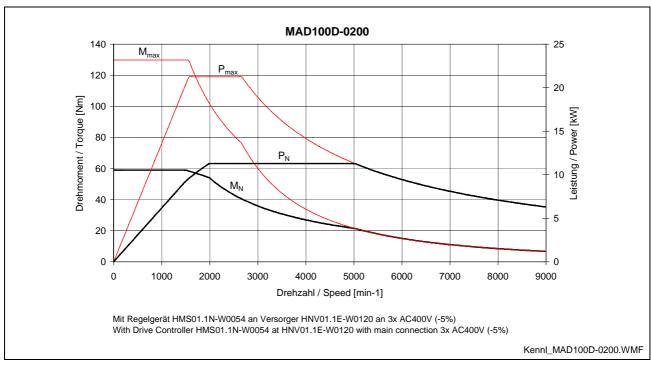


Fig. 4-21: Characteristic curve of MAD100D-0200 motors

4-16 Technical Data Rexroth IndraDyn A

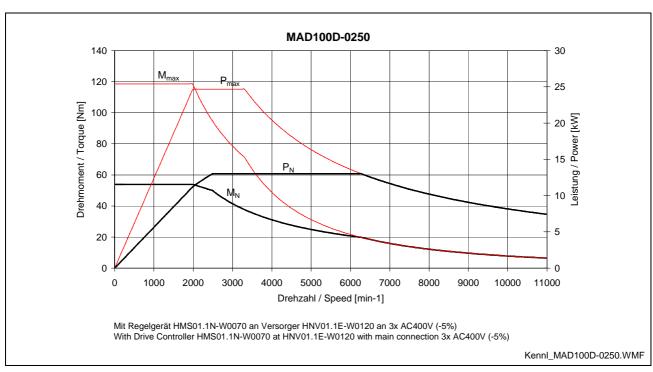


Fig. 4-22: Characteristic curve of MAD100D-0250 motors

**Technical Data 4-17** Rexroth IndraDyn A

#### 4.6 **Data Sheet MAD130B**

Description		Symbol	Unit			MAD130B					
Motor data 1)											
Winding				0050	0100	0150	0200	0250			
Rated torque		M <sub>N</sub>	Nm	95	100	85	80	75			
Rated power		P <sub>N</sub>	kW	5	10.5	13.3	16.8	19.6			
Rated current		I <sub>N</sub>	Α	12.8	26.9	34.9	43	47.2			
Rated speed		n <sub>N</sub>	rpm	500	1000	1500	2000	2500			
Key speed		n <sub>1</sub>	rpm	500	500	1000	1500	2000			
Maximum torque		M <sub>max</sub>	Nm	209	230	200	187	176			
Maximum output		P <sub>max</sub>	kW	10.3	21.5	27.4	34.4	40.2			
Maximum current		I <sub>max</sub>	Α	25.4	53.7	71	80.7	83.3			
	N	n <sub>max</sub>	rpm	3000	6000		7500				
Maximum speed	R	n <sub>max</sub>	rpm	3000		525	50				
with bearing	V	n <sub>max</sub>	rpm	3000							
	Н	n <sub>max</sub>	rpm	3000	6000	9000 <sup>7</sup> )	1000	00 <sup>7</sup> )			
Continuous torque at stan	dstill	M <sub>n1</sub>	Nm	95	110	95	85	80			
Continuous current at star	ndstill	I <sub>n1</sub>	Α	12.8	28.7	37.4	44.5	47.7			
Torque constant at 20° C		K <sub>M_N</sub>	Nm/A	8.49	4.79	3.08					
Thermal time constant		T <sub>th</sub>	min				45				
Duty cycle time (S6-44%)		T <sub>C</sub>	min	10	6.4	10	10	5			
Discharge capacity		C <sub>ab</sub>	nF	16	15.8	15.8					
Number of pole pairs		p				3					
Power wire cross-section	2)	A	mm²	1	4	6	10	10			
Moment of inertia 3)	,	J <sub>rot</sub>	kgm²								
Mass <sup>4</sup> )		m	kg			100					
Sound pressure level <sup>5</sup> )		L <sub>P</sub>	dB(A)			70 (+3)					
Ambient temperature in or	peration	T <sub>um</sub>	°C			0+40					
Insulation class according EN 60034-1	to DIN					F					
Motor protection class						IP65					
Holding brake (option	nal)			Electric	ally clamping		ectrically rele	easing			
Transmittable torque		M <sub>4</sub>	Nm		100		80				
Connection voltage		U <sub>Br</sub>	V			DC 24 ± 10 %					
Rated current		I <sub>Br</sub>	Α		1.5		1.6				
Moment of inertia		J <sub>Br</sub>	kgm²			0.002					
Max. permissible braking	enerav	W <sub>max</sub>	Ws			30000					
Disconnection time	- 37	t <sub>2</sub>	ms		65	1	140				
Connection time	+	t <sub>1</sub>	ms		110		50				
Maximum speed brake	+	n <sub>Br_max</sub>	rpm		8000		8000				
Mass		m	kg			8					
Fan						Axial fan					
Air current					I	$B \rightarrow A$ , blowing					
Connection voltage		U <sub>N</sub>	V	3 x 4			0V ±10 %. 50/60	) Hz			
Power consumption		S <sub>N</sub>	VA			139 208		· ·=			
Fan flow <sup>6</sup> )		I <sub>N</sub>	A			0.20 0.25					
Medium air voltage		V	m³/h			1000					
1) Values determined a	acardina ta	-		rant and valtage	a anacified as re		values				

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values.

Fig. 4-23: Data sheet MAD130B

Reference value =  $540 \text{ V}_{DC}$  intermediate circuit.

Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Value without holding brake.
Value without holding brake, with fan.

At 1m distance, with PWM = 4 kHz

With  $I_N$  + 20% and higher, fans should be monitored.

Value without holding brake. Observe maximum speed of holding brake.

## **Characteristic Curves of MAD130B Motors**

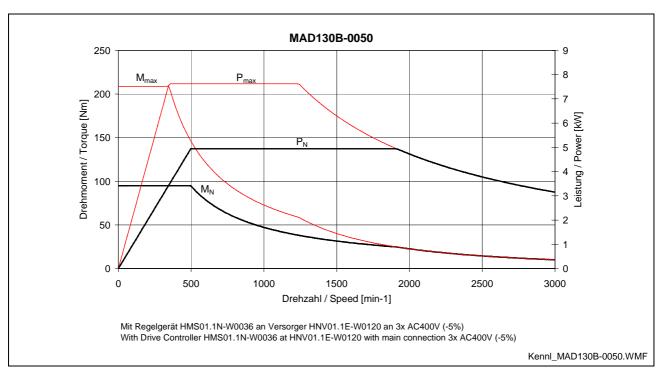


Fig. 4-24: Characteristic curve of MAD130B-0050 motors

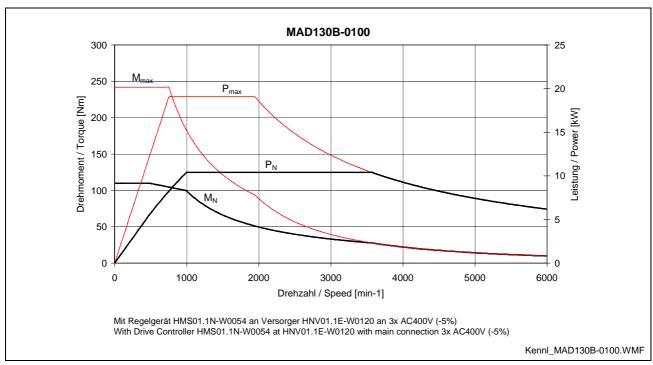


Fig. 4-25: Characteristic curve of MAD130B-0100 motors

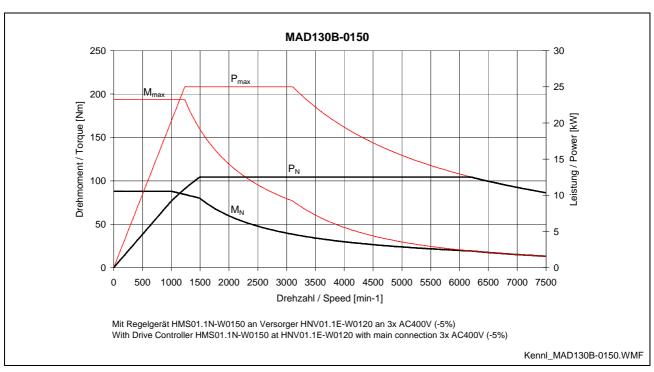


Fig. 4-26: Characteristic curve of MAD130B-0150 motors

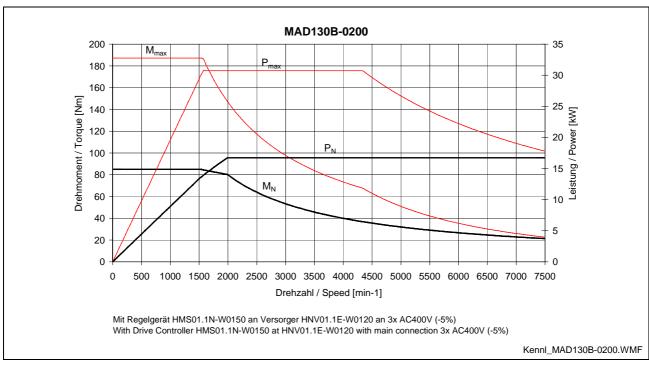


Fig. 4-27: Characteristic curve of MAD130B-0200 motors

4-20 Technical Data Rexroth IndraDyn A

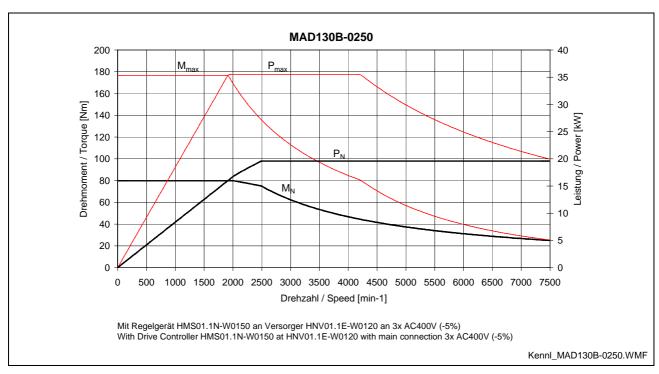


Fig. 4-28: Characteristic curve of MAD130B-0250 motors

**Technical Data 4-21** Rexroth IndraDyn A

#### 4.7 **Data Sheet MAD130C**

Description		Symbol	Unit			MAD130C			
Motor data 1)	•								
Winding				0050	0100	0150	0200	0250	
Rated torque		M <sub>N</sub>	Nm	140	125	117	110	100	
Rated power		P <sub>N</sub>	kW	7.3	13.1	18.4	23	26.2	
Rated current		I <sub>N</sub>	Α	19.7	36.2	48.9	57	62	
Rated speed		n <sub>N</sub>	rpm	500	1000	1500	2000	2500	
Key speed		n <sub>1</sub>	rpm	500	500	1000	1500	2000	
Maximum torque		M <sub>max</sub>	Nm	308	305	275	253	250	
Maximum output		$P_{\text{max}}$	kW	15	26.9	37.7	47.2	53.7	
Maximum current		I <sub>max</sub>		35.3	74.3	93.3	106.7	114.9	
	N	n <sub>max</sub>	rpm	3000	6000		7500		
Maximum speed	R	n <sub>max</sub>	rpm	3000		52	50		
with bearing	V	n <sub>max</sub>	rpm	3000	6000		7500		
	Н	n <sub>max</sub>	rpm	3000	6000	9000 7)	1000	00 <sup>7</sup> )	
Continuous torque at stand	dstill	M <sub>n1</sub>	Nm	140	140	125 115 11			
Continuous current at stan	dstill	I <sub>n1</sub>	Α	19.7	39.2	51.0			
Torque constant at 20° C		K <sub>M_N</sub>	Nm/A	9.31	4.33	3.1	2.64	2.1	
Thermal time constant		T <sub>th</sub>	min			50			
Duty cycle time (S6-44%)		Tc	min			10			
Discharge capacity		C <sub>ab</sub>	nF	20	20 20.5 19.3			20	
Number of pole pairs		р		3					
Power wire cross-section	<sup>2</sup> )	A	mm²	2.5	6 10 16			16	
Moment of inertia 3)		$J_{rot}$	kgm²	0.108					
Mass <sup>4</sup> )		m	kg			122			
Sound pressure level 5)		L <sub>P</sub>	dB(A)			70 (+3)			
Ambient temperature in op	eration	T <sub>um</sub>	°C			0+40			
Insulation class according EN 60034-1	to DIN					F			
Motor protection class						IP65			
Holding brake (option	al)			Electri	cally clampin	g	Electrically re	leasing	
Transmittable torque		M <sub>4</sub>	Nm		100		80		
Connection voltage		U <sub>Br</sub>	V			DC 24 ± 10 %			
Rated current		$I_{Br}$	Α		1.5		1.6		
Moment of inertia		$J_{Br}$	kgm²			0.002			
Max. permissible braking e	energy	$W_{\text{max}}$	Ws			30000			
Disconnection time		t <sub>2</sub>	ms		65		140		
Connection time		t <sub>1</sub>	ms		110		50		
Maximum speed brake		n <sub>Br_max</sub>	rpm		8000		8000		
Mass		m	kg			8			
Fan						Axial fan			
Air current						$B \rightarrow A$ , blowing			
Connection voltage		U <sub>N</sub>	V	3 x	400V ±15 %, 50	/60Hz 3 x 48	0V ±10 %, 50/6	) Hz	
Power consumption		S <sub>N</sub>	VA			139 208			
Fan flow <sup>6</sup> )		I <sub>N</sub>	Α			0.20 0.25			
Medium air voltage		V	m³/h			1000			
1) Values determined as		150.000			enocified as re	-1			

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values. Reference value = 540 V<sub>DC</sub> intermediate circuit.

Fig. 4-29: Data Sheet MAD130C

Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Value without holding brake.

Value without holding brake, with fan.

At 1m distance, with PWM = 4 kHz

With  $I_N$  + 20% and higher, fans should be monitored. Value without holding brake. Observe maximum speed of holding brake.

## **Characteristic Curves of MAD130C Motors**

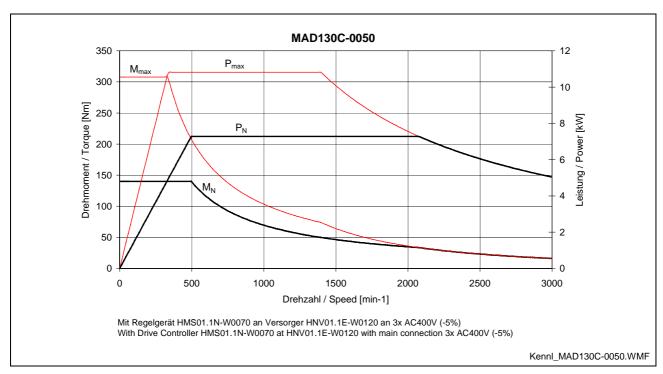


Fig. 4-30: Characteristic curve of MAD130C-0050 motors

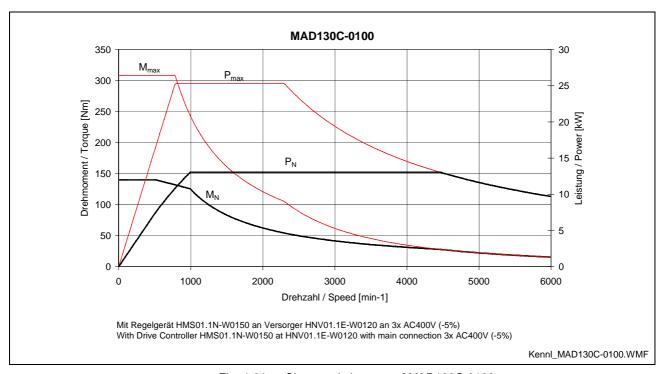


Fig. 4-31: Characteristic curve of MAD130C-0100 motors

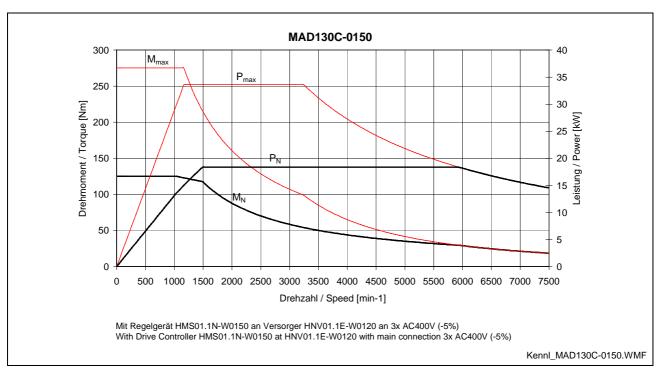


Fig. 4-32: Characteristic curve of MAD130C-0150 motors

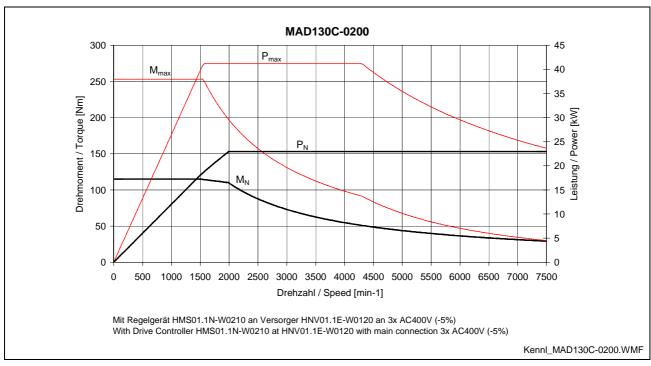


Fig. 4-33: Characteristic curve of MAD130C-0200 motors

4-24 Technical Data Rexroth IndraDyn A

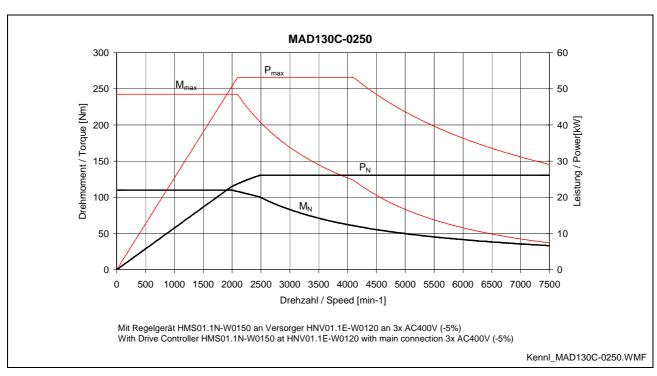


Fig. 4-34: Characteristic curve of MAD130C-0250 motors

**Technical Data 4-25** Rexroth IndraDyn A

#### 4.8 **Data Sheet MAD130D**

Description	S	ymbol	Unit			MAD130D			
Motor data 1)	•		1						
Winding				0050	0100	0150	0200	0250	
Rated torque		M <sub>N</sub>	Nm	180	170	155	150	120	
Rated power		P <sub>N</sub>	kW	9.4	17.8	24.3	31.4	31.4	
Rated current		I <sub>N</sub>	Α	24.2	43.7	61.5	71.3	72	
Rated speed		n <sub>N</sub>	rpm	500	1000	1500	2000	2500	
Key speed		n <sub>1</sub>	rpm	500	500	1000	1500	2000	
Maximum torque	1	M <sub>max</sub>	Nm	396	418	375	341	310	
Maximum output		P <sub>max</sub>	kW	19.3	36.5	49.8	64.4	64.4	
Maximum current		I <sub>max</sub>	Α	47	93.4	123	137	123.4	
	N	n <sub>max</sub>	rpm	3000	6000		7500		
Maximum speed		n <sub>max</sub>	rpm	3000	0000	52	250		
with bearing	.,	n <sub>max</sub>	rpm	3000	6000		7500		
<u>-</u>		n <sub>max</sub>	rpm	3000	6000	9000 7)	100	nn <sup>7</sup> )	
Continuous torque at stands		M <sub>n1</sub>	Nm	180	190	170	155	130	
Continuous current at stand		I <sub>n1</sub>	A	24.2	47.8	64.1	72.8	75.4	
Torque constant at 20° C		K <sub>M_N</sub>	Nm/A	8.75	4.72				
Thermal time constant		T <sub>th</sub>	min	0.73	4.72	45	2.02	2.69	
Duty cycle time (S6-44%)		T <sub>C</sub>	min			10			
Discharge capacity		Cab	nF	27.5	27.3	30.5	27.5	26.4	
Number of pole pairs		р	- '''	3					
Power wire cross-section <sup>2</sup>	)	A	mm²	4	10	16	16	25	
Moment of inertia <sup>3</sup> )	,	J <sub>rot</sub>	kgm²						
Mass <sup>4</sup> )		m	kg			165			
Sound pressure level <sup>5</sup> )		L <sub>P</sub>	dB(A)			70 (+3)			
Ambient temperature in ope	eration	T <sub>um</sub>	°C			0+40			
Insulation class according to EN 60034-1		- um				F			
Motor protection class						IP65			
Holding brake (optiona	ıD			Electr	ically clampin		Electrically re	leasing	
Transmittable torque	,	M <sub>4</sub>	Nm		100	.9	80		
Connection voltage		U <sub>Br</sub>	V			DC 24 ± 10 %			
Rated current		I <sub>Br</sub>	Α		1.5		1.6		
Moment of inertia		J <sub>Br</sub>	kgm²			0.002			
Max. permissible braking er	nergy \	$N_{\text{max}}$	Ws			30000			
Disconnection time	0,	t <sub>2</sub>	ms		65		140		
Connection time		t <sub>1</sub>	ms		110		50		
Maximum speed brake	n	Br_max	rpm		8000		8000		
Mass		m	kg			8			
Fan						Axial fan			
Air current						$B \rightarrow A$ , blowing			
Connection voltage		U <sub>N</sub>	V	3 ∨	400V +15 % 50	0/60Hz 3 x 48		0 Hz	
Power consumption		S <sub>N</sub>	VA	3 x	100 \$ 110 70, 00	139 208	70 V ±10 70, 00/0	V 1 12	
Fan flow <sup>6</sup> )		I <sub>N</sub>	A			0.20 0.25			
Medium air voltage		V	m³/h			1000			
1) Values determined as						not maan aquara			

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values. Reference value = 540 V<sub>DC</sub> intermediate circuit.

Fig. 4-35: Data Sheet MAD130D

Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Value without holding brake.

Value without holding brake, with fan.

At 1m distance, with PWM = 4 kHz

With I<sub>N</sub> + 20% and higher, fans should be monitored.

Value without holding brake. Observe maximum speed of holding brake.

### **Characteristic Curves of MAD130D Motors**

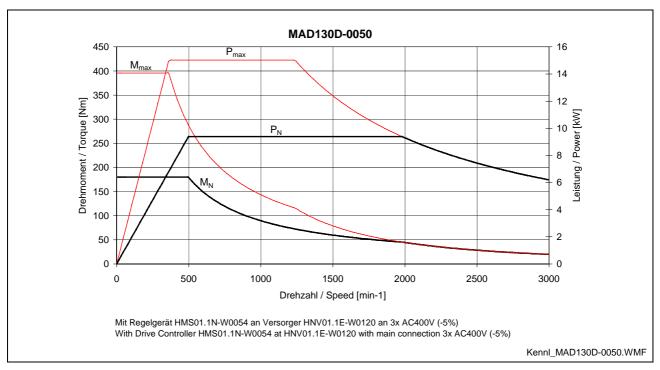


Fig. 4-36: Characteristic curve of MAD130D-0050 motors

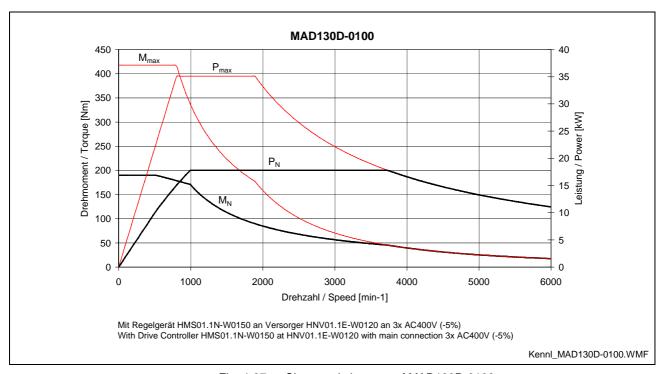


Fig. 4-37: Characteristic curve of MAD130D-0100 motors

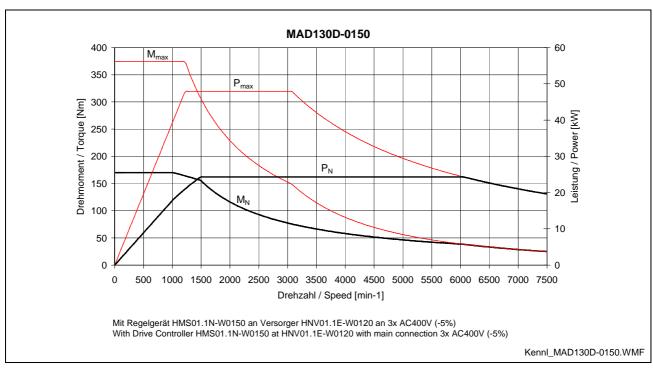


Fig. 4-38: Characteristic curve of MAD130D-0150 motors

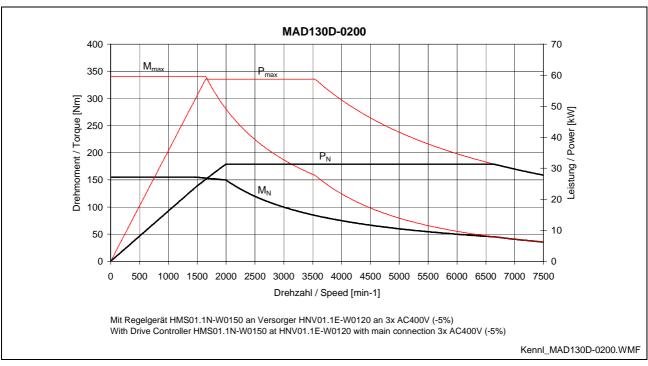


Fig. 4-39: Characteristic curve of MAD130D-0200 motors

4-28 Technical Data Rexroth IndraDyn A

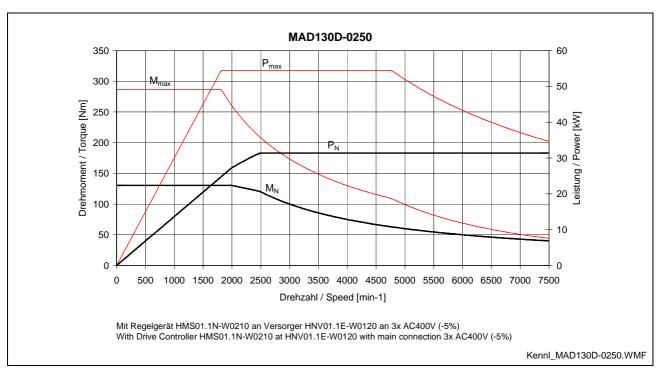


Fig. 4-40: Characteristic curve of MAD130D-0250 motors

**Technical Data 4-29** Rexroth IndraDyn A

#### 4.9 **Data Sheet MAD160B**

Description		Symbol	Unit		I	MAD160B				
Motor data 1)										
Winding				0050	0100	0150	0200			
Rated torque		M <sub>N</sub>	Nm	220	200	190	160			
Rated power		P <sub>N</sub>	kW	11.5	20.9	29.8	33.5			
Rated current		I <sub>N</sub>	Α	26.1	43.5	61.6	75.8			
Rated speed		n <sub>N</sub>	rpm	500	1000	1500	2000			
Key speed		n <sub>1</sub>	rpm	500	500	1000	1500			
Maximum torque		M <sub>max</sub>	Nm	484	484 461		375			
Maximum output		P <sub>max</sub>	kW	23.6	23.6 42.9 61.2		68.7			
Maximum current		I <sub>max</sub>	Α	51.7	87.5	132.2	157.4			
	N	n <sub>max</sub>	rpm	3000	3000 6000					
Maximum speed	R	n <sub>max</sub>	rpm	3000		4200				
with bearing	V	n <sub>max</sub>	rpm	3000		6000				
	Н	n <sub>max</sub>	rpm			8000 <sup>7)</sup>				
Continuous torque at stand	Istill	M <sub>n1</sub>	Nm	220	210	200	170			
Continuous current at stand	dstill	I <sub>n1</sub>	Α	26.1	45	64	80.9			
Torque constant at 20° C		K <sub>M_N</sub>	Nm/A	10.96	5.47	3.37	2.54			
Thermal time constant		$T_{th}$	min			60				
Duty cycle time (S6-44%)		Tc	min			10				
Discharge capacity		$C_{ab}$	nF	35	35	35	34.4			
Number of pole pairs		р				2				
Power wire cross-section 2	2)	Α	mm²	4	10	16	25			
Moment of inertia 3)		$J_{rot}$	kgm²			0.25				
Mass <sup>4</sup> )		m	kg			201				
Sound pressure level <sup>5</sup> )		L <sub>P</sub>	dB(A)			75 (+3)				
Ambient temperature in op	eration	$T_{um}$	°C		0+40					
Insulation class according EN 60034-1	to DIN					F				
Motor protection class						IP65				
Holding brake (optional	al)			Electricall clamping	FIECTI	ically releasing	Electrically releasing - reinforced			
Transmittable torque		$M_4$	Nm		100		240			
Connection voltage		$U_Br$	V		DO	C 24 ± 10 %				
Rated current		$I_{Br}$	Α	1.8		2.0	1.87			
Moment of inertia		$J_{Br}$	kgm²		0.0065		0.0188			
Max. permissible braking e	nergy	$W_{\text{max}}$	Ws		40000		70000			
Disconnection time		t <sub>2</sub>	ms	100		190	300			
Connection time		t <sub>1</sub>	ms	85		12	30			
Maximum speed brake		n <sub>Br_max</sub>	rpm	8000		8000	6000			
Mass		m	kg		20		25			
Fan						Axial fan				
Air current					B -	→ A, blowing				
Connection voltage		U <sub>N</sub>	V	3 x 400		Hz 3 x 480V ±10 %	6, 50/60 Hz			
Power consumption		S <sub>N</sub>	VA			32 175				
Fan flow <sup>6</sup> )		I <sub>N</sub>	Α			.19 0.21				
Medium air voltage		V	m³/h			1000				
1		4- IFC COO								

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values. Reference value =  $540 \text{ V}_{DC}$  intermediate circuit. Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Fig. 4-41: Data sheet MAD160B



Value without holding brake.

Value without holding brake, with fan. At 1m distance, with PWM = 4 kHz

With  $I_N$  + 20% and higher, fans should be monitored.

Value without holding brake. Observe maximum speed of holding brake.

# **Characteristic Curves of MAD160B Motors**

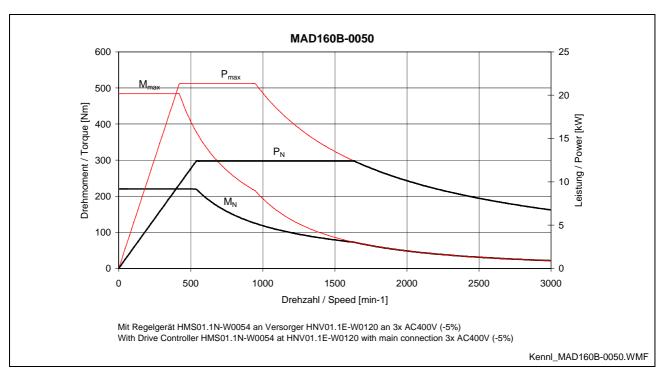


Fig. 4-42: Characteristic curve of MAD160B-0050 motors

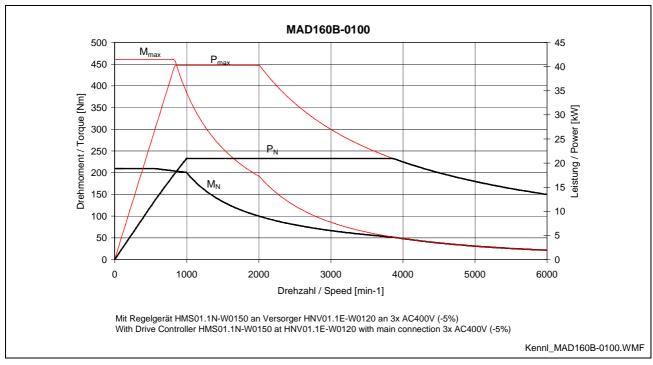


Fig. 4-43: Characteristic curve of MAD160B-0100 motors

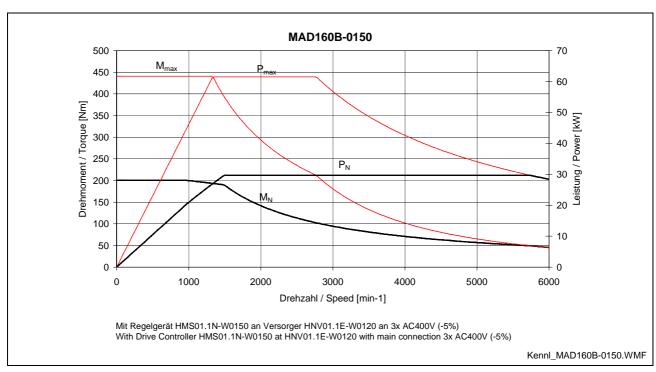


Fig. 4-44: Characteristic curve of MAD160B-0150 motors

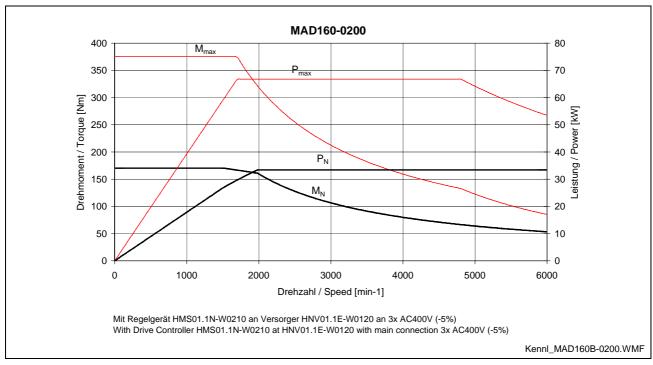


Fig. 4-45: Characteristic curve of MAD160B-0200 motors

# 4.10 Data Sheet MAD160C

Description		Symbol	Unit		MA	D160C			
Motor data 1)		-							
Winding				0050	0100	0150	0200		
Rated torque		M <sub>N</sub>	Nm	240	225	215	210		
Rated power		P <sub>N</sub>	kW	12.6	23.6	33.8	44		
Rated current		I <sub>N</sub>	Α	27.6	52.9	75.3	93.9		
Rated speed		n <sub>N</sub>	rpm	500	1000	1500	2000		
Key speed		n <sub>1</sub>	rpm	500	500	1000	1500		
Maximum torque		M <sub>max</sub>	Nm	528	527	496	494		
Maximum output		P <sub>max</sub>	kW	25.8	48.4	69.3	90.2		
Maximum current		I <sub>max</sub>	Α	54.8	112.3	152.6	182.4		
	N	n <sub>max</sub>	rpm	3000	•				
Maximum speed	R	n <sub>max</sub>	rpm	3000		6000 4200			
with bearing	V	n <sub>max</sub>	rpm	3000					
-	Н	n <sub>max</sub>	rpm		8	000 7)			
Continuous torque at star	ndstill	M <sub>n1</sub>	Nm	240	240	225	225		
Continuous current at sta		I <sub>n1</sub>	Α	27.6	55.7	77.8	93.9		
Torque constant at 20° C		K <sub>M_N</sub>	Nm/A	9.95	4.83	3.36	2.63		
Thermal time constant		T <sub>th</sub>	min			70			
Duty cycle time (S6-44%)		T <sub>C</sub>	min			10			
Discharge capacity		C <sub>ab</sub>	nF	28	24.4	27.2	32.3		
Number of pole pairs		р				2			
Power wire cross-section	2)	A	mm²	6	16	25	25		
Moment of inertia 3)	,	$J_{rot}$	kgm²	0.311					
Mass <sup>4</sup> )		m	kg			238			
Sound pressure level <sup>5</sup> )		L <sub>P</sub>	dB(A)			5 (+3)			
Ambient temperature in o	peration	$T_{um}$	°C			+40			
Insulation class accordino EN 60034-1	to DIN			F					
Motor protection class						IP65			
Holding brake (option	nal)			Electricall clamping	'   FIECTICA	lly releasing	Electrically releasing - reinforced		
Transmittable torque		$M_4$	Nm		100		240		
Connection voltage		$U_Br$	V		DC 2	4 ± 10 %			
Rated current		I <sub>Br</sub>	Α	1.8		2.0	1.87		
Moment of inertia		$J_{Br}$	kgm²		0.0065		0.0188		
Max. permissible braking	energy	$W_{max}$	Ws		40000		70000		
Disconnection time		t <sub>2</sub>	ms	100		190	300		
Connection time		t <sub>1</sub>	ms	85		12	30		
Maximum speed brake		n <sub>Br_max</sub>	rpm	8000		8000	6000		
Mass		m	kg		20		25		
Fan					Ax	ial fan			
Air current						A, blowing			
Connection voltage		U <sub>N</sub>	V	3 x 400	OV ±15 %, 50/60Hz		%. 50/60 Hz		
Power consumption		S <sub>N</sub>	VA	5 X 400		175	, 30,00 . IL		
Fan flow <sup>6</sup> )		I <sub>N</sub>	A			0 0.21			
Medium air voltage		V	m³/h			1000			
1) Values determined a									

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values.

Fig. 4-46: Data sheet MAD160C



Reference value =  $540 \text{ V}_{DC}$  intermediate circuit. Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Value without holding brake.

Value without holding brake, with fan. At 1m distance, with PWM = 4 kHz

With  $I_N$  + 20% and higher, fans should be monitored.

Value without holding brake. Observe maximum speed of holding brake.

### **Characteristic Curves of MAD160C Motors**

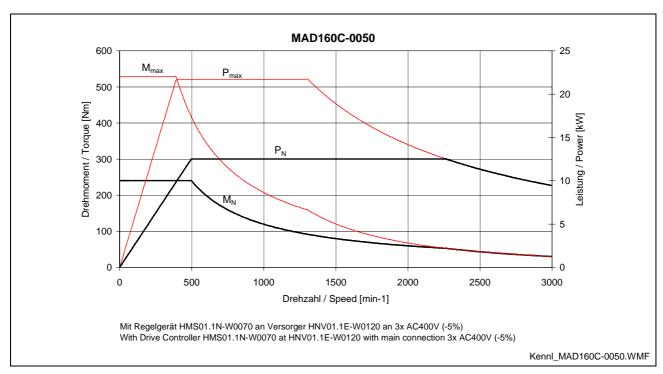


Fig. 4-47: Characteristic curve of MAD160C-0050 motors

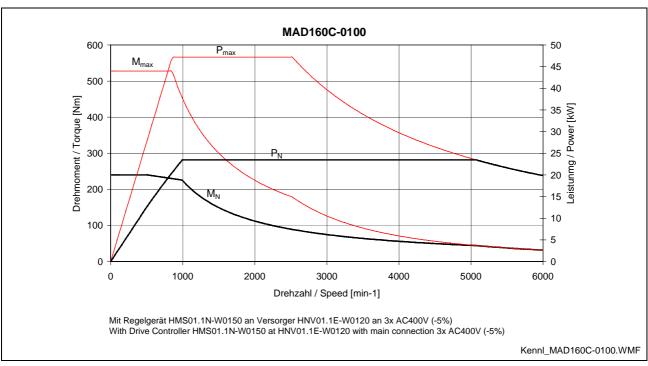


Fig. 4-48: Characteristic curve of MAD160C-0100 motors

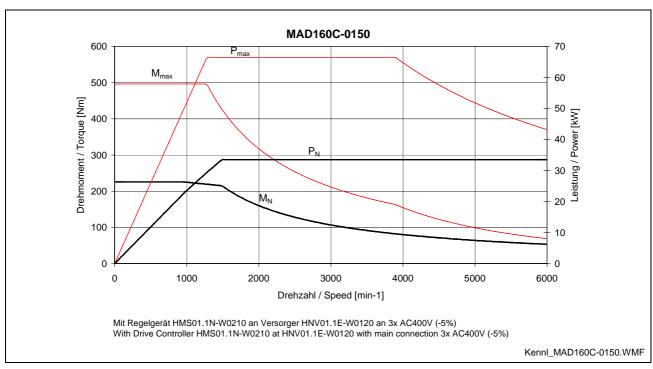


Fig. 4-49: Characteristic curve of MAD160C-0150 motors

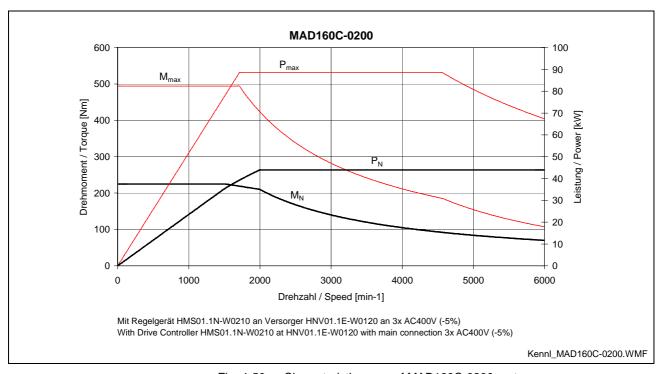


Fig. 4-50: Characteristic curve of MAD160C-0200 motors

**Technical Data 4-35** Rexroth IndraDyn A

## 4.11 Data Sheet MAD180C

Description	S	ymbol	Unit	MAD180C						
Motor data 1)										
Winding				0050	0100	0150	0200			
Rated torque		M <sub>N</sub>	Nm	325	300	270	250			
Rated power		P <sub>N</sub>	kW	17	31.4	42.4	52.4			
Rated current		I <sub>N</sub>	Α	38.2	69	88.6	104.6			
Rated speed		n <sub>N</sub>	rpm	500	1000	1500	2000			
Key speed		n <sub>1</sub>	rpm	500	500	1000	1500			
Maximum torque		M <sub>max</sub>	Nm	715	620	681	594			
Maximum output		P <sub>max</sub>	kW	34.9	64.4	86.9	107.4			
Maximum current		I <sub>max</sub>	Α	76.6	147.5	230.3	207.3			
_	N	n <sub>max</sub>	rpm	3000 6000						
Maximum speed	R	n <sub>max</sub>	rpm	3000		4200				
with bearing	V	n <sub>max</sub>	rpm	3000		6000				
	Н	n <sub>max</sub>	rpm	not available						
Continuous torque at stand		M <sub>n1</sub>	Nm	325	330	300	270			
Continuous current at stand	dstill	I <sub>n1</sub>	Α	38.2	75	116.2	110			
Torque constant at 20° C		K <sub>M_N</sub>	Nm/A	10	5.19	3.25	3.01			
Thermal time constant		$T_{th}$	min		4	15				
Duty cycle time (S6-44%)		T <sub>C</sub>	min		1	0				
Discharge capacity		$C_{ab}$	nF	29.2	25.2	30	31.6			
Number of pole pairs		р				2				
Power wire cross-section <sup>2</sup>	)	Α	mm²	10	25	35	35			
Moment of inertia 3)		$J_{rot}$	kgm²	m² 0.458						
Mass <sup>4</sup> )		m	kg		3	34				
Sound pressure level 5)		$L_P$	dB(A)		78	(+3)				
Ambient temperature in ope	eration	$T_{um}$	°C		0	.+40				
Insulation class according t EN 60034-1	o DIN					F				
Motor protection class					IP	<sup>1</sup> 65				
Holding brake (optiona	ıl)			Electricall	y clamping	Electricall	y releasing			
Transmittable torque		M <sub>4</sub>	Nm	3	00	2	40			
Connection voltage		U <sub>Br</sub>	V		DC 24	± 10 %				
Rated current		I <sub>Br</sub>	Α		2	1.	.87			
Moment of inertia		$J_{Br}$	kgm²		0.0	188				
Max. permissible braking er	nergy	W <sub>max</sub>	Ws		70	000				
Disconnection time		t <sub>2</sub>	ms	Ş	90	3	00			
Connection time		t <sub>1</sub>	ms	1	50	3	30			
Mass		m	kg		2	25				
Fan					Axia	ıl fan				
Air current					$B \rightarrow A$ ,	blowing				
Connection voltage		U <sub>N</sub>	V	3 x 400\		3 x 480V ±10 %, 5	50/60 Hz			
Power consumption		S <sub>N</sub>	VA			382				
Fan current <sup>6</sup> )		I <sub>N</sub>	Α			0.46				
Medium air voltage		V	m³/h	1500						

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values. Reference value =  $540 \text{ V}_{DC}$  intermediate circuit.

Fig. 4-51: Data sheet MAD180C

Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Value without holding brake.

Value without holding brake, with fan. At 1m distance, with PWM = 4 kHz

With  $I_N + 20\%$  and higher, fans should be monitored.

# **Characteristic Curves of MAD180C Motors**

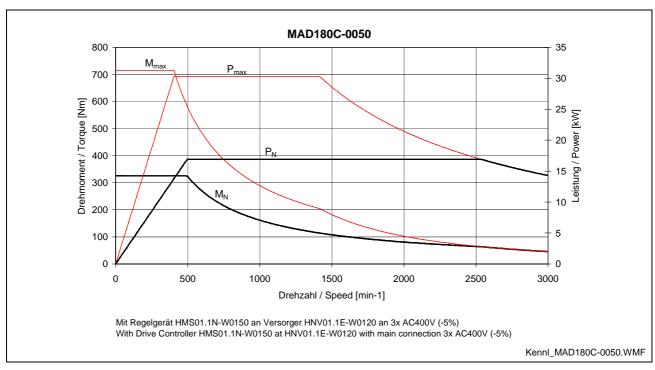


Fig. 4-52: Characteristic curve of MAD180C-0050 motors

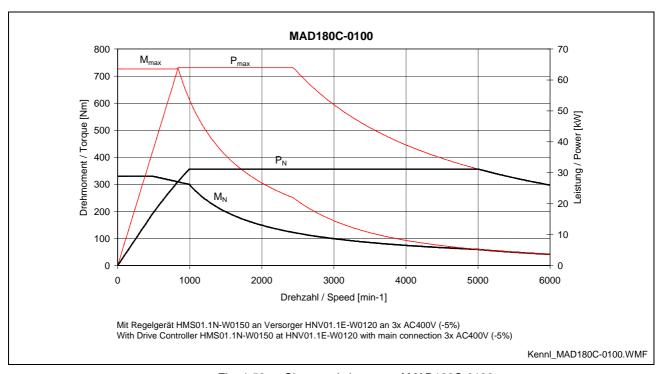


Fig. 4-53: Characteristic curve of MAD180C-0100 motors

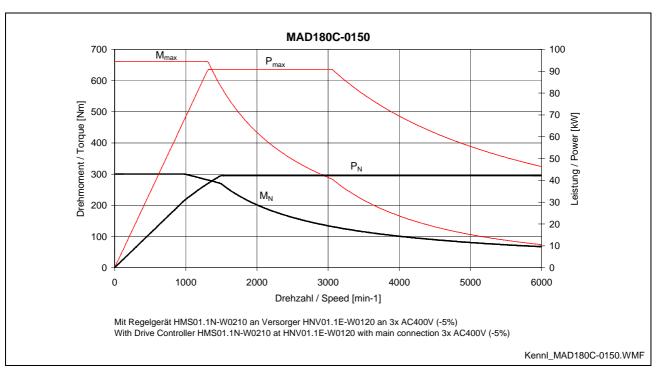


Fig. 4-54: Characteristic curve of MAD180C-0150 motors

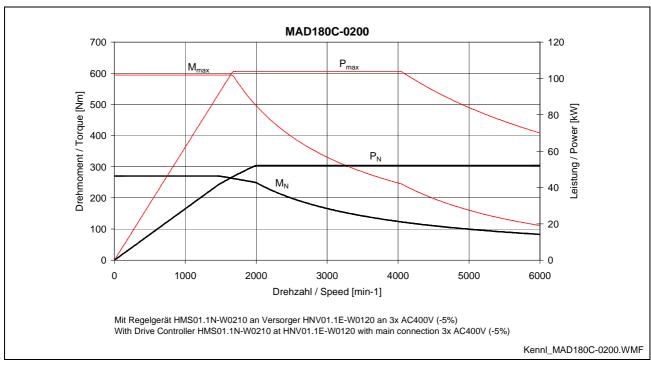


Fig. 4-55: Characteristic curve of MAD180C-0200 motors

## 4.12 Data Sheet MAD180D

			MAD180D					
		0050	0100	0150	0200			
M <sub>N</sub>	Nm	390	370	340	300			
P <sub>N</sub>	kW	20.4	38.7	53.4	62.8			
I <sub>N</sub>	Α	39.7	82.4	107.8	117.4			
n <sub>N</sub>	rpm	500	1000	1500	2000			
n <sub>1</sub>	rpm	500	500	1000	1500			
M <sub>max</sub>	Nm	858	901	793	768			
P <sub>max</sub>	kW	41.8	79.3	109.5	128.7			
I <sub>max</sub>	Α	78.4	188	218.1	269.7			
N n <sub>max</sub>	rpm	3000		6000				
R n <sub>max</sub>	rpm	3000						
V n <sub>max</sub>	rpm							
	rpm							
	Nm	390	410	360	350			
	Α	39.7	90.0	112.3	132.6			
K <sub>M N</sub>	Nm/A			2.92				
	min	-						
	min							
	nF	38	38.4		38			
A	mm²	10 25 35			35			
$J_{rot}$	kgm²							
m	kg							
L <sub>P</sub>								
tion T <sub>um</sub>	°C			· · ·				
				F				
			ı	P65				
		Electrica			ly releasing			
M <sub>4</sub>	Nm		300	2	240			
U <sub>Br</sub>	V		DC 2	4 ± 10 %				
I <sub>Br</sub>	Α		2	1	.87			
$J_{\mathrm{Br}}$	kgm²		0.	0188				
	Ws		7	0000				
t <sub>2</sub>	ms		90	3	300			
t <sub>1</sub>	ms		150		30			
m	kg			25				
			Axi	ial fan				
U <sub>N</sub>	V	3 x 40			50/60 Hz			
	VA							
V	m³/h			500				
	PN	PN	PN    kW	PN    kW	P <sub>N</sub>   kW   20.4   38.7   53.4     I <sub>N</sub>			

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values. Reference value =  $540 \text{ V}_{DC}$  intermediate circuit.

Fig. 4-56: Data Sheet MAD180D

Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Value without holding brake.
Value without holding brake, with fan.
At 1m distance, with PWM = 4 kHz

With  $I_N$  + 20% and higher, fans should be monitored.

### **Characteristic Curves of MAD180D Motors**

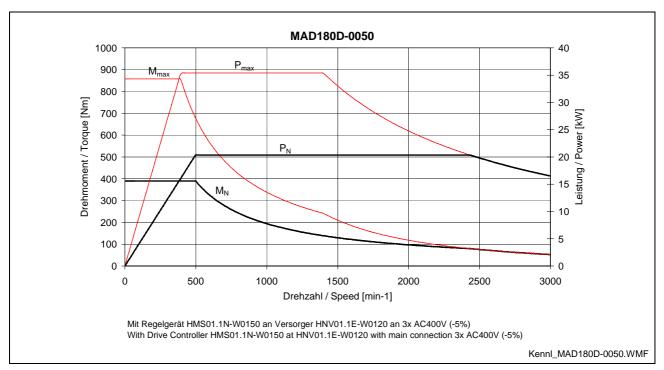


Fig. 4-57: Characteristic curve of MAD180D-0050 motors

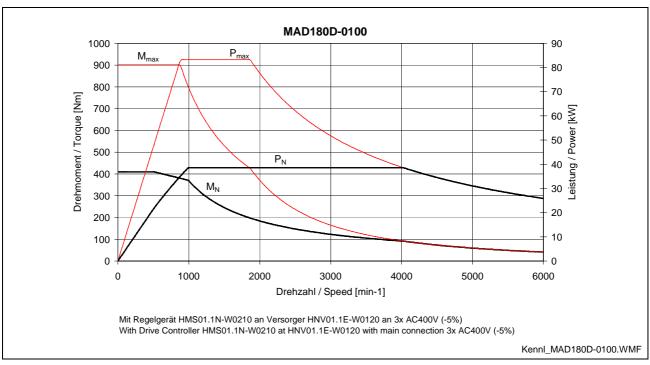


Fig. 4-58: Characteristic curve of MAD180D-0100 motors

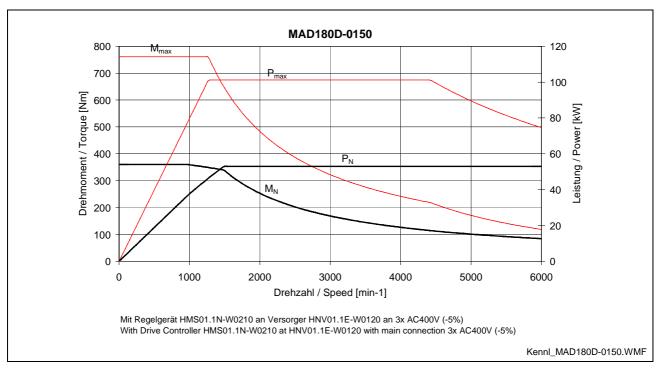


Fig. 4-59: Characteristic curve of MAD180D-0150 motors

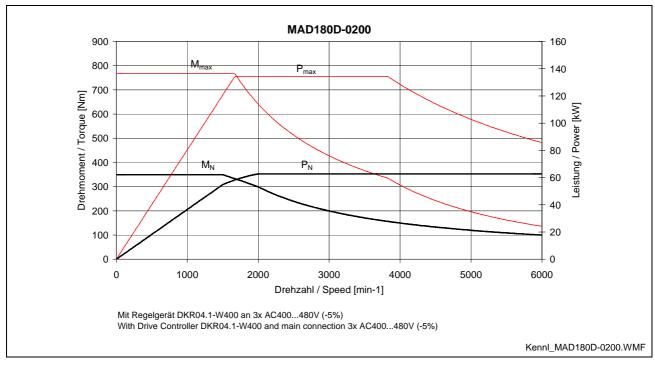


Fig. 4-60: Characteristic curve of MAD180D-0200 motors

**Technical Data 4-41** Rexroth IndraDyn A

## 4.13 Data Sheet MAD225C

Description		Symbol	Unit		MAD225C	
Motor data <sup>1</sup> )	1					
Winding				0050*	0100*	0150
Rated torque		M <sub>N</sub>	Nm	640	620	593
Rated power		P <sub>N</sub>	kW	33.5	64.9	93
Rated current		I <sub>N</sub>	Α	72	129	174
Rated speed		n <sub>N</sub>	rpm	500	1000	1500
Key speed		n <sub>1</sub>	rpm	500	500	1000
Maximum torque		M <sub>max</sub>	Nm	1450	1450	1450
Maximum output		P <sub>max</sub>	kW	70	135	190
Maximum current		I <sub>max</sub>	Α	160	280	376
	N	n <sub>max</sub>	rpm	3000	3750	3750
Maximum speed	R	n <sub>max</sub>	rpm			
with bearing	V	n <sub>max</sub>	rpm	3000	3750	3750
	Н	n <sub>max</sub>	rpm			
Continuous torque at standstill		M <sub>n1</sub>	Nm	640	640	660
Continuous current at standstill		I <sub>n1</sub>	А	72	135	187
Torque constant at 20° C		$K_{M\_N}$	Nm/A	10.2	5.5	3.9
Thermal time constant		$T_{th}$	min	45	45	45
Duty cycle time (S6-44	l%)	T <sub>C</sub>	min	5	5	5
Discharge capacity		C <sub>ab</sub>	nF	126	126	126
Number of pole pairs		р			2	
Power wire cross-sect	ion <sup>2</sup> )	А	mm²	25	2 x 16	2 x 35
Moment of inertia 3)		$J_{rot}$	kgm²		1.55	
Mass <sup>4</sup> )		m	kg		610	
Sound pressure level	5)	$L_P$	dB(A)		78 (+3)	
Ambient temperature i operation	n	$T_{um}$	°C		0+40	
Insulation class accord DIN EN 60034-1	ding to				F	
Motor protection class					IP65	
Fan					Axial fan	
Air current					$B \rightarrow A$ blowing	
Connection voltage		U <sub>N</sub>	V	3 x 400V ±15 %,	50/60Hz 3 x 480V	± 10 %, 50/60 Hz
Power consumption		S <sub>N</sub>	VA		i.p.	
Fan current <sup>6</sup> )		I <sub>N</sub>	А		i.p.	
Medium air voltage		V	m³/h		i.p.	

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values. Reference value =  $540 \text{ V}_{DC}$  intermediate circuit.

Fig. 4-61: Data sheet MAD225C

Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Value without holding brake.
Value without holding brake, with fan.

At 1m distance, with PWM = 4 kHz

With  $I_N$  + 20% and higher, fans should be monitored. Preliminary data

i. p.) in preparation

# **Characteristic Curve MAD225C Motor**

in preparation	
	ļ

Fig. 4-62: Characteristic curves of MAD225C motors

**Technical Data 4-43** Rexroth IndraDyn A

## 4.14 Data Sheet MAF100B

Description		Symbol	Unit			MAF100B			
Motor data <sup>1</sup> )									
Winding				0050	0100	0150	0200	0250	
Rated torque		M <sub>N</sub>	Nm	50	46	42	38	33	
Rated power		P <sub>N</sub>	kW	2.6	4.8	6.6	8	8.6	
Rated current		I <sub>N</sub>	Α	8.5	14.3	18.1	23.9	26	
Rated speed		n <sub>N</sub>	rpm	500	1000	1500	2000	2500	
Key speed		n <sub>1</sub>	rpm	500	500	1000	1500	2000	
laximum torque		M <sub>max</sub>	Nm	110	110	101	92	84	
laximum output		P <sub>max</sub>	kW	5.3	9.8	13.5	16.4	17.7	
Maximum current		I <sub>max</sub>	Α	20.3	36.7	46.2	51.7	50.7	
	N	n <sub>max</sub>	rpm	3000	6000		9000		
F		n <sub>max</sub>	rpm	3000	6000		6300		
Maximum speed with bearing	V	n <sub>max</sub>	rpm			not available			
_	Н	n <sub>max</sub>	rpm	3000	6000	9000	1100	00 <sup>6</sup> )	
Continuous torque at standstill		M <sub>n1</sub>	Nm	50	50	46	42	38	
Continuous current at standstill		I <sub>n1</sub>	Α	8.5	17.9	22.7	25.8	26	
Torque constant at 20° C		K <sub>M_N</sub>	Nm/A	6.68	3.73	2.76	1.84	1.49	
Thermal time constant		T <sub>th</sub>	min			10	•		
Duty cycle time (S6-44%)	T <sub>C</sub>	min			10				
Discharge capacity	Cab	nF			6				
Number of pole pairs	р				3				
Power wire cross-section <sup>2</sup> )		Α	mm²	1	1.5	2.5	4	4	
Moment of inertia 3)		$J_{rot}$	kgm²			0.019			
Mass <sup>3</sup> )		m	kg			38			
Sound pressure level 4)		L <sub>P</sub>	dB(A)			70 (+3)			
Ambient temperature in operation		T <sub>um</sub>	°C			0+40			
Insulation class according to DIN EN	N 60034-1			F					
Motor protection class				IP65					
Liquid cooling <sup>5</sup> )									
Power loss to be dissipated		Pv	kW			1.0			
Cooling agent  Cooling agent inle	t	T <sub>in</sub>	°C	+10+40					
temperature Permissible increa	se at P <sub>V</sub>	$\Delta T_{diff}$	K			10			
Decompression without snap-on co	oupling	$\Delta p_{diff}$	bar			0.4			
at Q <sub>N</sub> with snap-on coup		$\Delta p_{diff}$	bar			0.8			
Required coolant flow at P <sub>V</sub>		Q <sub>min</sub>	l/min			1.45			
Permissible inlet pressure		p <sub>max</sub>	bar			3			
Volume of coolant duct		V <sub>cool</sub>	1			0.06			
Holding brake (optional)				Electrica	lly clamping	Ele	ctrically rele	easing	
Transmittable torque		M <sub>4</sub>	Nm		30		24		
Connection voltage		U <sub>Br</sub>	V		[	OC 24 ± 10 %			
Rated current		I <sub>Br</sub>	Α		0.9		1.1		
Moment of inertia		J <sub>Br</sub>	kgm²			0.00056			
Maximum permissible braking energ	ıy	W <sub>max</sub>	Ws			20000			
Disconnection time	-	t <sub>2</sub>	ms		50		90		
Connection time		t <sub>1</sub>	ms		42		30		
Maximum speed brake		n <sub>Br_max</sub>	rpm	1	0000		10000		
Mass		m	kg		2		1.6		
		·							

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values.

Fig. 4-63: Data sheet MAF100B



Reference value 540 V<sub>DC</sub> DC bus voltage

Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Value without holding brake.

At 1m distance, with PWN = 4 kHz.

Data refer to water as a cooling agent. When other coolants are used, convert data. Observe the information on coolant entry temperature in Chapter 9.8. Value without holding brake. Observe maximum speed of holding brake.

# **Characteristic Curves of MAD100B Motors**

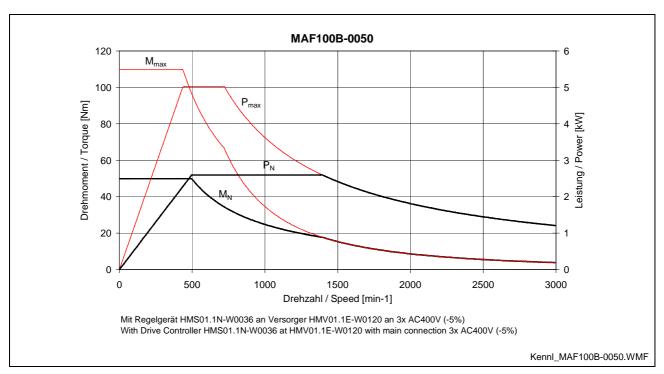


Fig. 4-64: Characteristic curves of MAF100B-0050 motors

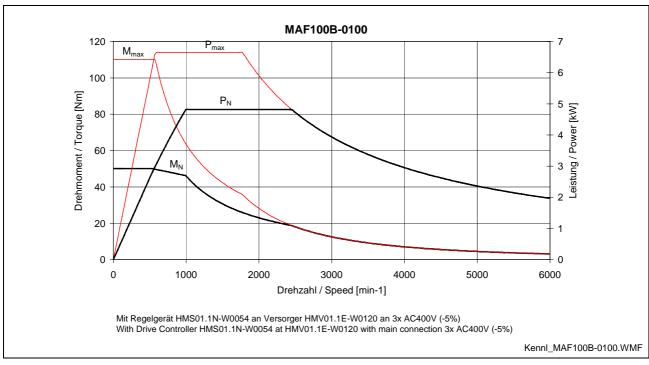


Fig. 4-65: Characteristic curves of MAF100B-0100 motors

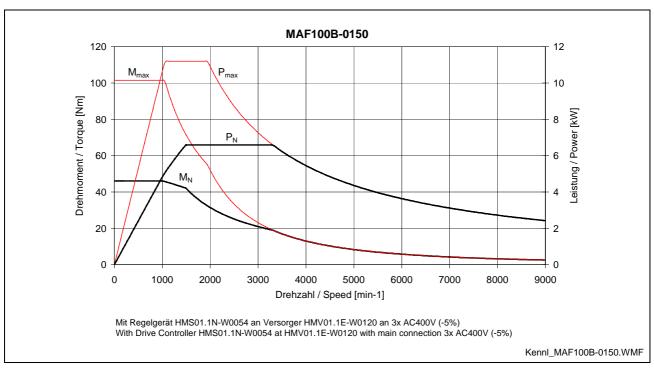


Fig. 4-66: Characteristic curves of MAF100B-0150 motors

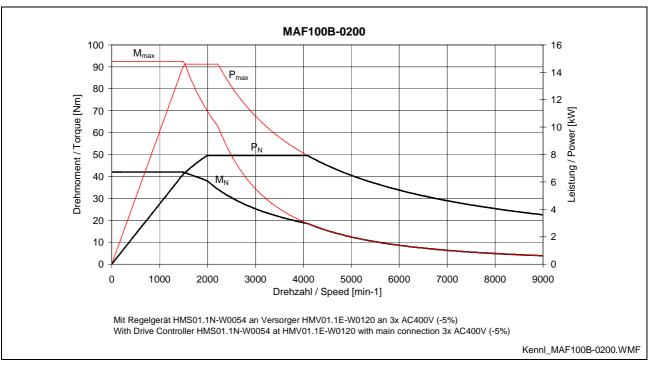


Fig. 4-67: Characteristic curves of MAF100B-0200 motors

4-46 Technical Data

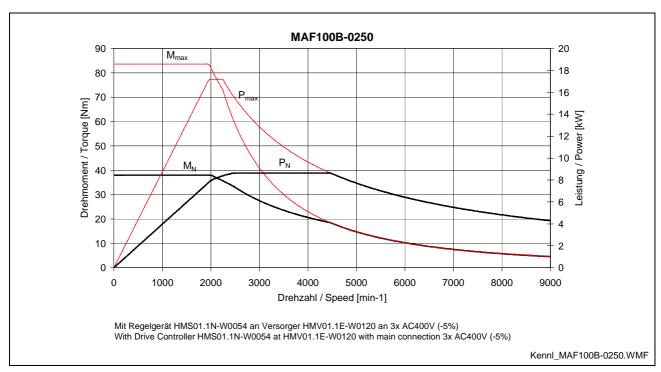


Fig. 4-68: Characteristic curves of MAF100B-0250 motors

**Technical Data 4-47** Rexroth IndraDyn A

# 4.15 Data Sheet MAF100C

Description		Symbol	Unit	MAF100C				
Motor data <sup>1</sup> )								
Winding				0050	0100	0150	0200	0250
Rated torque		M <sub>N</sub>	Nm	70	68	66	64	62
Rated power		P <sub>N</sub>	kW	3.9	7.5	10.4	13.4	16.2
Rated current		I <sub>N</sub>	Α	12.1	19	27.9	36.7	40.2
Rated speed		n <sub>N</sub>	rpm	500	1000	1500	2000	2500
Key speed		n <sub>1</sub>	rpm	500	500	1000	1500	2000
Maximum torque		M <sub>max</sub>	Nm	154	154	149	145	138
Maximum output		P <sub>max</sub>	kW	8	15.4	21.3	27.5	33.3
Maximum current		I <sub>max</sub>	Α	25.6	41.4	60.4	77.5	85.9
	N	n <sub>max</sub>	rpm	3000	6000		9000	
	R	n <sub>max</sub>	rpm	3000	6000		6300	
Maximum speed with bearing	V	n <sub>max</sub>	rpm	0000		not available		
•	Н	n <sub>max</sub>	rpm	3000	6000	9000	1100	)() <sup>6</sup> )
Continuous torque at standstill		M <sub>n1</sub>	Nm	70	70	68	66	64
Continuous current at standstill		I <sub>n1</sub>	Α	12.1	19.5	28.6	37.6	38.5
Torque constant at 20° C		K <sub>M_N</sub>	Nm/A	6.06	3.77	2.5	1.91	1.55
Thermal time constant		T <sub>th</sub>	min	0.00	0.11	10	1.01	1.00
Duty cycle time (S6-44%)		T <sub>C</sub>	min			10		
Discharge capacity		C <sub>ab</sub>	nF	8.5	8.5	8.6	8.5	9.4
Number of pole pairs		р		0.0	0.0	3	0.0	V.¬
Power wire cross-section <sup>2</sup> )		A	mm²	1	2.5	4	6	10
Moment of inertia <sup>3</sup> )		J <sub>rot</sub>	kgm²	•	2.0	0.0284	, ,	10
Mass <sup>3</sup> )		m	kg	• • • • • • • • • • • • • • • • • • • •				
Sound pressure level <sup>4</sup> )		L <sub>P</sub>	dB(A)					
Ambient temperature in operation		T <sub>um</sub>	°C			0+40		
Insulation class according to DIN EN 6	0034-1	dili				F		
Motor protection class						 IP65		
Liquid cooling <sup>5</sup> )						00		
Power loss to be dissipated		Pv	kW	1.	1	1.2	1.3	2
Cooling agent Cooling agent inlet		T <sub>in</sub>	°C		. 1	+10+40	1.0	
temperature Permissible increase	at Pv	$\Delta T_{diff}$	K			10		
Decompression without snap-on cour			bar			0.6		
at Q <sub>N</sub> with snap-on coupling		Δp <sub>diff</sub>	bar			1.2		
Required coolant flow at P <sub>V</sub>	9	Δp <sub>diff</sub>	l/min	1.	6	1.75	1.9	2.8
<u> </u>		Q <sub>min</sub>		1.	.0	3	1.9	2.0
Permissible inlet pressure  Volume of coolant duct		p <sub>max</sub> V <sub>cool</sub>	bar I			0.08		
Holding brake (optional)		V COOI	'	Electric	ally clampi		lectrically re	loseina
Transmittable torque		N/I	Nm	LICCUIC	30	iig L	24	icasiiig
•		M <sub>4</sub>			30	DC 24 + 10.9/		
Connection voltage Rated current		U <sub>Br</sub>	V A		0.9	DC 24 ± 10 %		
		I <sub>Br</sub>			0.9	0.00050	1.1	
Moment of inertia		J <sub>Br</sub>	kgm²			0.00056		
Max. permissible braking energy								
Disconnection time		t <sub>2</sub>	ms		50		90	
Connection time		t <sub>1</sub>	ms		42		30	
Maximum speed brake		n <sub>Br_max</sub>	rpm		10000		10000	
Mass		m	kg					

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values.

Fig. 4-69: Data Sheet MAF100C



Reference value 540V<sub>DC</sub> DC bus voltage.

Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Value without holding brake.

At 1m distance, with PWN = 4 kHz.

Data refer to water as a cooling agent. When other coolants are used, convert data. Observe the information on coolant entry temperature in Chapter 9.8. Value without holding brake. Observe maximum speed of holding brake.

#### **Characteristic Curves of MAF100C Motors**

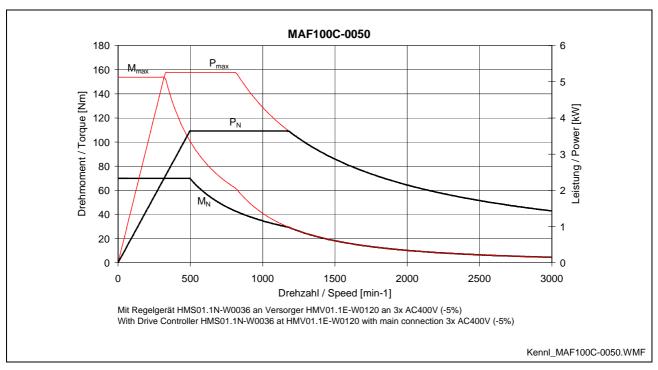


Fig. 4-70: Characteristic curves of MAF100C-0050 motors

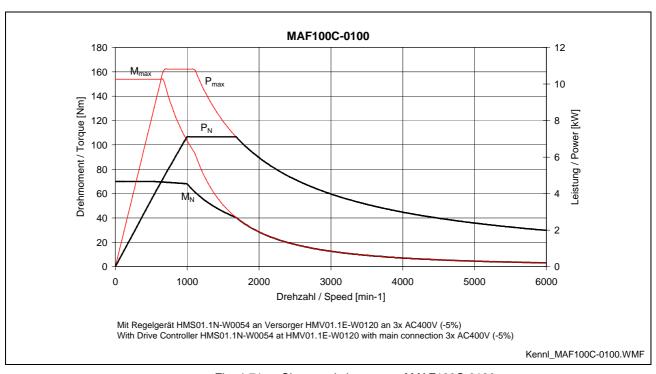


Fig. 4-71: Characteristic curves of MAF100C-0100 motor

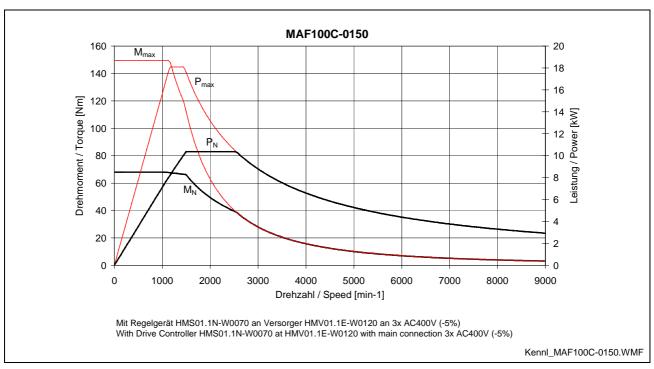


Fig. 4-72: Characteristic curves of MAF100C-0150 motors

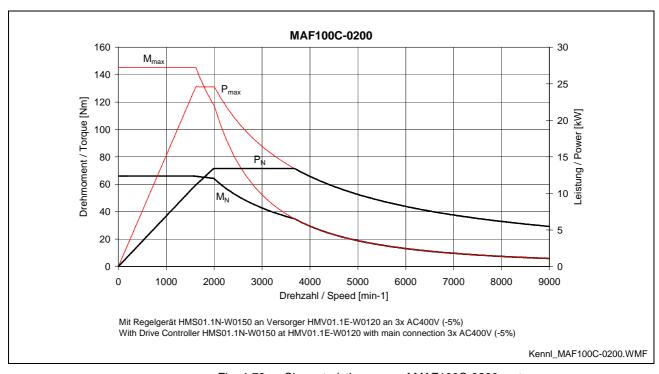


Fig. 4-73: Characteristic curves of MAF100C-0200 motors

4-50 Technical Data Rexroth IndraDyn A

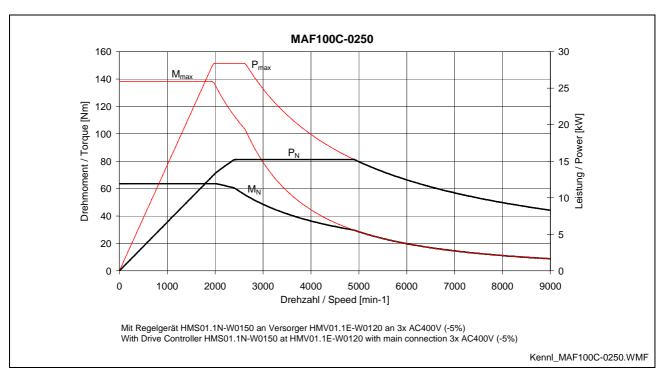


Fig. 4-74: Characteristic curves of MAF100C-0250 motors

# 4.16 Data Sheet MAF100D

Description		Symbol	Unit	MAF100D						
Motor data <sup>1</sup> )										
Winding				0050	0100	0150	0200	0250		
Rated torque		M <sub>N</sub>	Nm	88	84	79	80	75		
Rated power		P <sub>N</sub>	kW	4.6	8.8	12.4	16.8	19.6		
Rated current		I <sub>N</sub>	Α	14.5	25.1	32.7	43.1	45.8		
Rated speed		n <sub>N</sub>	rpm	500	1000	1500	2000	2500		
Key speed		n <sub>1</sub>	rpm	500	500	1000	1500	2000		
Maximum torque		M <sub>max</sub>	Nm	193	194	185	182	177		
Maximum output		P <sub>max</sub>	kW	9.4	18	25.4	34.4	40.2		
Maximum current		I <sub>max</sub>	Α	29.2	52.7	68.7	89.8	100.4		
	N	n <sub>max</sub>	rpm	3000	6000		9000			
	R	n <sub>max</sub>	rpm	3000	6000		6300			
Maximum speed with bearing	V	n <sub>max</sub>	rpm			not availa				
-	Н	n <sub>max</sub>	rpm	3000	6000	9000	1100	00 <sup>6</sup> )		
Continuous torque at standstill		M <sub>n1</sub>	Nm	88	88	84	83	80		
Continuous current at standstill		I <sub>n1</sub>	Α	14.5	26.1	34.3	44.4	56.1		
Torque constant at 20° C		K <sub>M_N</sub>	Nm/A	6.79	3.78	2.77	2.08	1.55		
Thermal time constant		T <sub>th</sub>	min			10				
Duty cycle time (S6-44%)		T <sub>C</sub>	min			10				
Discharge capacity	Cab	nF	11	11	11	11	9.2			
Number of pole pairs		р				3				
Power wire cross-section <sup>2</sup> )	A	mm²	1.5	4	6	10	10			
Moment of inertia 3)		J <sub>rot</sub>	kgm²		1	0.032				
Mass <sup>3</sup> )		m	kg							
Sound pressure level <sup>4</sup> )		L <sub>P</sub>	dB(A)							
Ambient temperature in operation		T <sub>um</sub>	°C			0+40				
Insulation class according to DIN EN 60	034-1					F	-			
Motor protection class						IP65				
Liquid cooling <sup>5</sup> )		•								
Power loss to be dissipated		Pv	kW	1.4	1.45	1.5	1.55	1.9		
Cooling agent Cooling agent inlet		T <sub>in</sub>	°C		-	+10+4	40			
temperature Permissible increase	at P <sub>V</sub>	$\Delta T_{diff}$	K			10				
Decompression without snap-on coup	ling	$\Delta p_{diff}$	bar			1.0				
at Q <sub>N</sub> with snap-on coupling		$\Delta p_{diff}$	bar			1.9				
Required coolant flow at P <sub>V</sub>	,	Q <sub>min</sub>	I/min	2	2.1	2.2	2.3	2.8		
Permissible inlet pressure		p <sub>max</sub>	bar			3				
Volume of coolant duct		V <sub>cool</sub>	I			0.11				
Holding brake (optional)				Electric	ally clampi		Electrically re	leasing		
Transmittable torque		M <sub>4</sub>	Nm		30		24			
Connection voltage		U <sub>Br</sub>	V			DC 24 ± 1				
Rated current		I <sub>Br</sub>	Α	0.9						
Moment of inertia		J <sub>Br</sub>	kgm²			0.0005				
Max. permissible braking energy		W <sub>max</sub>	Ws			20000				
Disconnection time		t <sub>2</sub>	ms		50	1	90			
Connection time		t <sub>1</sub>	ms		42		30			
Maximum speed brake		n <sub>Br_max</sub>	rpm		10000		10000			
Mass		m	kg		2		1.6			
4			9				1.0			

<sup>1)</sup> Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values.

Fig. 4-75: Data Sheet MAF100D



Reference value 540 V<sub>DC</sub> DC bus voltage.

Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

<sup>3)</sup> Value without holding brake.

At 1m distance, with PWN = 4 kHz.

Data refer to water as a cooling agent. When other coolants are used, convert data. Observe the information on coolant entry

temperature in Chapter 9.8.

Value without holding brake. Observe maximum speed of holding brake.

# **Characteristic Curves of MAF100D Motors**

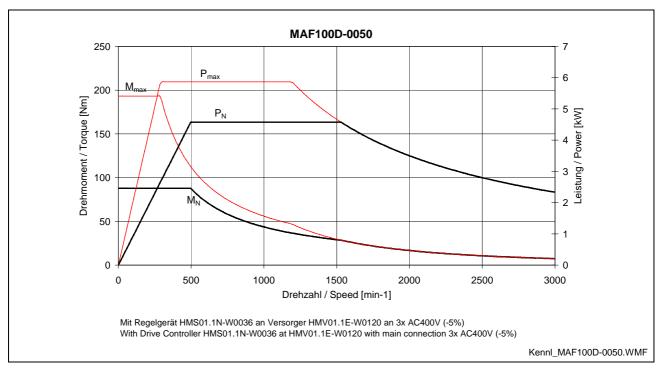


Fig. 4-76: Characteristic curves of MAF100D-0050 motors

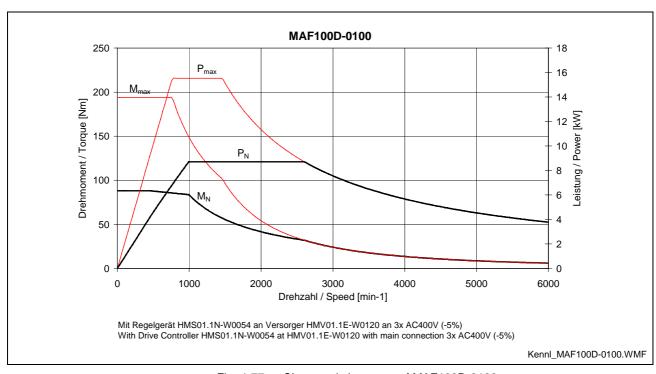


Fig. 4-77: Characteristic curves of MAF100D-0100 motors

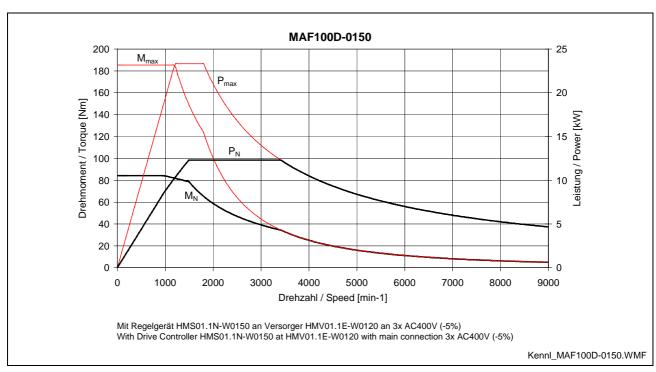


Fig. 4-78: Characteristic curves of MAF100D-0150 motors

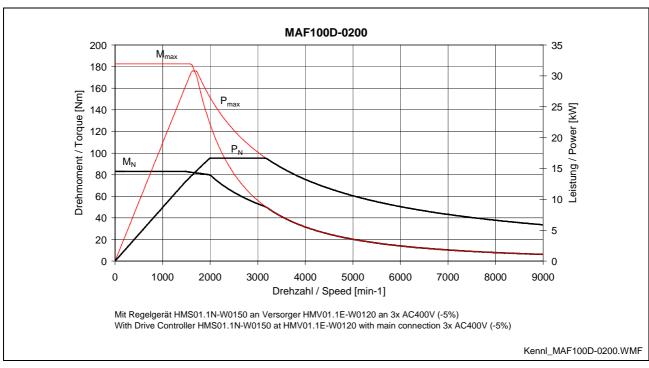


Fig. 4-79: Characteristic curves of MAF100D-0200 motors

4-54 Technical Data Rexroth IndraDyn A

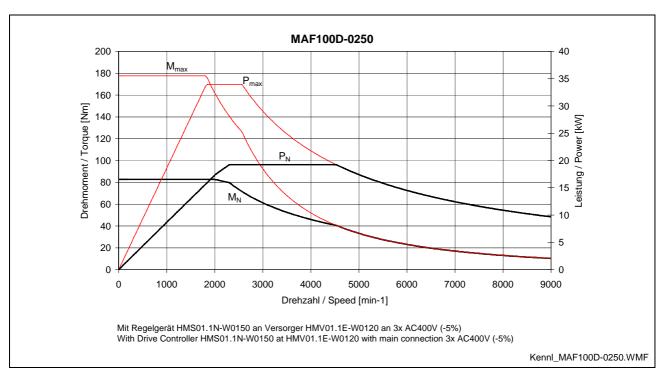


Fig. 4-80: Characteristic curves of MAF100D-0250 motors

**Technical Data 4-55** Rexroth IndraDyn A

# 4.17 Data Sheet MAF130B

Description		Symbol	Unit			MAF130	В			
Motor data <sup>1</sup> )										
Winding				0050	0100	0150	0200	0250		
Rated torque		M <sub>N</sub>	Nm	116	112	115	100	90		
Rated power		P <sub>N</sub>	kW	6.1	11.7	18.1	20.9	23.6		
Rated current		I <sub>N</sub>	Α	14.7	28.4	43.7	52.7	55.5		
Rated speed		n <sub>N</sub>	rpm	500	1000	1500	2000	2500		
Key speed		n <sub>1</sub>	rpm	500	500	1000	1500	2000		
Maximum torque		M <sub>max</sub>	Nm	255	255	264	220	221		
Maximum output		P <sub>max</sub>	kW	12.5	24	37.1	42.9	48.3		
Maximum current		I <sub>max</sub>	Α	30.5	60.9	94.7	114.1	111.4		
	N	n <sub>max</sub>	rpm	3000	6000		7500			
Marian and a divide basis a	R	n <sub>max</sub>	rpm	3000		•	5250			
Maximum speed with bearing	V	n <sub>max</sub>	rpm	3000	6000		7500			
•	Н	n <sub>max</sub>	rpm	3000	6000	9000 <sup>6</sup> )	1000	00 <sup>6</sup> )		
Continuous torque at standstill		M <sub>n1</sub>	Nm	116	116	120	108	100		
Continuous current at standstill		I <sub>n1</sub>	Α	14.7	29.3	45.3	55.2	55.5		
Torque constant at 20° C		K <sub>M_N</sub>	Nm/A	8.46	4.25	2.83	2.12	1.83		
Thermal time constant		T <sub>th</sub>	min			15				
Duty cycle time (S6-44%)		T <sub>C</sub> min			10					
Discharge capacity		Cab	nF		16					
Number of pole pairs		р				3				
Power wire cross-section <sup>2</sup> )		Α	mm²	1.5	4	10	10	16		
Moment of inertia 3)		$J_{rot}$	kgm²			0.079				
Mass <sup>3</sup> )		m	kg	81						
Sound pressure level 4)		L <sub>P</sub>	dB(A)			70 (+3)	)			
Ambient temperature in operation		T <sub>um</sub>	°C			0+40	)			
Insulation class according to DIN EN 6	0034-1					F				
Motor protection class						IP65				
Liquid cooling <sup>5</sup> )										
Power loss to be dissipated		$P_V$	kW	1.8	1.9	2	2.1	2.2		
Cooling agent Cooling agent inlet		Tin	°C			+10+4	40			
temperature Permissible increase	at P <sub>V</sub>	$\Delta T_{\text{diff}}$	K			10				
Decompression without snap-on coup	oling	$\Delta p_{diff}$	bar			0.22				
at Q <sub>N</sub> with snap-on coupling		$\Delta p_{diff}$	bar			0.45				
Required coolant flow at P <sub>V</sub>		Q <sub>min</sub>	l/min	2.7	2.8	2.9	3.1	3.2		
max. system pressure		p <sub>max</sub>	bar			3				
Holding brake (optional)				Electric	ally clampi	ng	Electrically re	leasing		
Transmittable torque		M <sub>4</sub>	Nm		100		80			
Connection voltage		U <sub>Br</sub>	V			DC 24 ± 1	0 %			
Rated current		$I_{Br}$	Α	1.5 1.6						
Moment of inertia		$J_{Br}$	kgm²							
Max. permissible braking energy		$W_{\text{max}}$	Ws			30000				
Disconnection time		t <sub>2</sub>	ms		65		140			
Connection time		t <sub>1</sub>	ms		110		50			
Maximum speed brake		n <sub>Br_max</sub>	rpm		8000		8000			
Mass		m	kg			8				
	l l			<u> </u>						

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values. Reference value 540  $V_{DC}$  DC bus voltage.

Fig. 4-81: Data sheet MAF130B



Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Value without holding brake. At 1m distance, with PWN = 4 kHz.

Data refer to water as a cooling agent. When other coolants are used, convert data. Observe the information on coolant entry temperature in Chapter 9.8.

Value without holding brake. Observe maximum speed of holding brake.

#### **Characteristic Curves of MAF130B Motors**

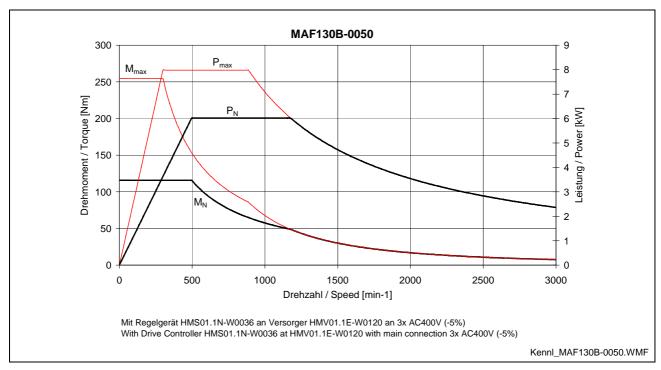


Fig. 4-82: Characteristic curve of MAF130B-0050 motors

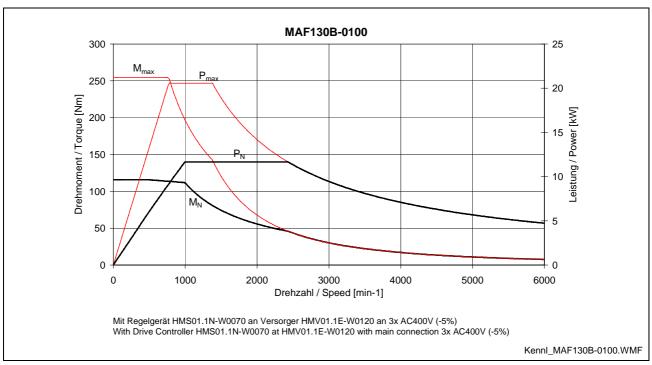


Fig. 4-83: Characteristic curve of MAF130B-0100 motors

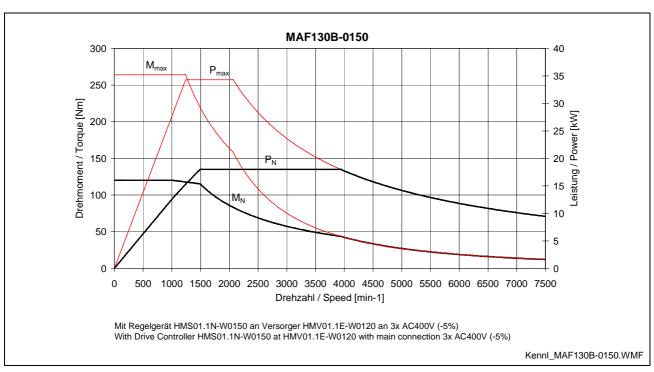


Fig. 4-84: Characteristic curve of MAF130B-0150 motors

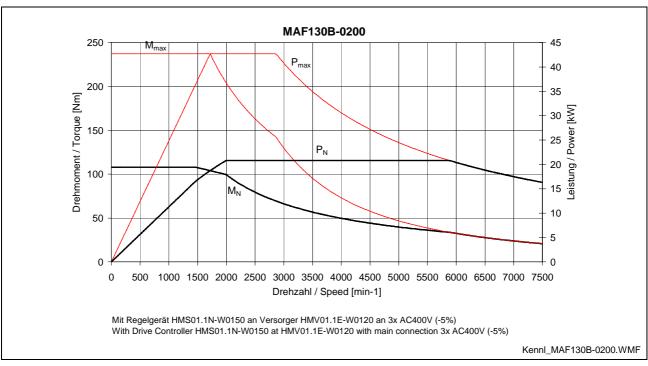


Fig. 4-85: Characteristic curve of MAF130B-0200 motors

4-58 Technical Data Rexroth IndraDyn A

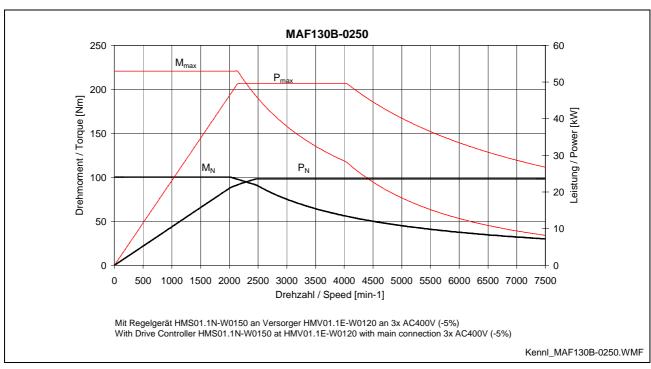


Fig. 4-86: Characteristic curve of MAF130B-0250 motors

# 4.18 Data Sheet MAF130C

Description		Symbol	Unit	MAF130C						
Motor data <sup>1</sup> )			•							
Winding				0050	0100	0150	0200	0250		
Rated torque		$M_N$	Nm	155	150	145	135	125		
Rated power		P <sub>N</sub>	kW	8.1	15.7	22.8	28.3	32.7		
Rated current		I <sub>N</sub>	Α	21	38	53.2	69.8	75.5		
Rated speed		$n_N$	rpm	500	1000	1500	2000	2500		
Key speed		n <sub>1</sub>	rpm	500	500	1000	1500	2000		
Maximum torque		$M_{\text{max}}$	Nm	340	330	330	315	298		
Maximum output		$P_{\text{max}}$	kW	16.6	32.2	46.7	58	67.1		
Maximum current		$I_{max}$	Α	42.6	71.8	111	142.9	150.8		
	N	n <sub>max</sub>	rpm	3000	6000		7500			
Maximum speed with bearing	R	n <sub>max</sub>	rpm	3000		5	5250	50		
Maximum speed with bearing	V	n <sub>max</sub>	rpm	3000	6000		7500			
<u> </u>	Н	n <sub>max</sub>	rpm	3000	6000	9000 <sup>6</sup> )	100	00 <sup>6</sup> )		
Continuous torque at standstill		M <sub>n1</sub>	Nm	155	155	150	143	135		
Continuous current at standstill		I <sub>n1</sub>	Α	21	39	54.7	71.2	75.5		
Torque constant at 20° C		$K_{M\_N}$	Nm/A	8.04	5.09	3.04	2.19	1.88		
Thermal time constant		$T_{th}$	min			15				
Duty cycle time (S6-44%)		T <sub>C</sub>	min			10	10			
Discharge capacity		$C_{ab}$	nF	20	15.4	20	16.8	20		
Number of pole pairs		р				3				
Power wire cross-section <sup>2</sup> )		Α	mm²	2.5	6	16	16	25		
Moment of inertia <sup>3</sup> )		$J_{rot}$	kgm²			0.101				
Mass <sup>3</sup> )		m	kg	106						
Sound pressure level 4)		$L_P$	dB(A)	70 (+3)						
Ambient temperature in operation		$T_{um}$	°C			0+40				
Insulation class according to DIN EN 6	0034-1					F				
Motor protection class					IP65					
Liquid cooling <sup>5</sup> )										
Power loss to be dissipated		$P_V$	kW			2.3				
Cooling agent inlet		T <sub>in</sub>	°C			+10+40	<u> </u>			
temperature Permissible increase		$\Delta T_{diff}$	K			10				
Decompression without snap-on coup	oling	$\Delta p_{\text{diff}}$	bar			0.35				
at Q <sub>N</sub> with snap-on coupling	g	$\Delta p_{diff}$	bar			0.7				
Required coolant flow at P <sub>V</sub>		$Q_{\text{min}}$	l/min			3.4				
max. system pressure		p <sub>max</sub>	bar			3				
Holding brake (optional)				Electric	ally clampi	ng E	Electrically re	eleasing		
Transmittable torque		$M_4$	Nm		100		80			
Connection voltage		$U_{\text{Br}}$	V			DC 24 ± 10	%			
Rated current		$I_{Br}$	Α	1.5 1.6						
Moment of inertia		$J_Br$	kgm²			0.002				
Max. permissible braking energy		$W_{\text{max}}$	Ws			30000				
Disconnection time		t <sub>2</sub>	ms		65		140			
Connection time		t <sub>1</sub>	ms		110		50			
Maximum speed brake		n <sub>Br_max</sub>	rpm		8000		8000			
Mass		m	kg			8				

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values.
 Reference value 540 V<sub>DC</sub> DC bus voltage.

Fig. 4-87: Data sheet MAF130C



Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

<sup>3)</sup> Value without holding brake.

At 1m distance, with PWN = 4 kHz.

Data refer to water as a cooling agent. When other coolants are used, convert data. Observe the information on coolant entry temperature in Chapter 9.8.

<sup>&</sup>lt;sup>6</sup>) Value without holding brake. Observe maximum speed of holding brake.

# **Characteristic Curves of MAF130C Motors**

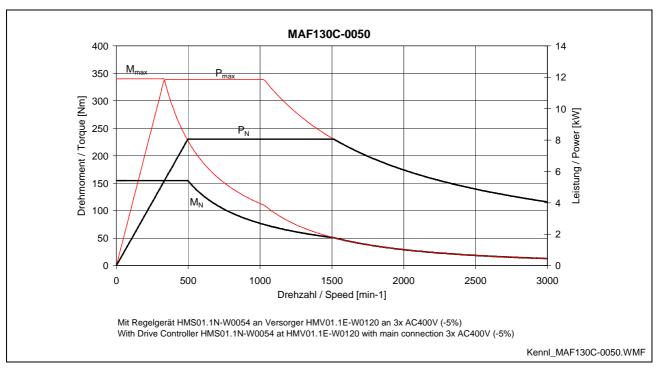


Fig. 4-88: Characteristic curve of MAF130C-0050 motors

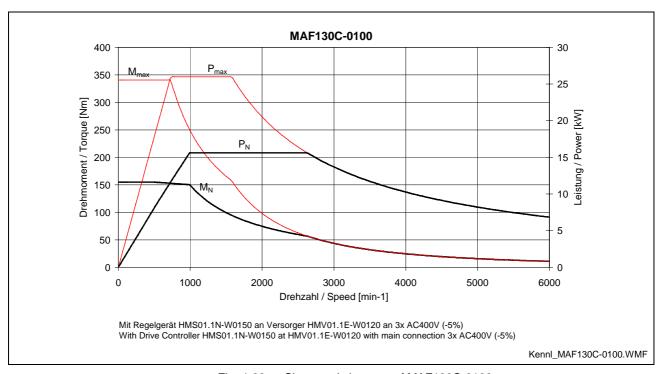


Fig. 4-89: Characteristic curve of MAF130C-0100 motors

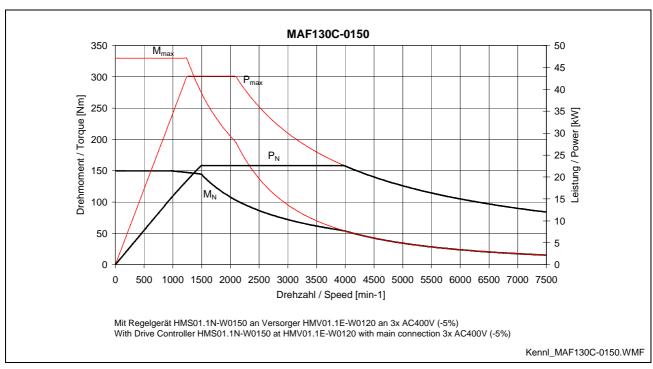


Fig. 4-90: Characteristic curve of MAF130C-0150 motors

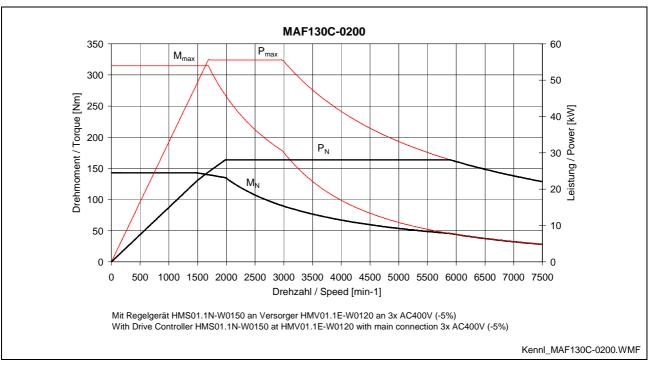


Fig. 4-91: Characteristic curve of MAF130C-0200 motors

4-62 Technical Data

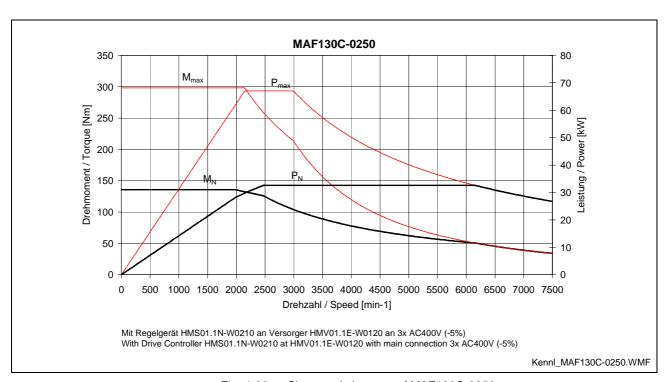


Fig. 4-92: Characteristic curve of MAF130C-0250 motors

Rexroth IndraDyn A

# 4.19 Data Sheet MAF130D

Description		Symbol	Unit	MAF130D						
Motor data <sup>1</sup> )			•							
Winding				0050	0100	0150	0200	0250		
Rated torque		M <sub>N</sub>	Nm	230	220	200	200	190		
Rated power		P <sub>N</sub>	kW	12	23	31.4	41.9	49.7		
Rated current		I <sub>N</sub>	Α	32.3	52	72.6	93.9	113		
Rated speed		n <sub>N</sub>	rpm	500	1000	1500	2000	2500		
Key speed		n <sub>1</sub>	rpm	500	500	1000	1500	2000		
Maximum torque		M <sub>max</sub>	Nm	506	506	484	461	432		
Maximum output		P <sub>max</sub>	kW	24.6	47.2	64.4	85.9	102		
Maximum current		I <sub>max</sub>	Α	64.3	108	155.4	190.9	214.9		
	Ν	n <sub>max</sub>	rpm	3000	6000		7500			
Maximum apond with boaring	R	n <sub>max</sub>	rpm	3000		;	5250			
Maximum speed with bearing	V	n <sub>max</sub>	rpm	3000	6000		7500			
	Н	n <sub>max</sub>	rpm	3000	6000	9000 <sup>6</sup> )	100	00 <sup>6</sup> )		
Continuous torque at standstill		$M_{n1}$	Nm	230	230	220	210	200		
Continuous current at standstill		I <sub>n1</sub>	Α	32.3	53.8	78	97.5	113		
Torque constant at 20° C		K <sub>M_N</sub>	Nm/A	7.71	4.81	3.21	2.51	2.04		
Thermal time constant		$T_th$	min			15				
Duty cycle time (S6-44%)		T <sub>C</sub>	min			10	0			
Discharge capacity		$C_{ab}$	nF	27.5	27.5	27.5	25.1	27.5		
Number of pole pairs		р				3				
Power wire cross-section <sup>2</sup> )		Α	mm²	6	10	25	25	35		
Moment of inertia <sup>3</sup> )		$J_{rot}$	kgm²			0.151				
Mass <sup>3</sup> )		m	kg	147						
Sound pressure level 4)		$L_P$	dB(A)		70 (+3)					
Ambient temperature in operation		$T_{um}$	°C	0+40						
Insulation class according to DIN EN 6	0034-1					F				
Motor protection class				IP65						
Liquid cooling <sup>5</sup> )										
Power loss to be dissipated		$P_V$	kW			3.3				
Cooling agent  Cooling agent inlet		T <sub>in</sub>	°C			+10+40	)			
temperature Permissible increase		$\Delta T_{diff}$	K			10				
Decompression without snap-on coup	oling	$\Delta p_{diff}$	bar			0.5				
at Q <sub>N</sub> with snap-on coupling	g	$\Delta p_{diff}$	bar			1.0				
Required coolant flow at P <sub>V</sub>		$Q_{min}$	l/min			4.8				
max. system pressure		$p_{\text{max}}$	bar			3				
Holding brake (optional)				Electric	ally clampi	ng	Electrically re	eleasing		
Transmittable torque		$M_4$	Nm		100		80			
Connection voltage		$U_{\text{Br}}$	V			DC 24 ± 10	%			
Rated current		$I_{Br}$	Α	1.5 1.6						
Moment of inertia		$J_{\text{Br}}$	kgm²			0.002				
Max. permissible braking energy		$W_{\text{max}}$	Ws			30000				
Disconnection time		t <sub>2</sub>	ms		140		110			
Connection time		t <sub>1</sub>	ms		110		70			
Maximum speed brake		$n_{\text{Br\_max}}$	rpm		8000		8000			
Mass		m	kg			8				

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values.
 Reference value 540 V<sub>DC</sub> DC bus voltage.

Fig. 4-93: Data sheet MAF130D



Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

<sup>3)</sup> Value without holding brake.

At 1m distance, with PWN = 4 kHz.

Data refer to water as a cooling agent. When other coolants are used, convert data. Observe the information on coolant entry temperature in Chapter 9.8.

Value without holding brake. Observe maximum speed of holding brake.

# **Characteristic Curves of MAF130D Motors**

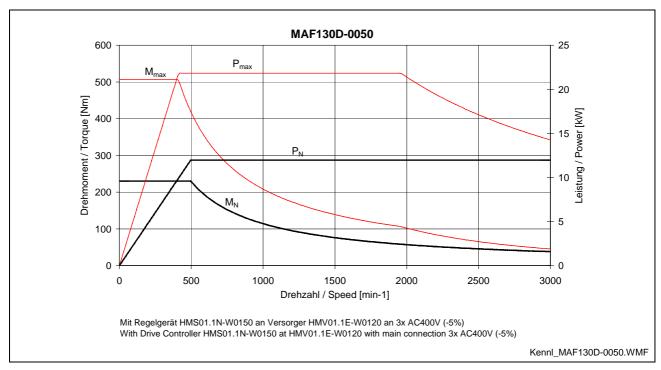


Fig. 4-94: Characteristic curve of MAF130D-0050 motors

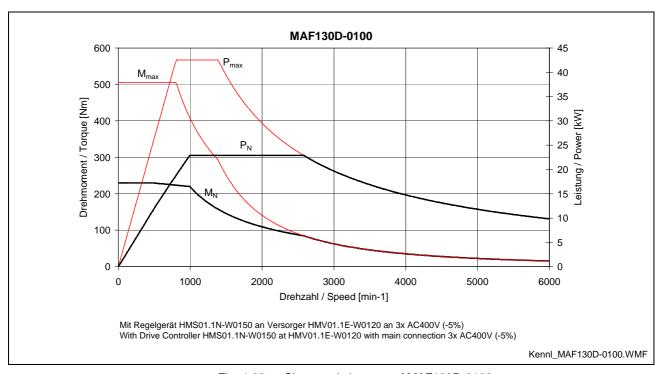


Fig. 4-95: Characteristic curve of MAF130D-0100 motors

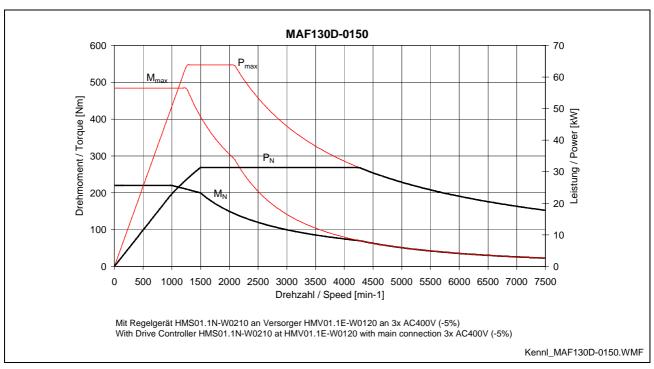


Fig. 4-96: Characteristic curve of MAF130D-0150 motors

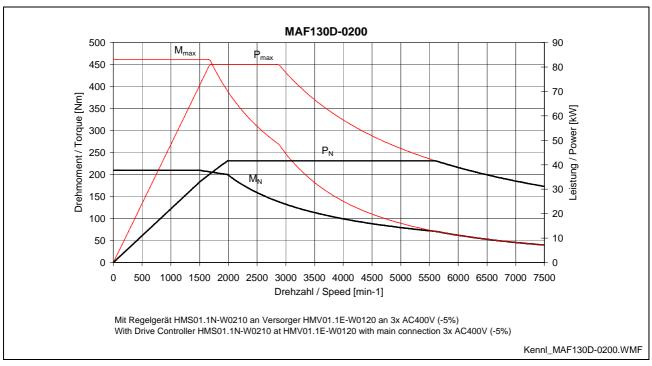


Fig. 4-97: Characteristic curve of MAF130D-0200 motors

4-66 Technical Data Rexroth IndraDyn A

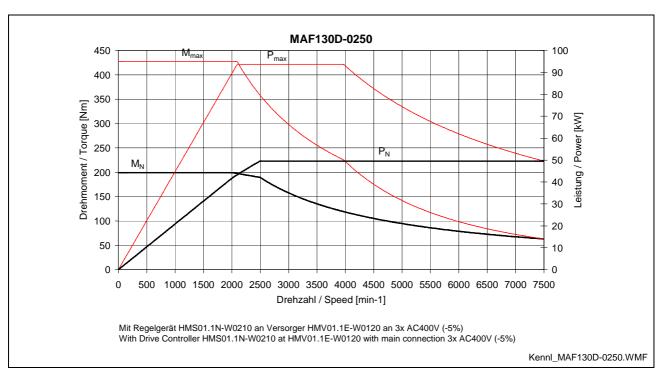


Fig. 4-98: Characteristic curve of MAF130D-0250 motors

# 4.20 Data Sheet MAF160B

Description	S	Symbol	Unit	MAF160B				
Motor data <sup>1</sup> )	<u>'</u>	l.						
Winding				0050	0100	0150	0200	
Rated torque		M <sub>N</sub>	Nm	270	260	250	240	
Rated power		P <sub>N</sub>	kW	14.1	27.2	39.3	50.3	
Rated current		I <sub>N</sub>	Α	34.2	73.7	89.5	108.5	
Rated speed		n <sub>N</sub>	rpm	500	1000	1500	2000	
Key speed		n <sub>1</sub>	rpm	500	500	1000	1500	
Maximum torque		M <sub>max</sub>	Nm	594	593	571	550	
Maximum output		P <sub>max</sub>	kW	28.9	55.8	80.6	103.1	
Maximum current		I <sub>max</sub>	Α	65.4	149	179.7	232.7	
	N	n <sub>max</sub>	rpm	3000	110	6000		
		n <sub>max</sub>	rpm	3000		4200		
Maximum speed with bearing	V	n <sub>max</sub>	rpm	3000		6000		
•	Н	n <sub>max</sub>	rpm		not av			
Continuous torque at standstill		M <sub>n1</sub>	Nm	270	270	260	250	
Continuous current at standstill		I <sub>n1</sub>	Α	34.2	75.8	92.1	112.3	
Torque constant at 20° C		K <sub>M_N</sub>	Nm/A	9.5	4.13	3.3	2.4	
Thermal time constant		T <sub>th</sub>	min					
Duty cycle time (S6-44%)		T <sub>C</sub>	min					
Discharge capacity		C <sub>ab</sub>	nF	26.9	35	35	21.7	
Number of pole pairs		р			3			
Power wire connection <sup>2</sup> )		A	mm²	6	25	25	35	
Moment of inertia 3)		$J_{rot}$	kgm²	0.23				
Mass <sup>3</sup> )		m	kg	197				
Sound pressure level 4)		L <sub>P</sub>	dB(A)	72 (+3)				
Ambient temperature in operation		T <sub>um</sub>	°C		0	,		
Insulation class according to DIN EN 600	034-1				F			
Motor protection class					IP	65		
Liquid cooling <sup>5</sup> )								
Power loss to be dissipated		$P_V$	kW	2.7	4.	0	4.5	
Cooling agent  Cooling agent inlet		Tin	°C		+10	+40		
temperature Permissible increase a	it P <sub>V</sub>	$\Delta T_{diff}$	K		1	0		
Decompression without snap-on coupling	ng	$\Delta p_{diff}$	bar		0.2	25		
at Q <sub>N</sub> with snap-on coupling		$\Delta p_{diff}$	bar		0.	5		
Required coolant flow at P <sub>V</sub>		Q <sub>min</sub>	l/min	3.8	5.	8	6.5	
max. system pressure		p <sub>max</sub>	bar		3	3		
Holding brake (optional)				Electricall	y clamping	Electricall	y releasing	
Transmittable torque		M <sub>4</sub>	Nm	·	10	00		
Connection voltage		U <sub>Br</sub>	V	DC 24 ± 10 %				
Rated current		I <sub>Br</sub>	Α	1	.8	2	.0	
Moment of inertia		$J_{Br}$	kgm²		0.00	065		
Max. permissible braking energy		W <sub>max</sub>	Ws		400	000		
Disconnection time		t <sub>2</sub>	ms	1	00	1:	90	
Connection time		t <sub>1</sub>	ms	8	35	1	2	
Mass		m	kg		2	0		

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values. Reference value 540  $V_{DC}$  DC bus voltage. Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Fig. 4-99: Data sheet MAF160B



Value without holding brake.

At 1m distance, with PWN = 4 kHz.

Data refer to water as a cooling agent. When other coolants are used, convert data. Observe the information on coolant entry temperature in Chapter 9.8.

#### **Characteristic Curves of MAF160B Motors**

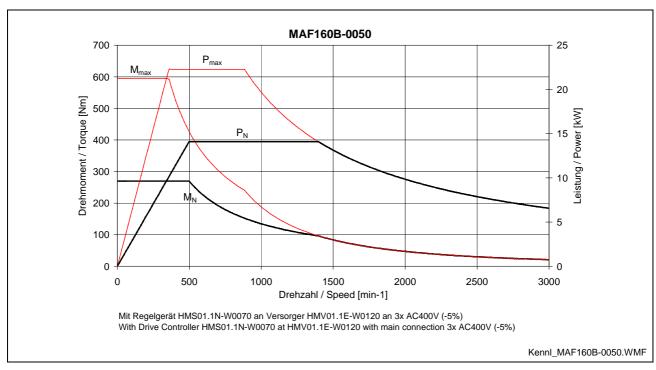


Fig. 4-100: Characteristic curve of MAF160B-0050 motors

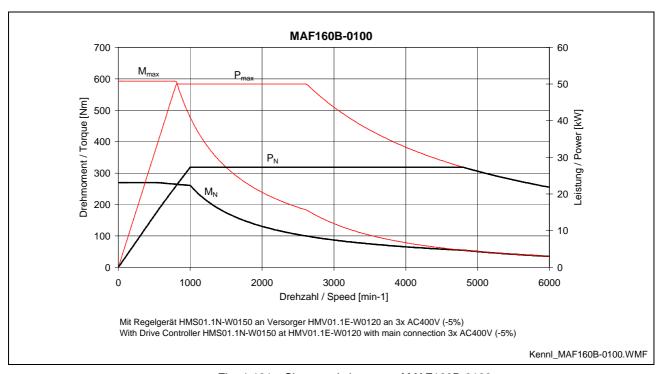


Fig. 4-101: Characteristic curve of MAF160B-0100 motor

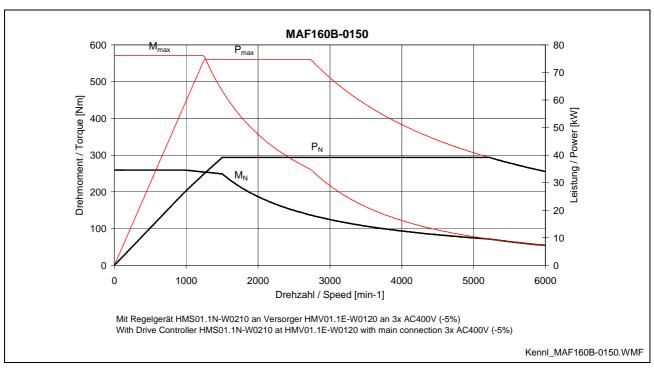


Fig. 4-102: Characteristic curve of MAF160B-0150 motors

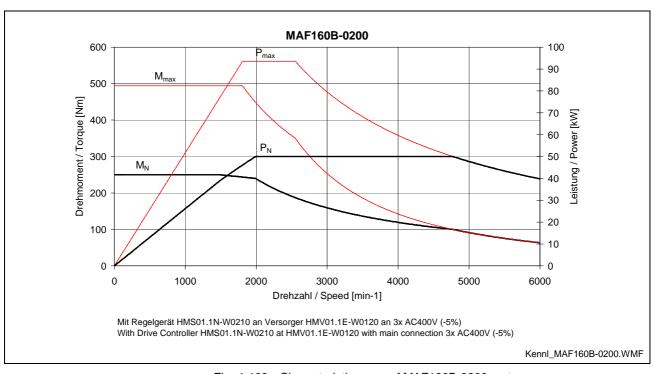


Fig. 4-103: Characteristic curve of MAF160B-0200 motors

# 4.21 Data Sheet MAF160C

Description	Sym	bol	Unit	MAF160C			
Motor data <sup>1</sup> )	1						
Winding				0050	0100	0150	0200
Rated torque	Mı	N	Nm	340	325	300	285
Rated power	Pı	٧	kW	17.8	34	47.1	59.7
Rated current	I <sub>N</sub>		Α	47.4	91.2	109.5	136
Rated speed	n <sub>l</sub>	1	rpm	500	1000	1500	2000
Key speed	n <sub>1</sub>	I	rpm	500	500	1000	1500
Maximum torque	M <sub>m</sub>	ax	Nm	748	746	681	677
Maximum output	Pm		kW	36.5	69.7	96.6	122.4
Maximum current	I <sub>ma</sub>	ax	Α	98	196	212.2	290.7
	N n <sub>m</sub>		rpm	3000		6000	
	R n <sub>m</sub>		rpm	3000		4200	
Maximum speed with bearing	V n <sub>m</sub>		rpm	3000		6000	
	H n <sub>m</sub>		rpm		not av		
Continuous torque at standstill	Mr		Nm	340	340	310	295
Continuous current at standstill	In	1	Α	47.4	94.8	111.9	141.4
Torque constant at 20° C	K <sub>M</sub>		Nm/A	7.76	3.88	3.37	2.3
Thermal time constant	T <sub>tl</sub>		min		2		
Duty cycle time (S6-44%)	To		min				
Discharge capacity	Ca		nF	28	28	28.8	25.3
Number of pole pairs	р				3		
Power wire cross-section <sup>2</sup> )	A		mm²	10	25	35	2x16
Moment of inertia 3)	J <sub>rc</sub>	ot	kgm²	0.26			
Mass <sup>3</sup> )	m		kg	227			
Sound pressure level <sup>4</sup> )	L	,	dB(A)	72 (+3)			
Ambient temperature in operation	Tu	m	°C		0		
Insulation class according to DIN EN	60034-1				F		
Motor protection class					IP	65	
Liquid cooling <sup>5</sup> )	1						
Power loss to be dissipated	Py	/	kW	4.	.5	3.8	4.2
Cooling agent Cooling agent inlet	Tii	n	°C		+10	+40	
temperature Permissible increas	e at P <sub>V</sub> ΔT <sub>o</sub>	diff	K		1	0	
Decompression _without snap-on cou			bar		0.	.5	
at Q <sub>N</sub> with snap-on coupling			bar		1.	.0	
Required coolant flow at P <sub>V</sub>	Qm		l/min	6	.5	5.5	6
max. system pressure	p <sub>m</sub>		bar		3		
Holding brake (optional)	1	un.		Electrically			y releasing
Transmittable torque	M	4	Nm	<u> </u>	10	00	<u> </u>
Connection voltage	UE		V		DC 24		
Rated current	I <sub>B</sub>		Α	1.			2.0
Moment of inertia	J <sub>B</sub>		kgm²		0.00		
Max. permissible braking energy	Wm		Ws		400		
Disconnection time	t <sub>2</sub>		ms	10	00		90
Connection time	t <sub>1</sub>		ms	8	5		12
Mass	m		kg	85 12 20			

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values. Reference value 540  $V_{DC}$  DC bus voltage. Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Fig. 4-104: Data sheet MAF160C

Value without holding brake.

At 1m distance, with PWN = 4 kHz.

Data refer to water as a cooling agent. When other coolants are used, convert data. Observe the information on coolant entry temperature in Chapter 9.8.

#### **Characteristic Curves of MAF160C Motors**

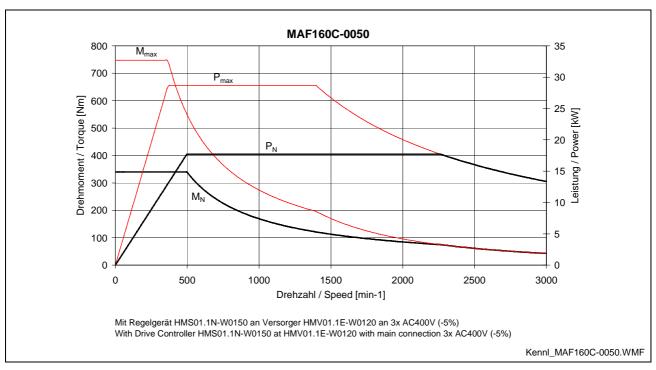


Fig. 4-105: Characteristic curve of MAF160C-0050 motors

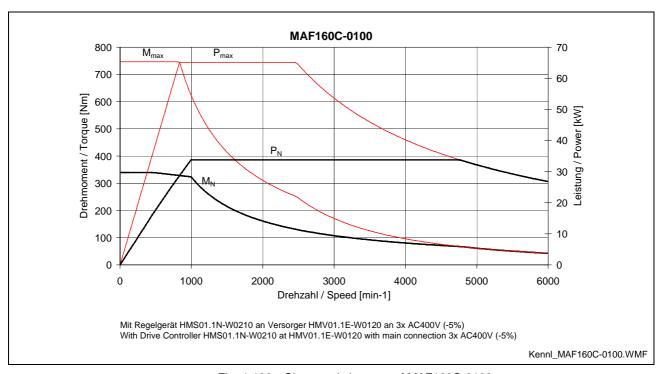


Fig. 4-106: Characteristic curve of MAF160C-0100 motor

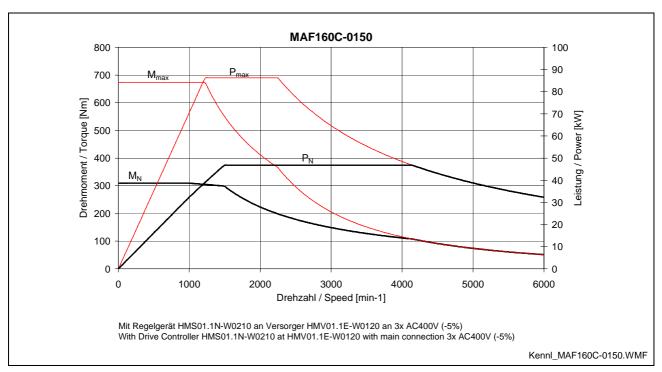


Fig. 4-107: Characteristic curve of MAF160C-0150 motors

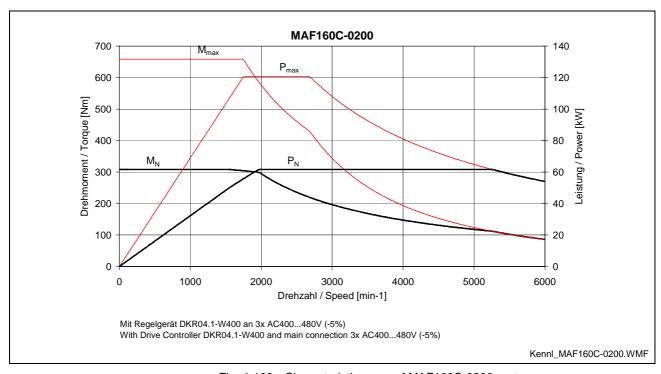


Fig. 4-108: Characteristic curve of MAF160C-0200 motors

**Technical Data 4-73** Rexroth IndraDyn A

# 4.22 Data Sheet MAF180C

Description		Symbol	Unit	MAF180C					
Motor data <sup>1</sup> )	•	'							
Winding				0050	0100	0150	0200		
Rated torque		M <sub>N</sub>	Nm	435	390	365	318		
Rated power		P <sub>N</sub>	kW	22.8	40.8	57.3	66.6		
Rated current		I <sub>N</sub>	Α	50	90.7	128.8	154		
Rated speed		n <sub>N</sub>	rpm	500	1000	1500	2000		
Key speed		n <sub>1</sub>	rpm	500	500	1000	1500		
Maximum torque		M <sub>max</sub>	Nm	986	957	858	739		
Maximum output		P <sub>max</sub>	kW	46.7	83.7	117.5	136.5		
Maximum current		I <sub>max</sub>	Α	104.7	208	280.9	318.9		
	N	n <sub>max</sub>	rpm	3000		6000	•		
Novimum apped with boaring		n <sub>max</sub>	rpm	3000		4200			
Maximum speed with bearing	V	n <sub>max</sub>	rpm	3000		6000			
	Н	n <sub>max</sub>	rpm		not ava				
Continuous torque at standstill		M <sub>n1</sub>	Nm	435	435	390	336		
Continuous current at standstill		I <sub>n1</sub>	Α	50	99.7	136.1	160.5		
Torque constant at 20° C		K <sub>M N</sub>	Nm/A	9.61	4.67	3.11	2.39		
Thermal time constant		T <sub>th</sub>	min	25					
Duty cycle time (S6-44%)		T <sub>C</sub>	min		10				
Discharge capacity		Cab	nF	32.5	30	30	38.9		
Number of pole pairs		р			3	}	,		
Power wire cross-section <sup>2</sup> )		A	mm²	10	25	2x16	2x25		
Moment of inertia 3)		J <sub>rot</sub>	kgm²	0.49					
Mass <sup>3</sup> )		m	kg	322					
Sound pressure level <sup>4</sup> )		L <sub>P</sub>	dB(A)		75 (	+3)			
Ambient temperature in operation		T <sub>um</sub>	°C		0				
Insulation class according to DIN EN	I 60034-1				F				
Motor protection class					IP6				
Liquid cooling <sup>5</sup> )	•								
Power loss to be dissipated		Pv	kW		4.	5			
Cooling agent Cooling agent inlet	i	T <sub>in</sub>	°C		+10	.+40			
temperature Permissible increase	se at P <sub>V</sub>	$\Delta T_{diff}$	K		10	)			
Decompression without snap-on co	oupling	$\Delta p_{diff}$	bar		0.	5			
at Q <sub>N</sub> with snap-on coupl	ling	$\Delta p_{diff}$	bar		1.	0			
Required coolant flow at P <sub>V</sub>	J	Q <sub>min</sub>	l/min		6.				
max. system pressure		p <sub>max</sub>	bar		3				
Holding brake (optional)		Tillax		Electrically	y clamping		y releasing		
Transmittable torque		M <sub>4</sub>	Nm	30	00	2-	40		
Connection voltage		U <sub>Br</sub>	V		DC 24 :	± 10 %			
Rated current		I <sub>Br</sub>	Α	2	2		87		
Moment of inertia		J <sub>Br</sub>	kgm²		0.01	188			
Max. permissible braking energy		W <sub>max</sub>	Ws		700				
Disconnection time		t <sub>2</sub>	ms	9	0		00		
Connection time		t <sub>1</sub>	ms	15	50	3	30		
Mass		m	kg		2	5			
,				20					

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values. Reference value 540  $V_{DC}$  DC bus voltage.

Fig. 4-109: Data sheet MAF180C



Rated for cable assemblies with current carrying capacity according to VDE0298-4 (1992) and installation type B2 according to EN 60204-1 (1993) at 40°C ambient temperature.

Values without holding brake. At 1m distance, with PWN = 4 kHz.

Data refer to water as a cooling agent. When other coolants are used, convert data. Observe the information on coolant entry temperature in Chapter 9.8.

#### **Characteristic Curves of MAF180C Motors**

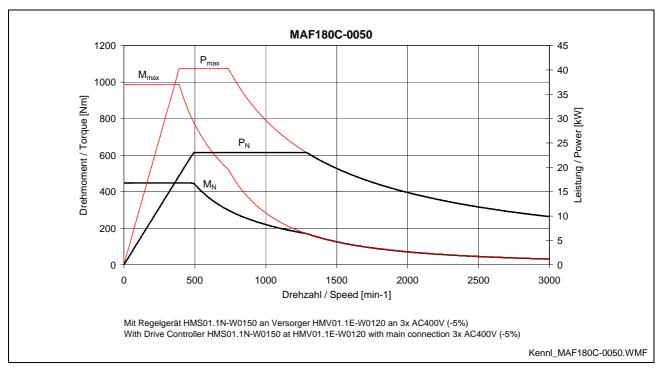


Fig. 4-110: Characteristic curve of MAF180C-0050 motors

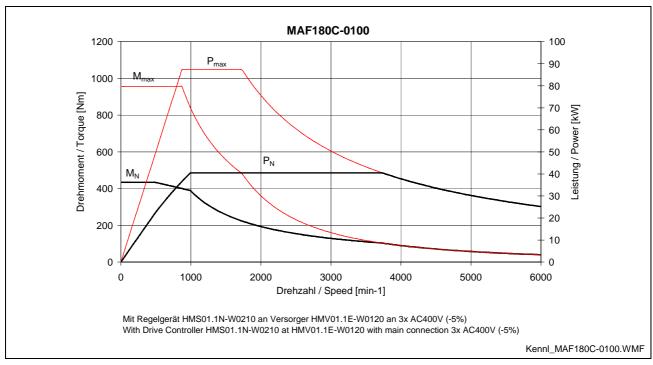


Fig. 4-111: Characteristic curve of MAF180C-0100 motors

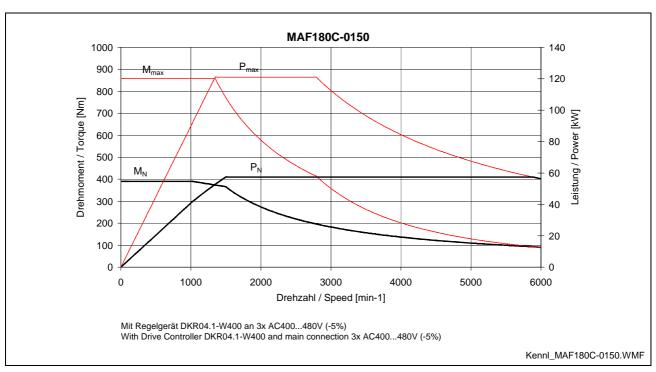


Fig. 4-112: Characteristic curve of MAF180C-0150 motors

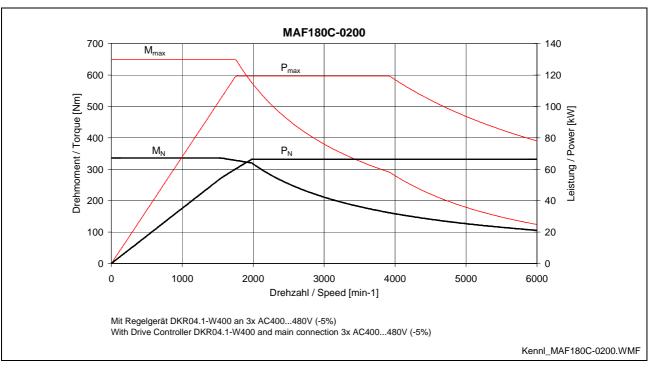


Fig. 4-113: Characteristic curve of MAF180C-0200 motors

# 4.23 Data Sheet MAF180D

Description	Symbol	Unit	MAF180D					
Motor data <sup>1</sup> )								
Winding			0050	0100	0150	0200		
Rated torque	M <sub>N</sub>	Nm	500	460	435	400		
Rated power	P <sub>N</sub>	kW	26.2	48.1	68.3	83.8		
Rated current	I <sub>N</sub>	Α	60.4	94.8	146.1	168.5		
Rated speed	n <sub>N</sub>	rpm	500	1000	1500	2000		
Key speed	n <sub>1</sub>	rpm	500	500	1000	1500		
Maximum torque	M <sub>max</sub>	Nm	1100	1094	1013	1008		
Maximum output	P <sub>max</sub>	kW	53.7	98.8	140	171.8		
Maximum current	I <sub>max</sub>	Α	117.3	213.1	294.9	377.1		
N	n <sub>max</sub>	rpm	3000		6000	•		
R		rpm	3000		4200			
Maximum speed with bearing V	n <sub>max</sub>	rpm	3000		6000			
H	n <sub>max</sub>	rpm		not ava	uilable			
Continuous torque at standstill	M <sub>n1</sub>	Nm	500	500	460	460		
Continuous current at standstill	I <sub>n1</sub>	Α	60.4	101.9	142.1	187.3		
Torque constant at 20° C	K <sub>M_N</sub>	Nm/A	10	5.23	3.49	2.75		
Thermal time constant	T <sub>th</sub>	min	25					
Duty cycle time (S6-44%)	T <sub>C</sub>	min		1	0			
Discharge capacity	C <sub>ab</sub>	nF	37.4	38	38	50		
Number of pole pairs	р			3	3	•		
Power wire cross-section <sup>2</sup> )	Α	mm²	16	35	50	2x25		
Moment of inertia 3)	$J_{rot}$	kgm²	0.61					
Mass <sup>3</sup> )	m	kg	382					
Sound pressure level <sup>4</sup> )	L <sub>P</sub>	dB(A)	75 (+3)					
Ambient temperature in operation	T <sub>um</sub>	°C		0	+40			
Insulation class according to DIN EN 60034-	-1			F	=			
Motor protection class				IP	65			
Liquid cooling <sup>5</sup> )								
Power loss to be dissipated	P <sub>V</sub>	kW		3.5		5.4		
Cooling agent Cooling agent inlet	T <sub>in</sub>	°C		+10	+40			
temperature Permissible increase at P	$ \sqrt{\Delta T_{diff}} $	K		1	0			
Decompression without snap-on coupling	$\Delta p_{diff}$	bar		0.	4			
at Q <sub>N</sub> with snap-on coupling	$\Delta p_{diff}$	bar		0.	8			
Required coolant flow at P <sub>V</sub>	Q <sub>min</sub>	l/min		5.1		7.9		
max. system pressure	p <sub>max</sub>	bar		3	3			
Holding brake (optional)			Electricall	y clamping	Electricall	y releasing		
Transmittable torque	M <sub>4</sub>	Nm	3	00	2	40		
Connection voltage	$U_{Br}$	V		DC 24	± 10 %			
Rated current	I <sub>Br</sub>	Α		2	1.	87		
Moment of inertia	$J_{Br}$	kgm²		0.0	188			
Max. permissible braking energy	W <sub>max</sub>	Ws		700	000			
Disconnection time	t <sub>2</sub>	ms	9	00	3	00		
Connection time	t <sub>1</sub>	ms	1:	50	3	30		
Mass	m	kg		2	5			

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values. Reference value 540  $V_{DC}$  DC bus voltage. Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Fig. 4-114: Data sheet MAF180D

Values without holding brake.

At 1m distance, with PWN = 4 kHz.

Data refer to water as a cooling agent. When other coolants are used, convert data. Observe the information on coolant entry temperature in Chapter 9.8.

#### **Characteristic Curves of MAF180D Motors**

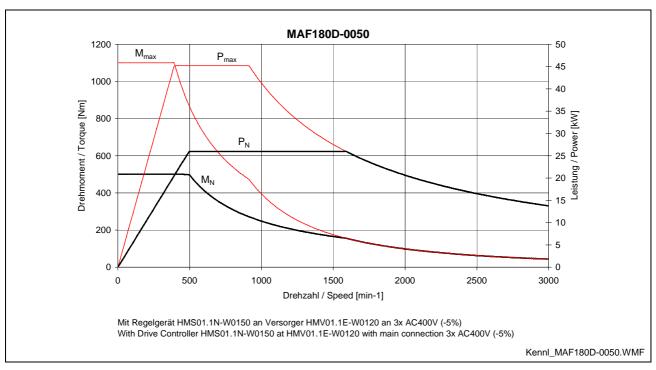


Fig. 4-115: Characteristic curve of MAF180D-0050 motors

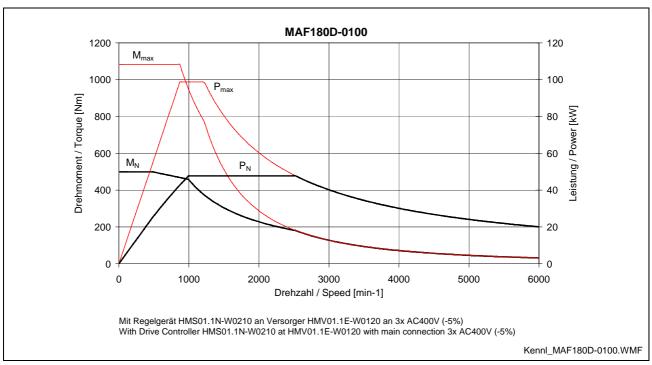


Fig. 4-116: Characteristic curve of MAF180D-0100 motors

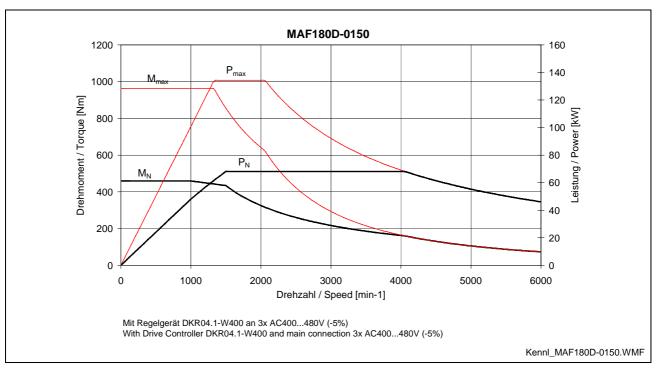


Fig. 4-117: Characteristic curve of MAF180D-0150 motors

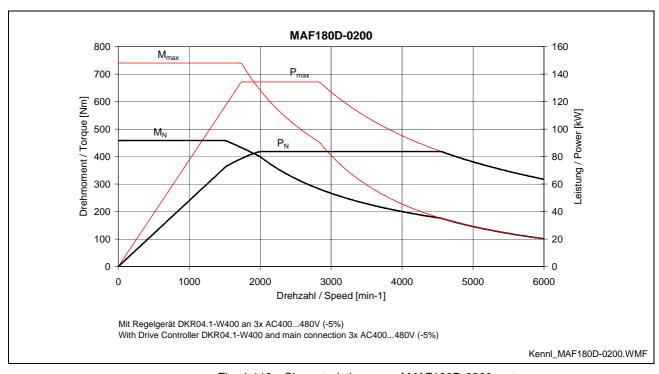


Fig. 4-118: Characteristic curve of MAF180D-0200 motors

**Technical Data 4-79** Rexroth IndraDyn A

# 4.24 Data Sheet MAF225C

Description	!	Symbol	Unit		MAF225C			
Motor data <sup>1</sup> )	•							
Winding				0050*	0100*	0150		
Rated torque		M <sub>N</sub>	Nm	820	790	764		
Rated power		P <sub>N</sub>	kW	42.9	82.7	120		
Rated current		I <sub>N</sub>	Α	98	170	215		
Rated speed		n <sub>N</sub>	rpm	500	1000	1500		
Key speed		n <sub>1</sub>	rpm	500	500	1000		
Maximum torque		M <sub>max</sub>	Nm	1750	1750	1750		
Maximum output		P <sub>max</sub>	kW	88	170	246		
Maximum current		I <sub>max</sub>	Α	215	375	489		
	N	n <sub>max</sub>	rpm	3000	3750	3750		
Maximum and with bearing	R	n <sub>max</sub>	rpm	not available				
Maximum speed with bearing	V	n <sub>max</sub>	rpm	3000	3750	3750		
_	Н	n <sub>max</sub>	rpm		not available			
Continuous torque at standstill		M <sub>n1</sub>	Nm	820	820	825		
Continuous current at standstill		I <sub>n1</sub>	Α	98	179	228		
Torque constant at 20° C		K <sub>M_N</sub>	Nm/A	9.7	5	3.68		
Thermal time constant		$T_th$	min	35	35	35		
Duty cycle time (S6-44%)		Tc	min	5	5	5		
Discharge capacity		C <sub>ab</sub>	nF	43.9	43.9	43.9		
Number of pole pairs		р			3			
Power wire cross-section <sup>2</sup> )		Α	mm²	2 x 16	2 x 25	2x35		
Moment of inertia <sup>3</sup> )		$J_{\text{rot}}$	kgm²		1.65			
Mass <sup>3</sup> )		m	kg		587			
Sound pressure level 4)		$L_P$	dB(A)		75 (+3)			
Ambient temperature in operation		$T_{um}$	°C		0+40			
Insulation class according to DIN EN	60034-1				F			
Motor protection class					IP65			
Liquid cooling <sup>5</sup> )								
Power loss to be dissipated		$P_V$	kW		8			
Cooling agent  Cooling agent inlet		Tin	°C		+10+40			
temperature Permissible increas		$\Delta T_{diff}$	K		10			
Decompression without snap-on cou	upling	$\Delta p_{diff}$	bar		0.8			
at Q <sub>N</sub> with snap-on coupling		$\Delta p_{diff}$	bar		1.6			
Required coolant flow at P <sub>V</sub>		Q <sub>min</sub>	l/min		11.5			
max. system pressure		p <sub>max</sub>	bar		3			

Values determined according to IEC 60034-1. Current and voltage specified as root-mean-square values. Reference value 540 V<sub>DC</sub> DC bus voltage.

Please note the explanations on power wire cross section in Chapter 4.2, Operating Behavior.

Fig. 4-121: Data sheet MAF225C

Values without holding brake.

At 1m distance, with PWN = 4 kHz.

Data refer to water as a cooling agent. When other coolants are used, convert data. Observe the information on coolant entry temperature in Chapter 9.8.

Preliminary data

# **Characteristic Curves MAF225C Motors**

in preparation

Fig. 4-119: Characteristic curves MAF225C motors

# 5 Dimension Sheets IndraDyn A

#### 5.1 Frame Size MAD100

## **MAD100** without Holding Brake

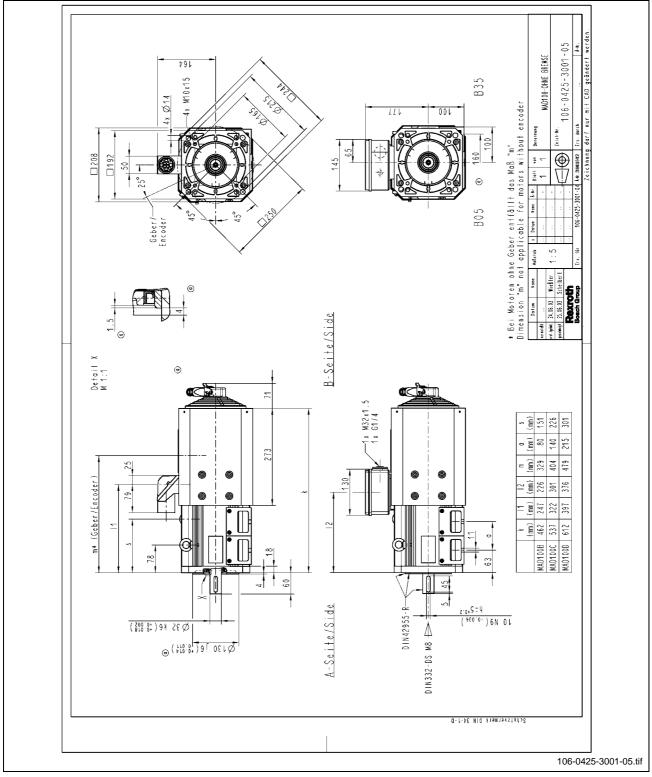


Fig. 5-1: Dimension sheet for MAD100 without holding brake

#### MAD100 with Brake 1 or 5

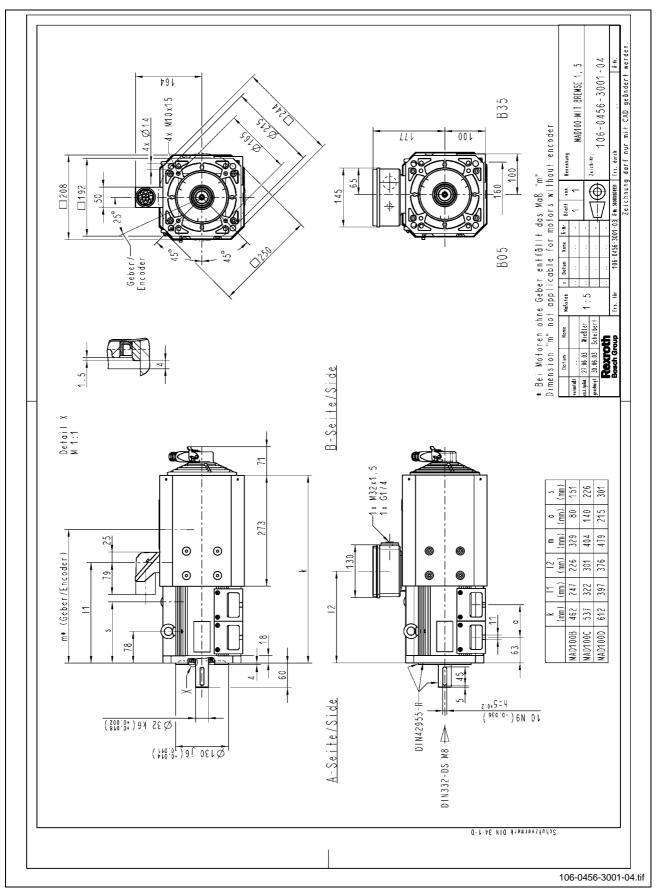


Fig. 5-2: Dimension sheet MAD100 with brake 1 or 5

#### MAD100 with Fan Cowl, without Holding Brake

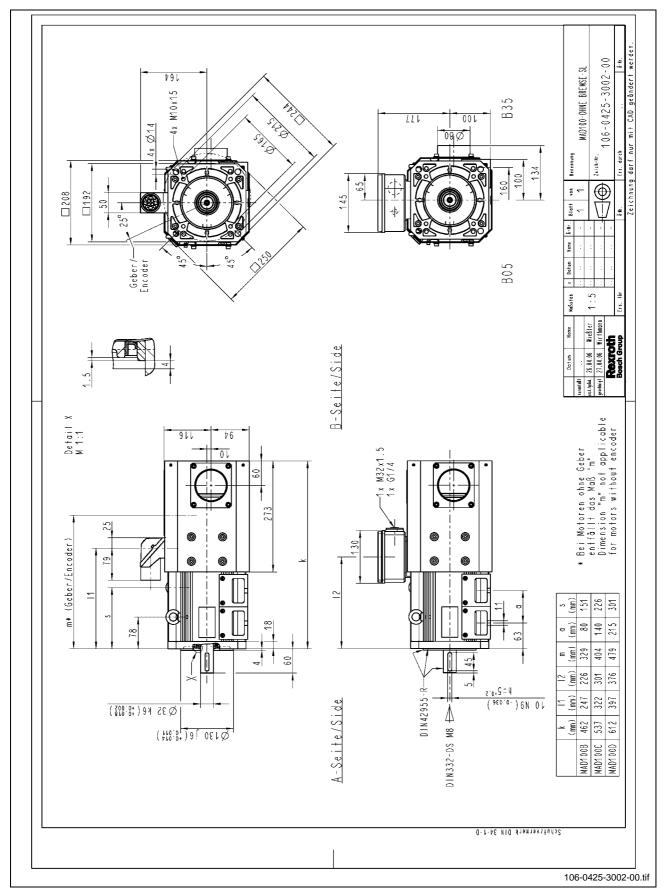


Fig. 5-3: Dimension sheet MAD100 with SL cooling, without holding brake

#### MAD100 with Fan Cowl and Brake 1 or 5

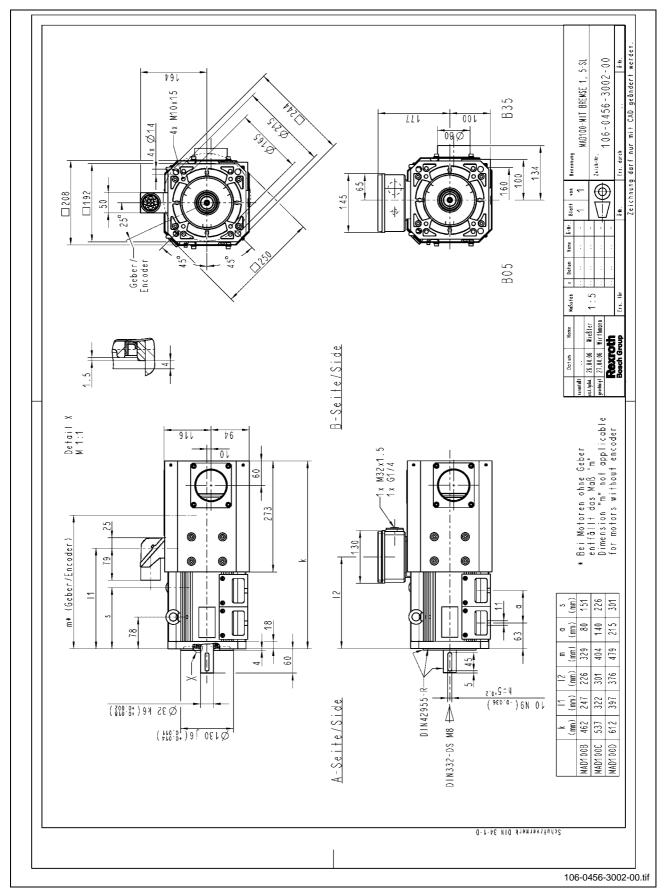


Fig. 5-4: Dimension sheet MAD100 with SL cooling and brake 1 or 5

## MAD100 in Explosion-Protected Design, without Holding Brake

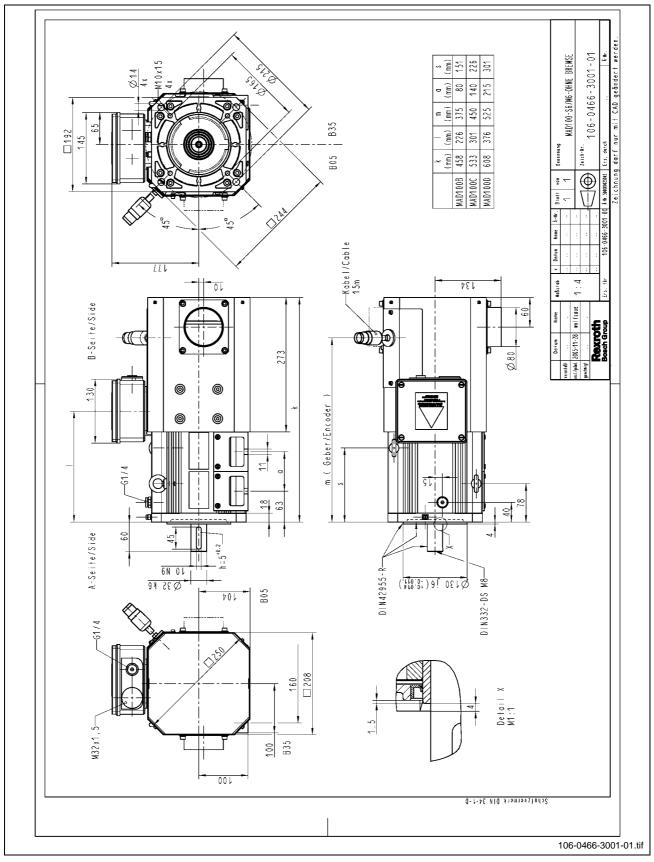


Fig. 5-5: Dimension sheet MAD100 with encoder M6 or S6, without holding brake

# MAD100 in ATEX Design, with Brake 1 or 5

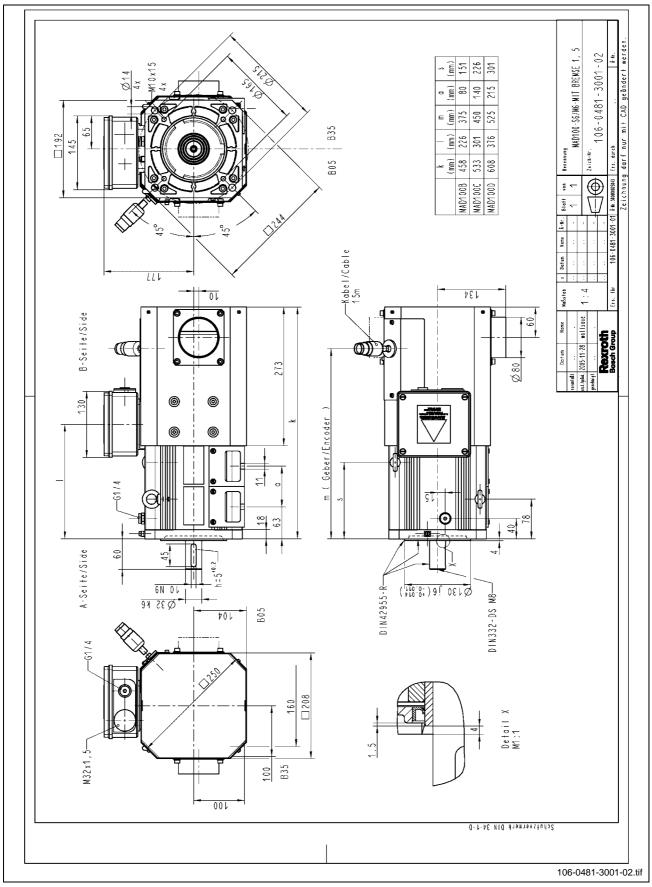


Fig. 5-6: Dimension sheet MAD100 with encoder M6 or S6 and brake 1 or 5

#### 5.2 Frame Size MAD130

## **MAD130** without Holding Brake

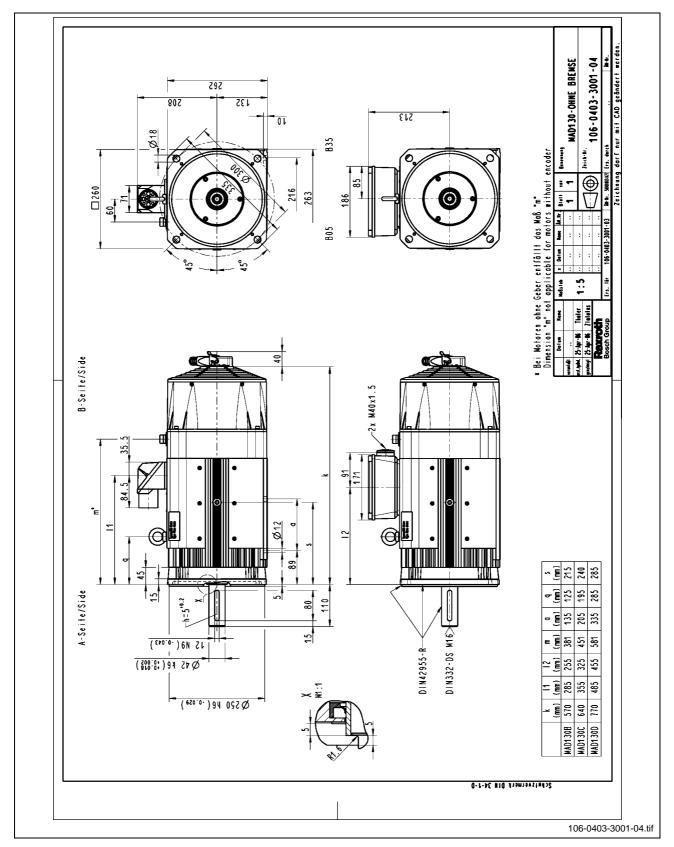


Fig. 5-7: Dimension sheet for MAD130 without holding brake

#### MAD130 with Brake 1 or 5

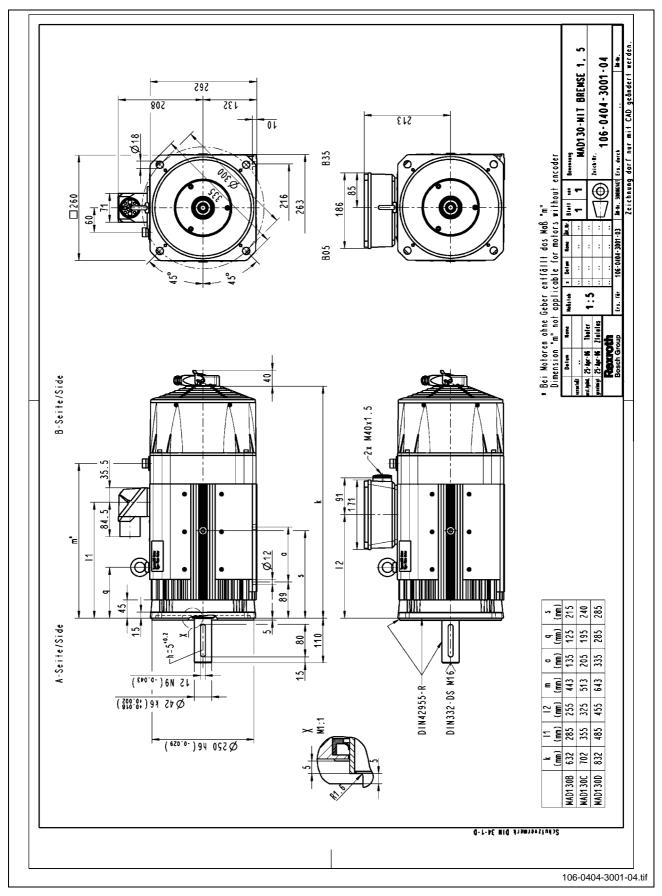


Fig. 5-8: Dimension sheet MAD130 with brake 1 or 5

MAD130 with Fan Cowl, without Holding Brake	
	in preparation
Fig. 5-9:	Dimension sheet MAD130 with SL cooling, without holding brake
MAD130 with Fan Cowl and Brake 1 or 5	
	in preparation

Fig. 5-10: Dimension sheet MAD130 with SL cooling and brake 1 or 5

## MAD130 in ATEX Design, without Holding Brake

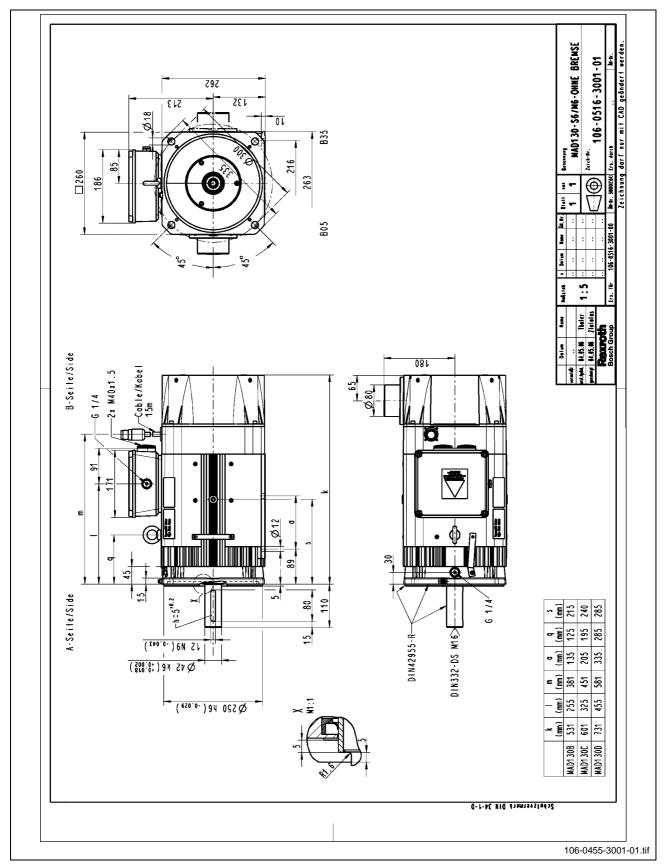


Abb. 5-1: Dimension sheet MAD130 with encoder M6 or S6, without holding brake



## MAD130 in ATEX Design, with Brake 1 or 5

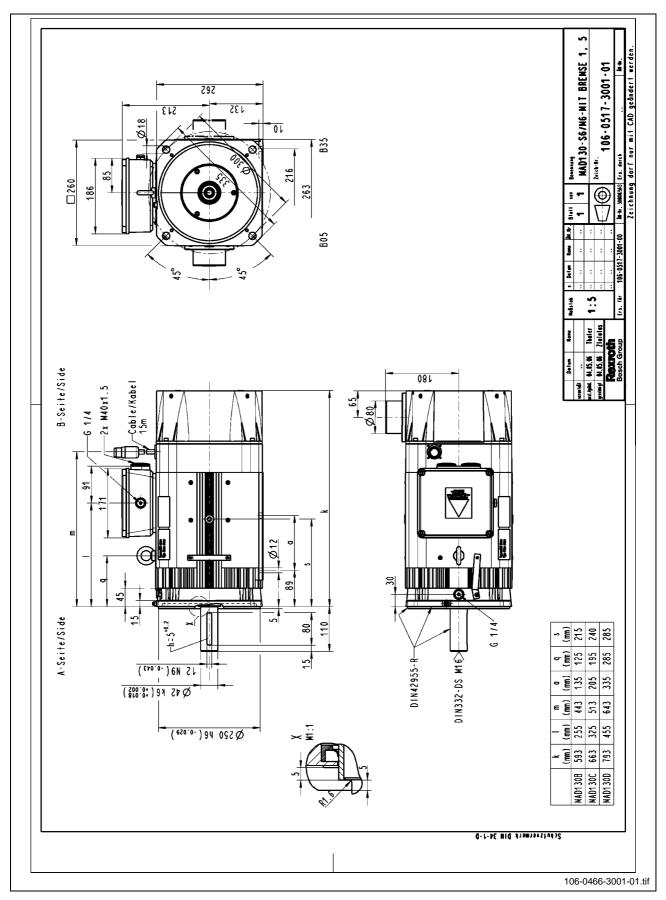


Fig. 5-12: Dimension sheet MAD130 with encoder M6 or S6 and brake 1 or 5

#### 5.3 Frame Size MAD160

## **MAD160** without Holding Brake

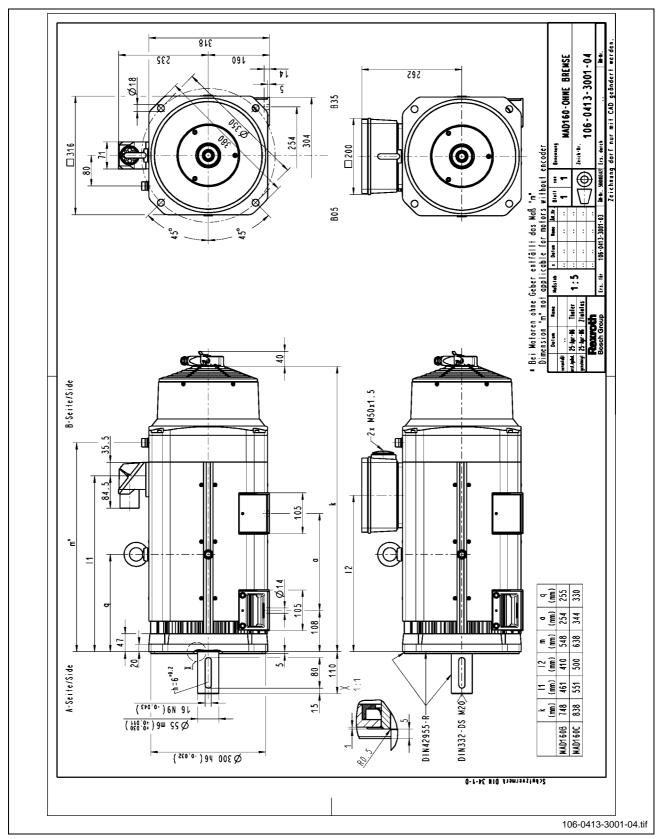


Fig. 5-13: Dimension sheet for MAD160 without holding brake



#### MAD160 with Brake 1 or 5

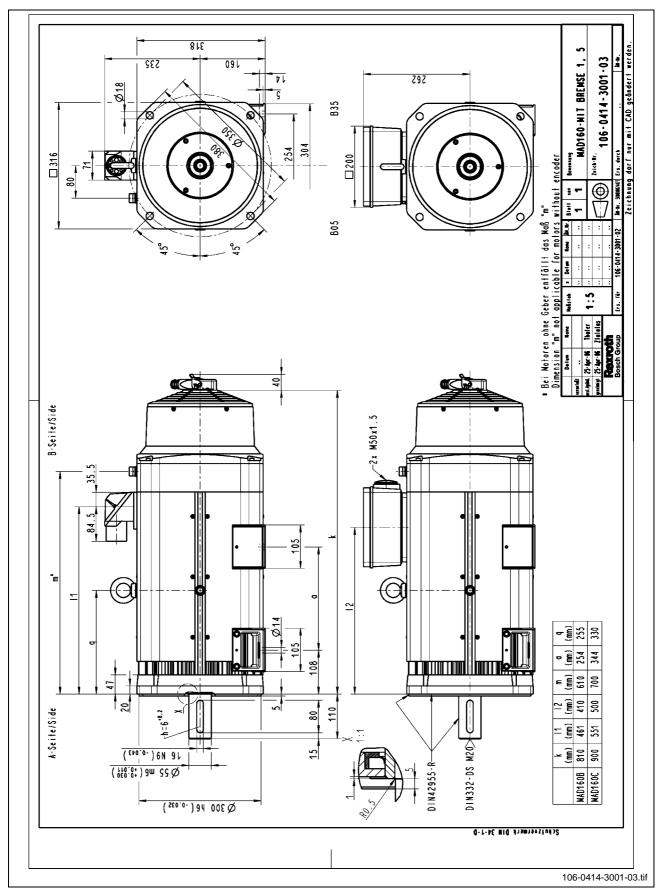


Fig. 5-14: Dimension sheet MAD160 with brake 1 or 5

#### MAD160 with Brake 3

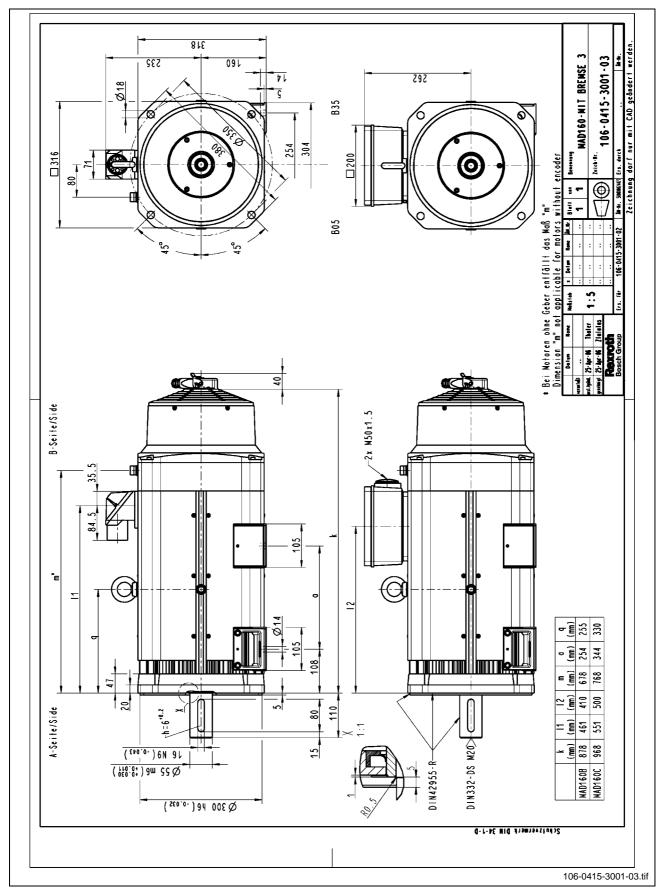


Fig. 5-15: Dimension sheet for MAD160 with brake 3

# MAD160 with Fan Cowl, without Holding Brake in preparation Fig. 5-16: Dimension sheet MAD160 with SL cooling, without holding brake MAD160 with Fan Cowl and Brake 1 or 5 in preparation Fig. 5-17: Dimension sheet MAD160 with SL cooling and brake 1 or 5 MAD160 with Fan Cowl and Brake 3

in preparation

Fig. 5-18: Dimension sheet MAD160 with SL cooling and brake 3 or 5

## MAD160 in ATEX Design, without Holding Brake

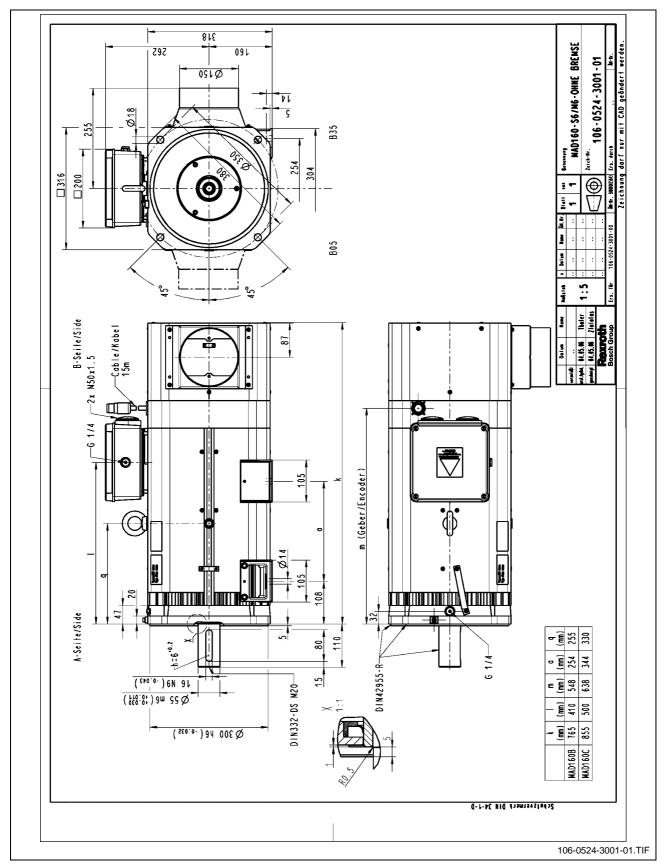


Fig. 5-19: Dimension sheet MAD160 with encoder M6 or S6, without holding brake

## MAD160 in ATEX Design, with Brake 1 or 5

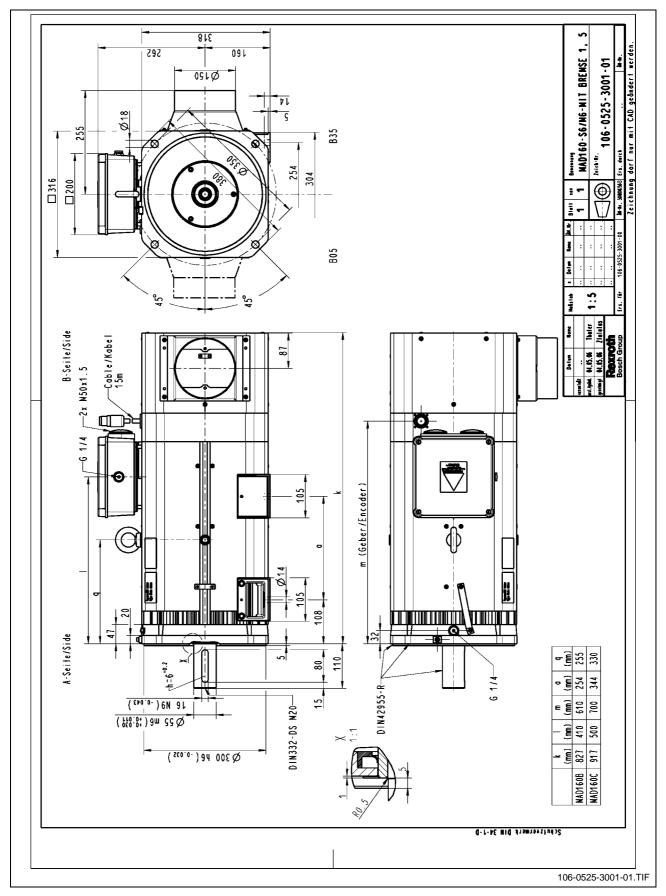


Fig. 5-20: Dimension sheet MAD160 with encoder M6 or S6 and brake 1 or 5

# MAD160 in ATEX Design, with Brake 3

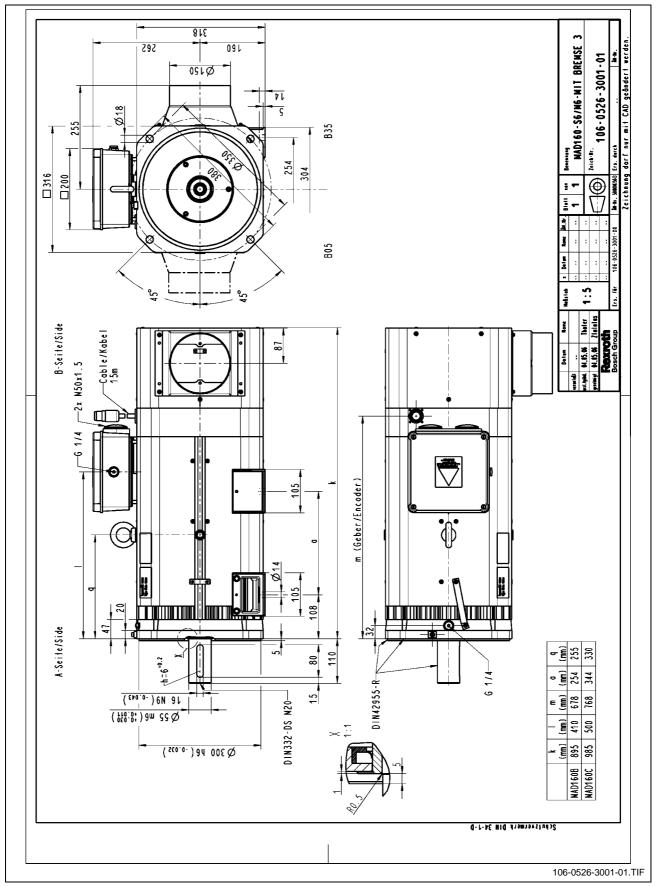


Fig. 5-21: Dimension sheet MAD160 with encoder M6 or S6 and brake 3

#### 5.4 Frame Size MAD180

## **MAD180** without Holding Brake

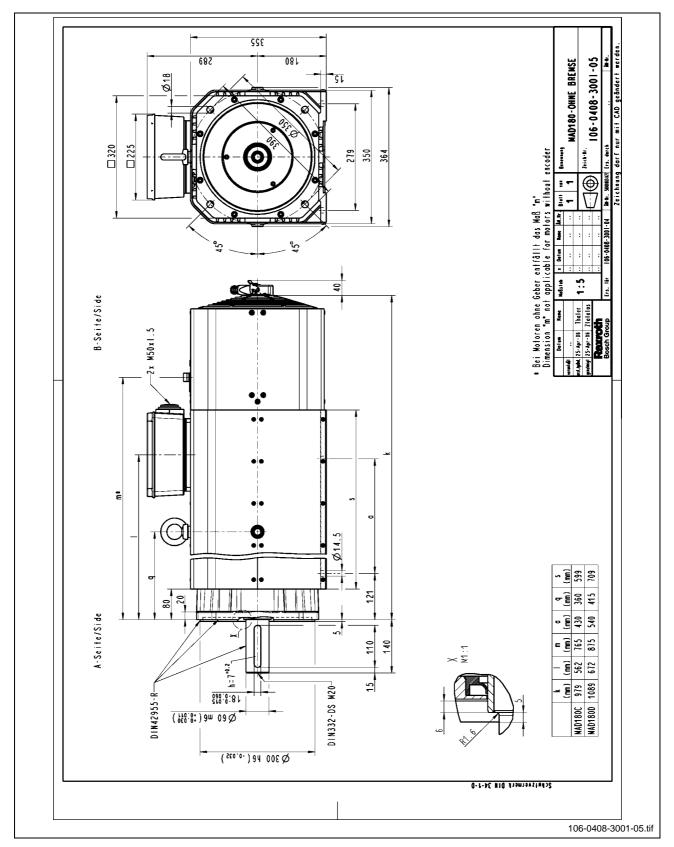


Fig. 5-22: Dimension sheet for MAD180 without holding brake

#### MAD180 with Brake 2 or 5

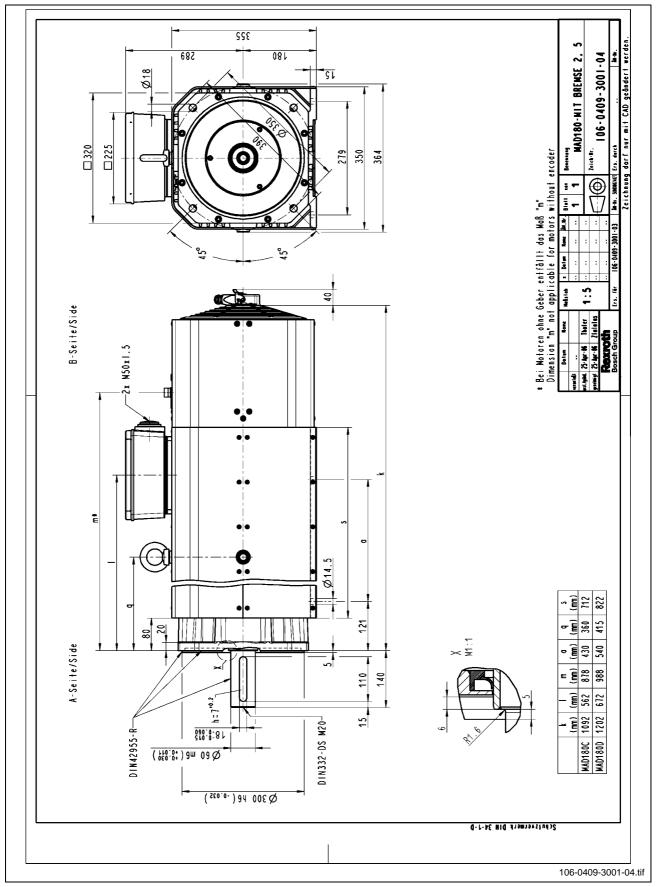


Fig. 5-23: Dimension sheet MAD180 with brake 2 or 5

MAD180 with Fan Cowl, without Holding Brake	
	in preparation
Fig. 5-24:	Dimension sheet MAD180 without holding brake, SL cooling
MAD180 with Fan Cowl and B	rake 2 or 5
	in preparation

Fig. 5-25: Dimension sheet MAD180 with SL cooling and brake 2 or 5

## MAD180 in ATEX Design, without Holding Brake

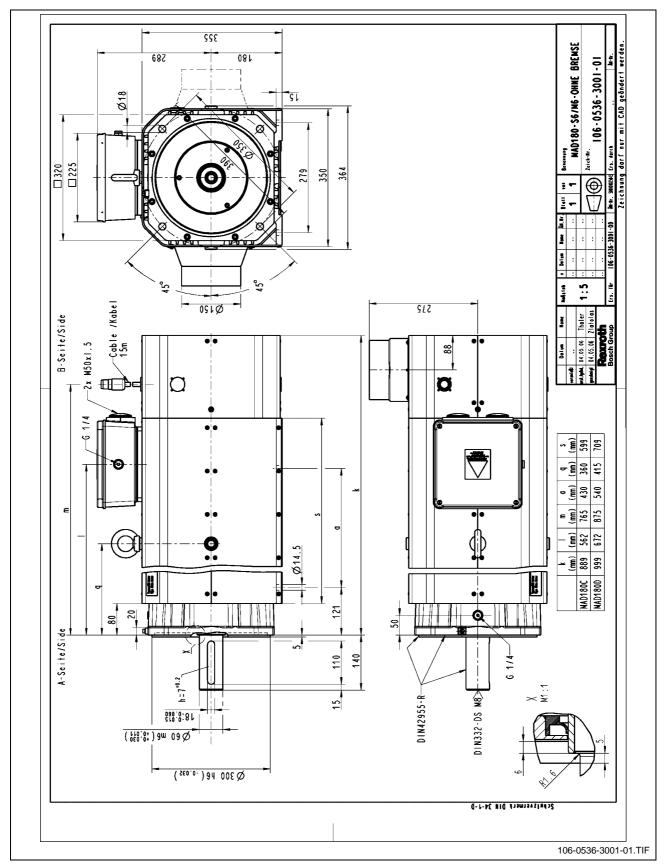


Fig. 5-26: Dimension sheet MAD180 with encoder M6 or S6, without holding brake

## MAD180 in ATEX Design, with Brake 2 or 5

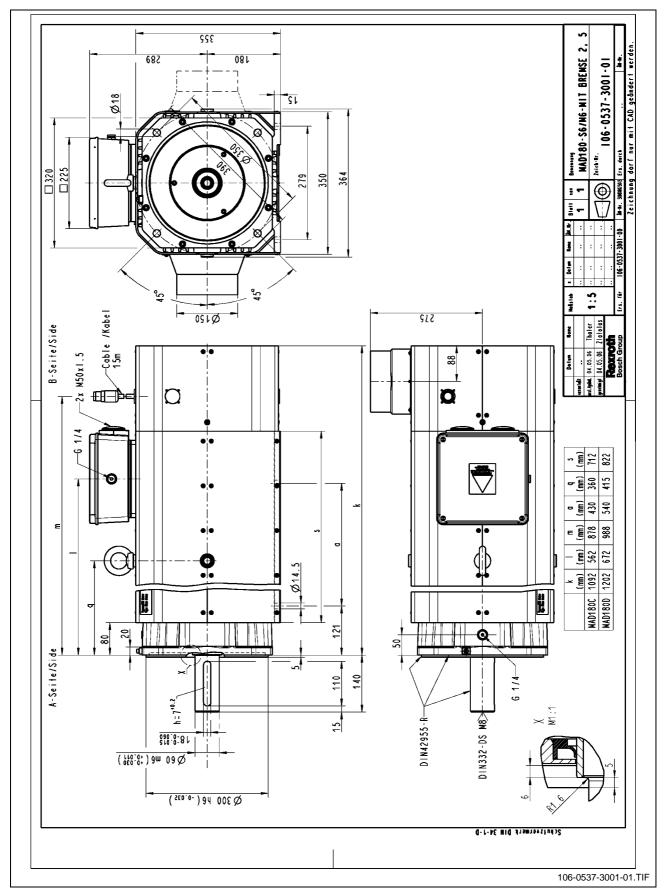


Fig. 5-27: Dimension sheet MAD180 with encoder M6 or S6 and brake 2 or 5

#### 5.5 Frame Size MAD225

## **MAD225 (without Holding Brake)**

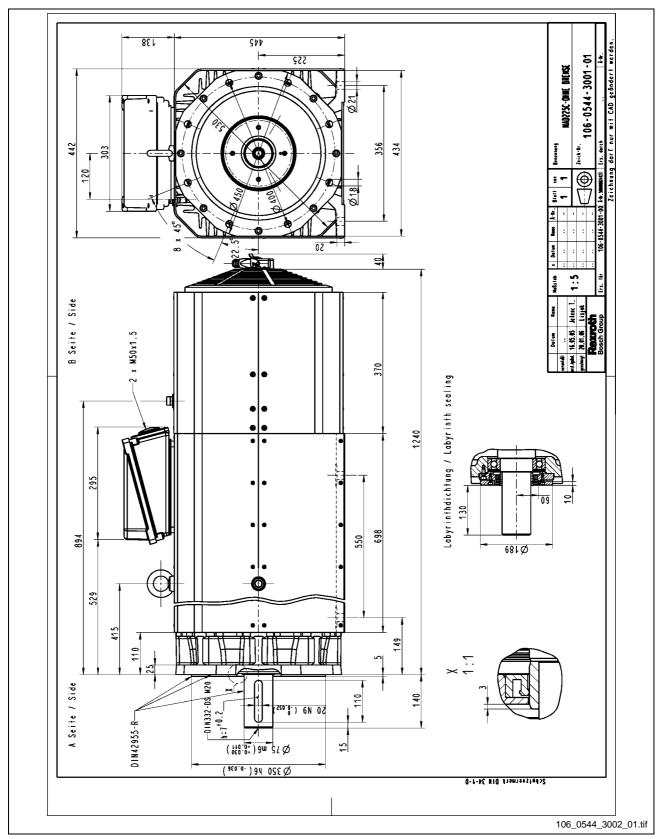


Fig. 5-28: Dimension sheet MAD225 (without Holding Brake)



#### 5.6 Frame Size MAF100

## **MAF100** without Holding Brake

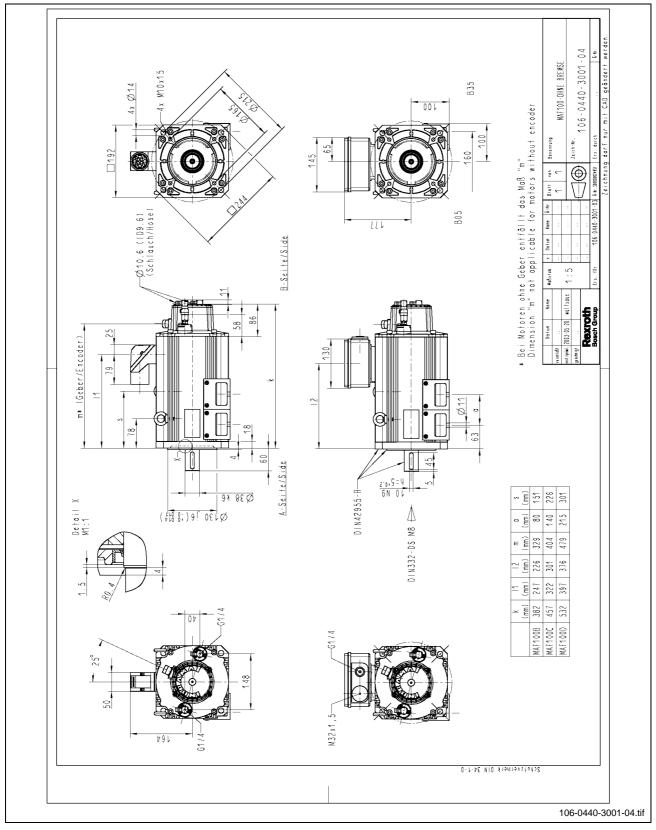


Fig. 5-29: Dimension sheet for MAF100 without holding brake

#### MAF100 with Brake 1 or 5

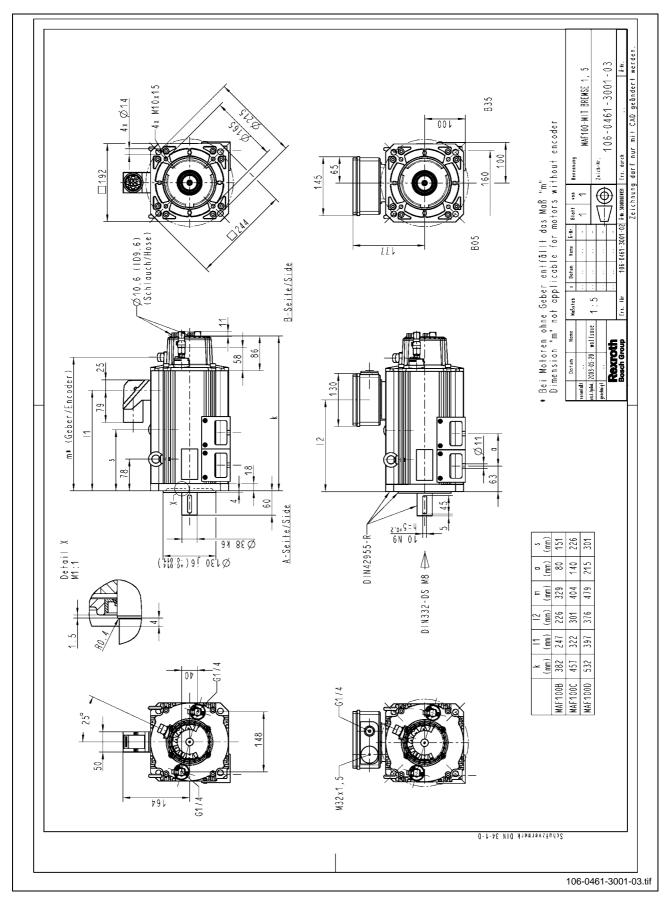


Fig. 5-30: Dimension sheet MAF100 with brake 1 or 5

# MAF100 in ATEX Design, without Holding Brake

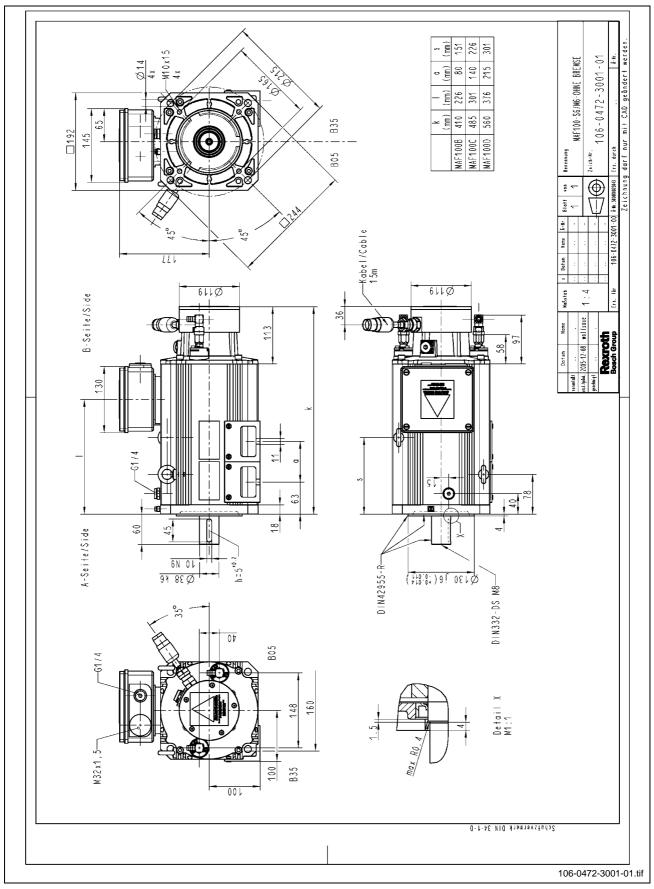


Fig. 5-31: Dimension sheet MAF100 with encoder M6 or S6, without holding brake

# MAF100 in ATEX Design, with Brake 1 or 5

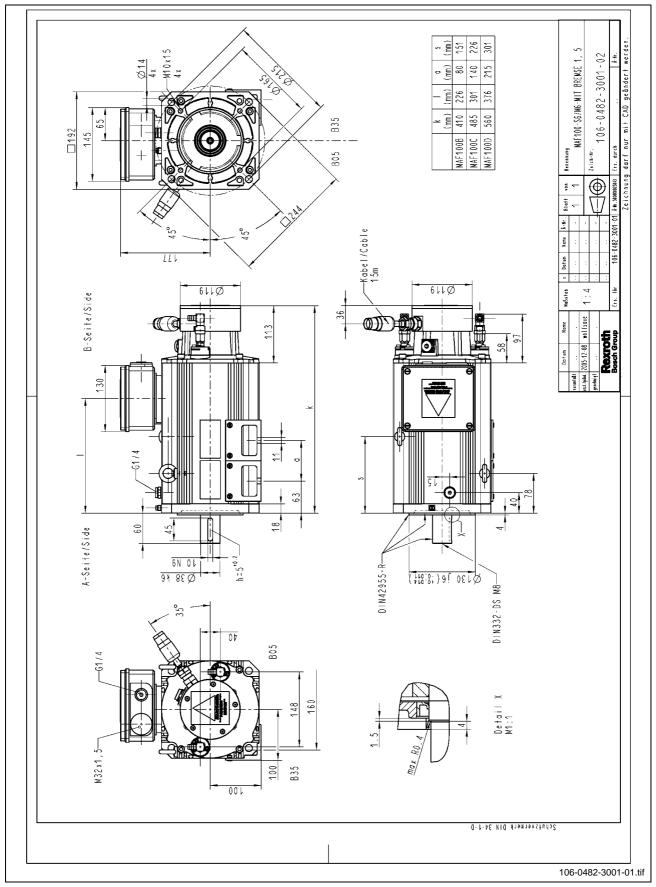


Fig. 5-32: Dimension sheet MAF100 with encoder M6 or S6 and brake 1 or 5

#### 5.7 Frame Size MAF130

## **MAF130** without Holding Brake

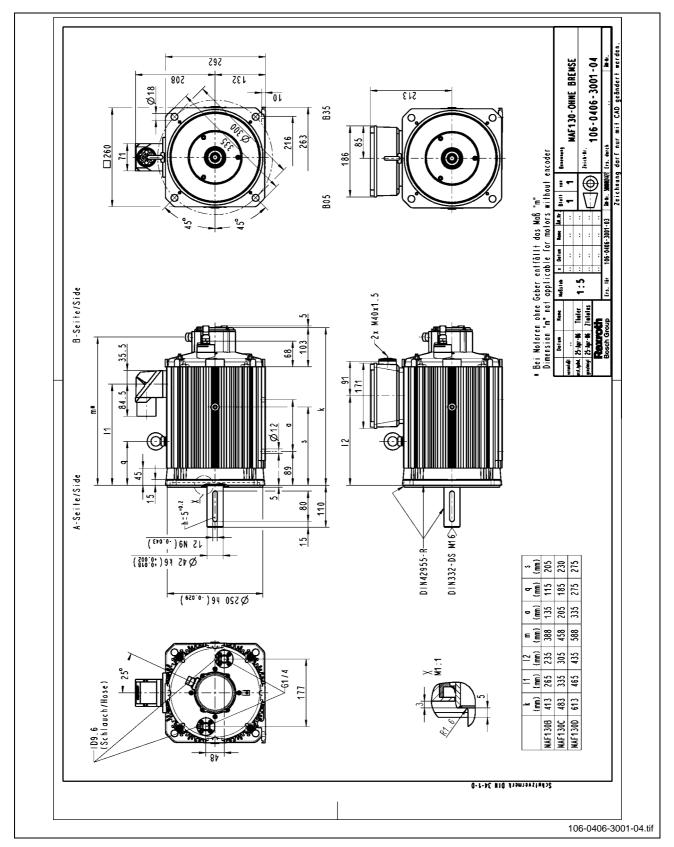


Fig. 5-33: Dimension sheet for MAF130 without holding brake

#### MAF130 with Brake 1 or 5

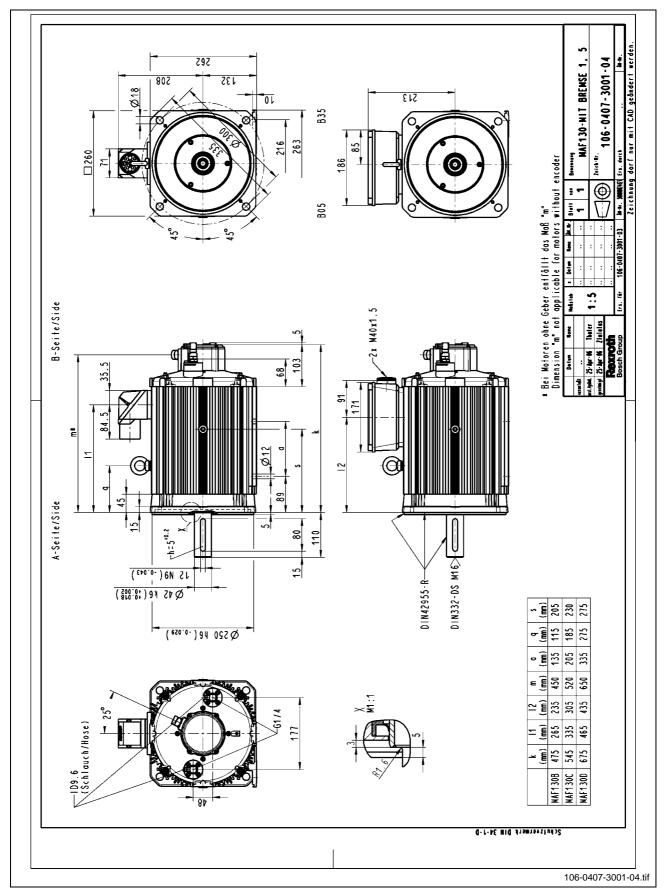


Fig. 5-34: Dimension sheet MAF130 with brake 1 or 5

## MAF130 in ATEX Design, without Holding Brake

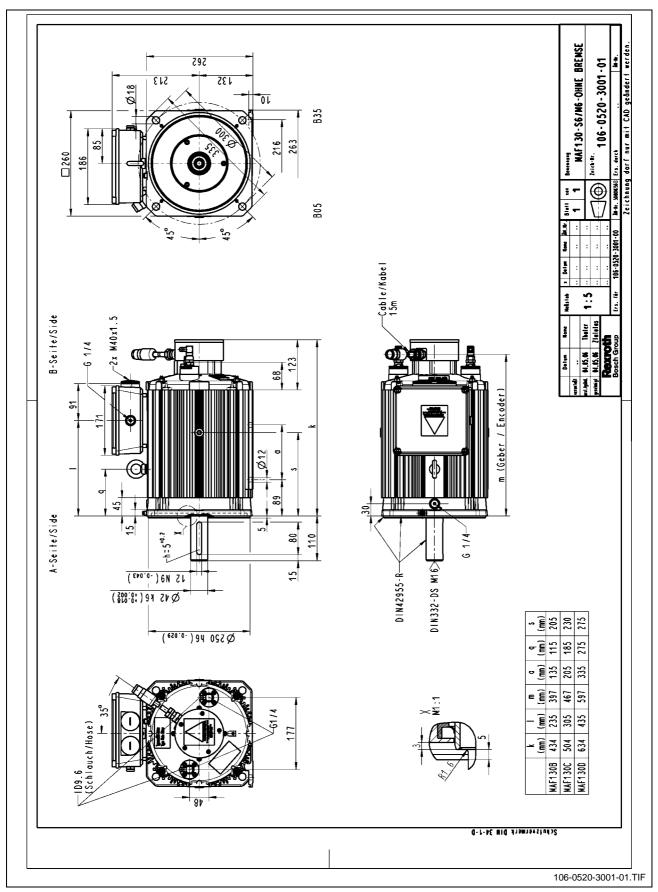


Fig. 5-35: Dimension sheet MAF130 with encoder M6 or S6, without holding brake

## MAF130 in ATEX Design, with Brake 1 or 5

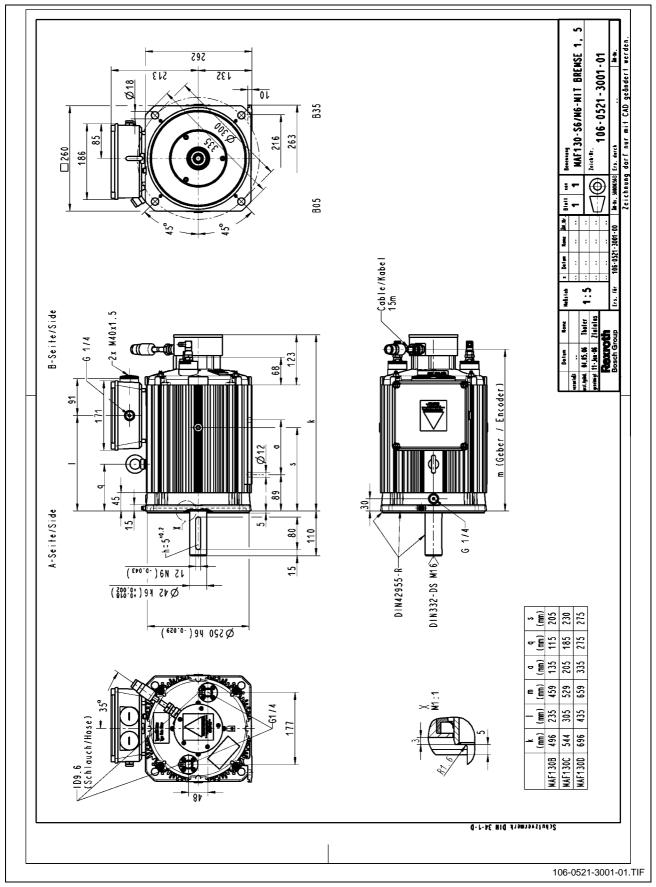


Fig. 5-36: Dimension sheet MAF130 with encoder M6 or S6 and brake 1 or 5

#### 5.8 Frame Size MAF160

## **MAF160** without Holding Brake

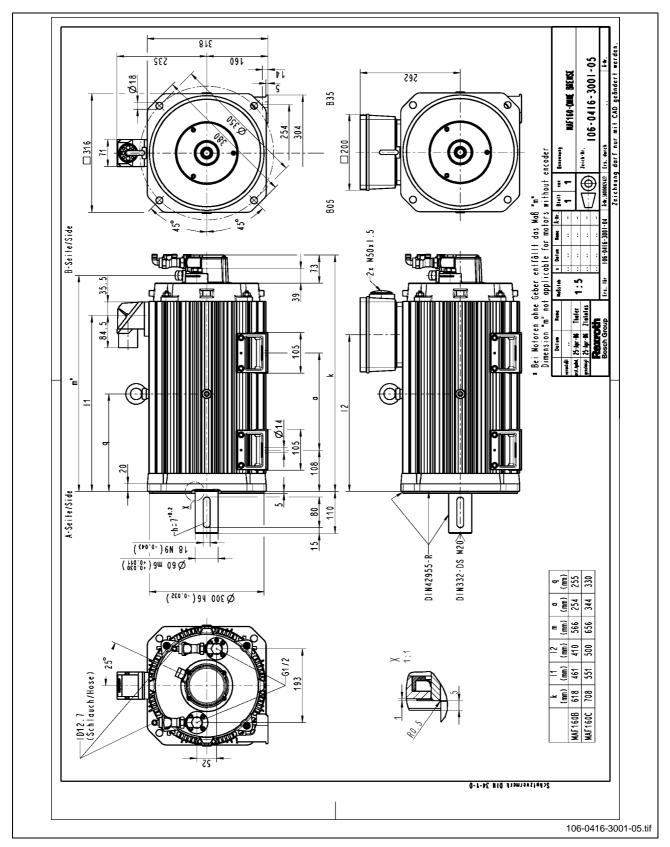


Fig. 5-37: Dimension sheet for MAF160 without holding brake

#### MAF160 with Brake 1 or 5

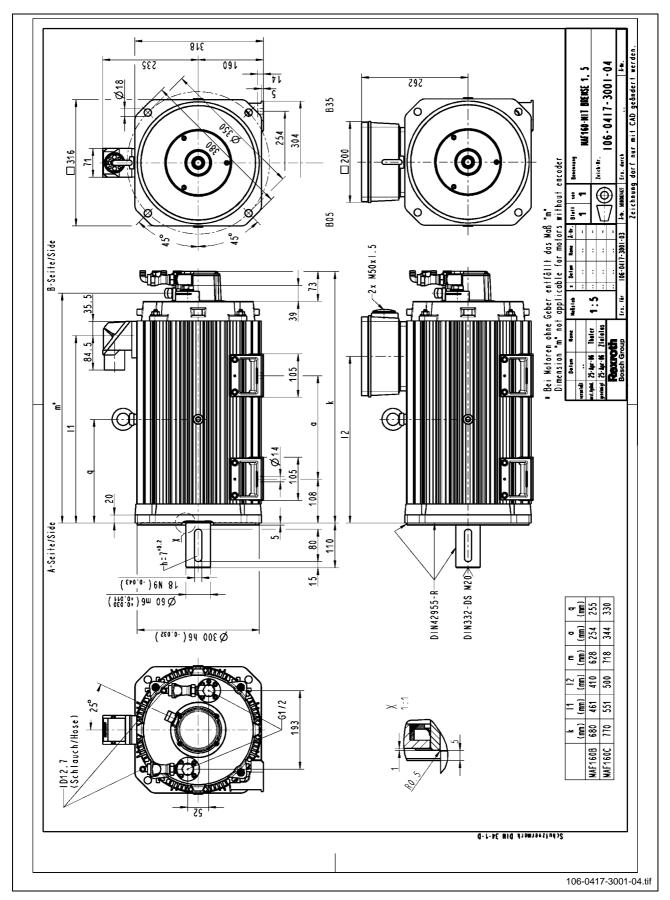


Fig. 5-38: Dimension sheet MAF160 with brake 1 or 5

# MAF160 in ATEX Design, without Holding Brake

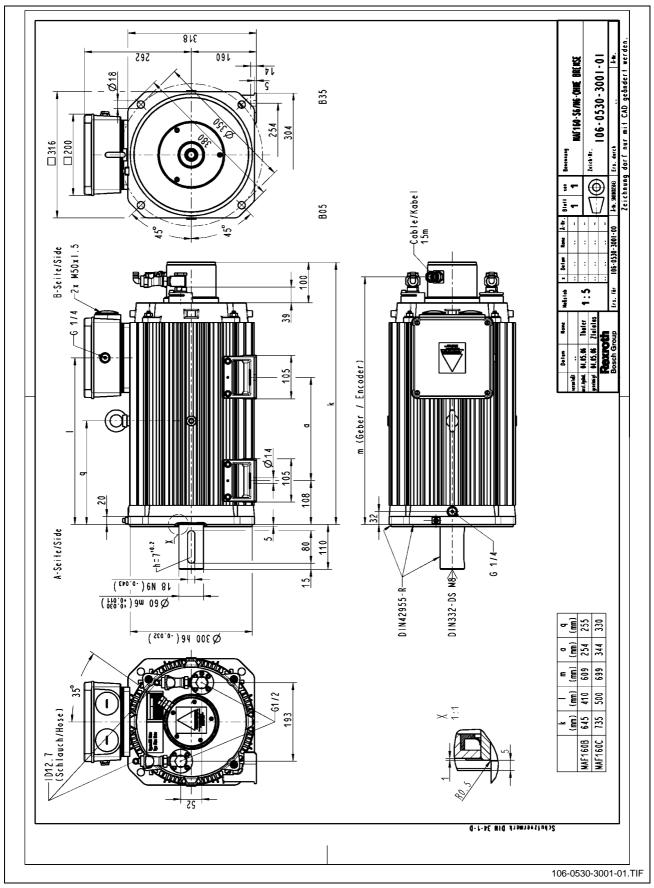


Fig. 5-39: Dimension sheet MAF160 with encoder M6 or S6, without holding brake

# MAF160 in ATEX Design, with Brake 1 or 5

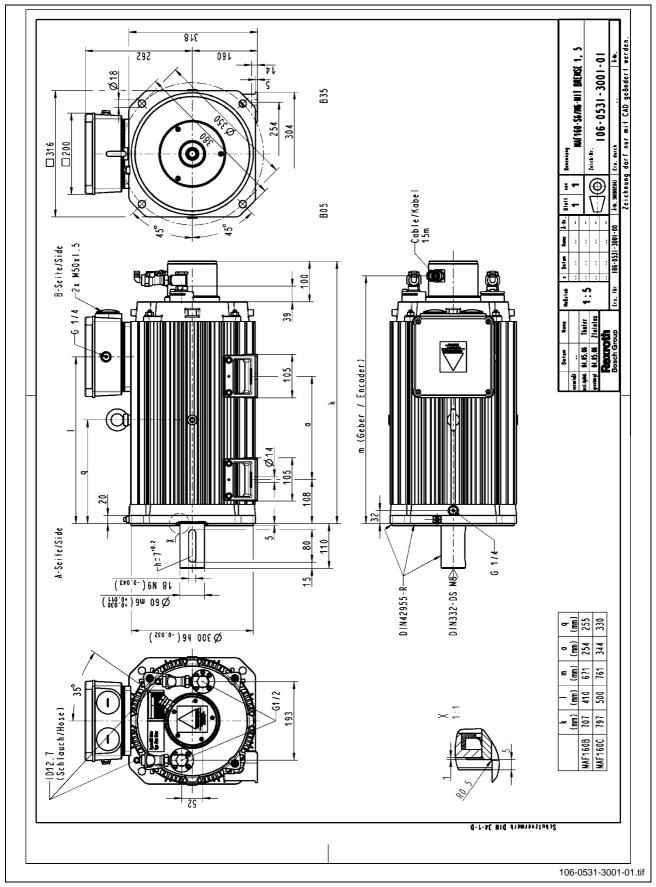


Fig. 5-40: Dimension sheet MAF160 with encoder M6 or S6 and brake 1 or 5

## 5.9 Frame Size MAF180

## **MAF180** without Holding Brake

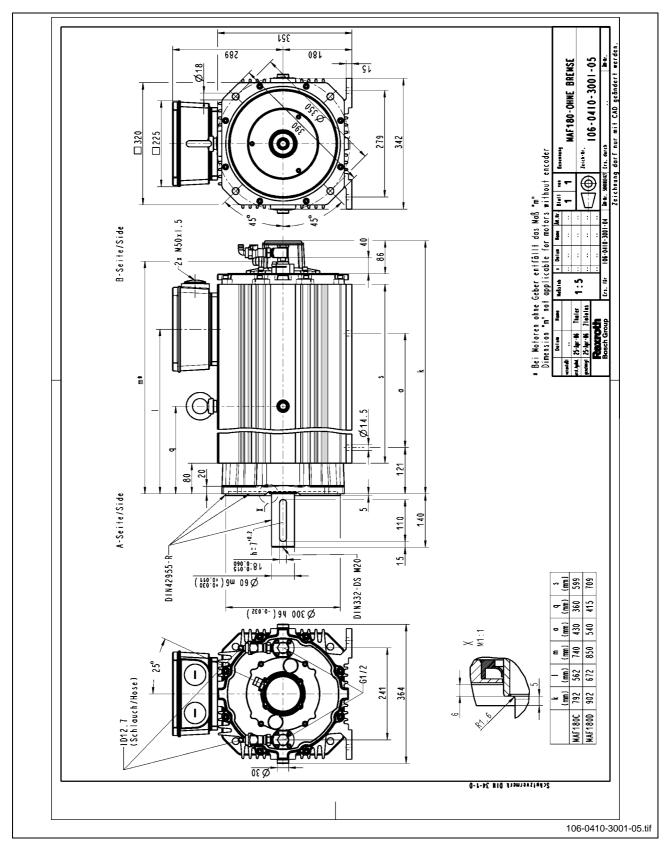


Fig. 5-41: Dimension sheet for MAF180 without holding brake

## MAF180 with Brake 2 or 5

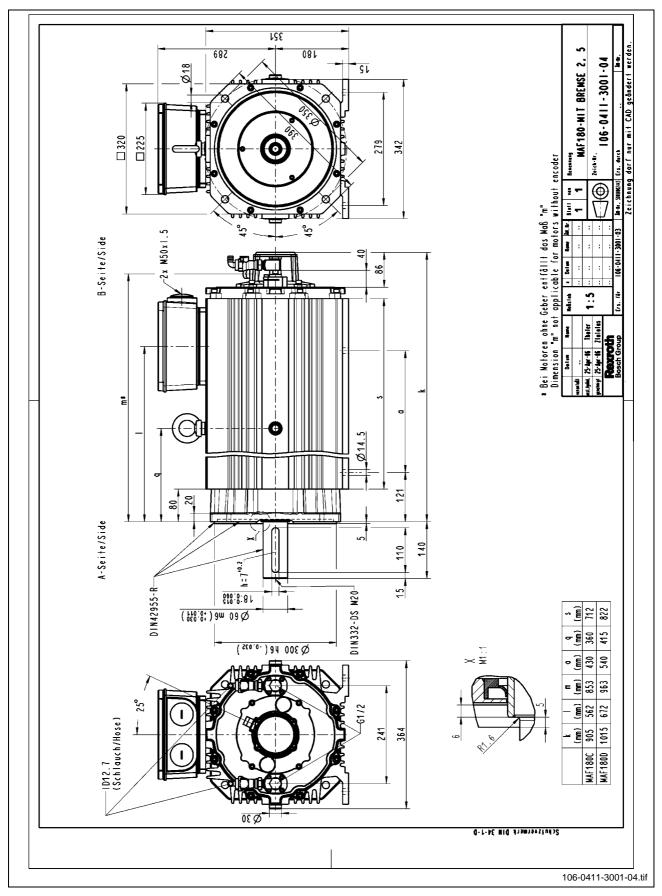


Fig. 5-42: Dimension sheet MAF180 with brake 2 or 5

## MAF180 in ATEX Design, without Holding Brake

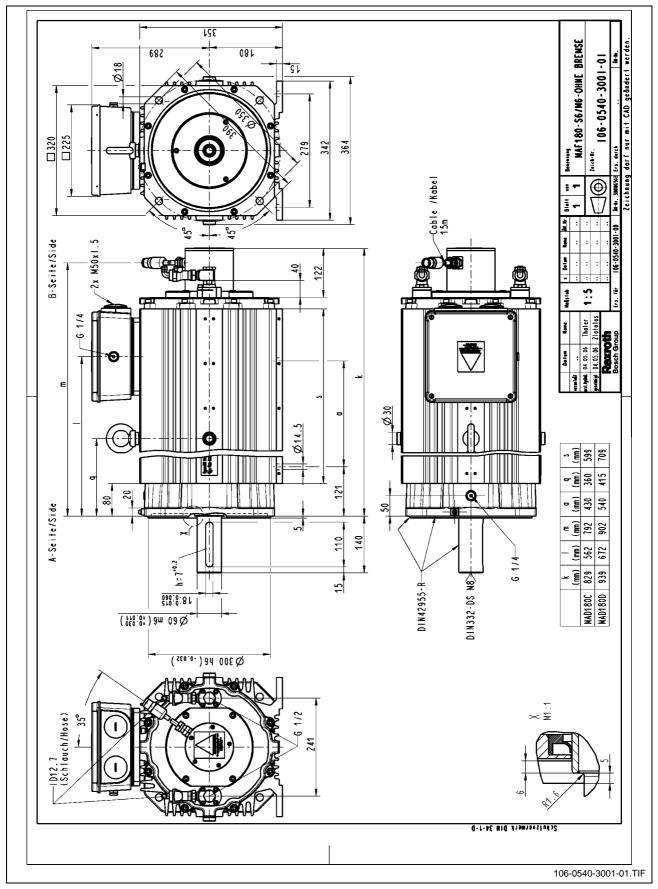


Fig. 5-43: Dimension sheet MAF180 with encoder M6 or S6, without holding brake

# MAF180 in ATEX Design, with Brake 2 or 5

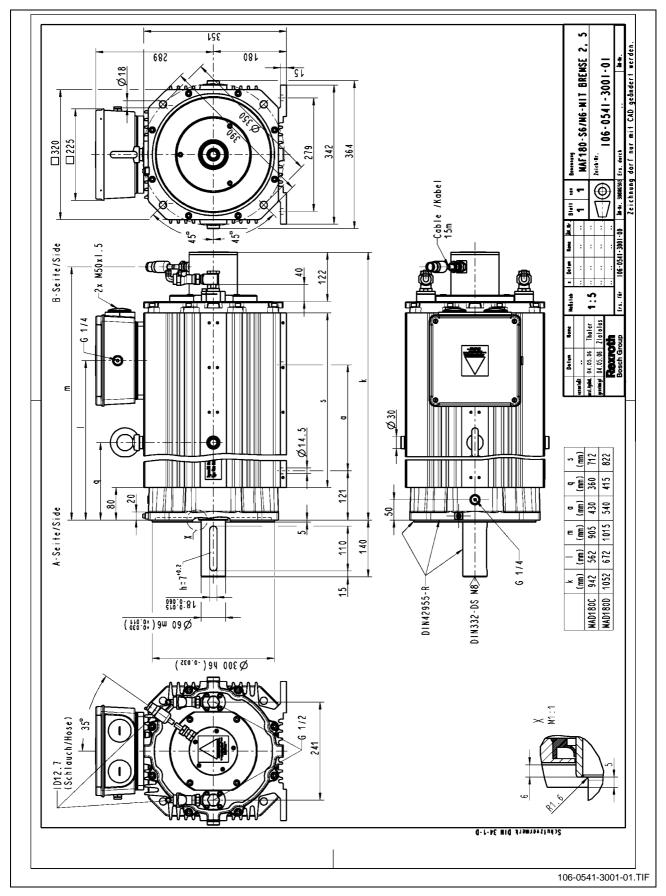


Fig. 5-44: Dimension sheet MAF180 with encoder M6 or S6 and brake 2 or 5

## 5.10 Frame Size MAF225

## **MAF225** (without Holding Brake)

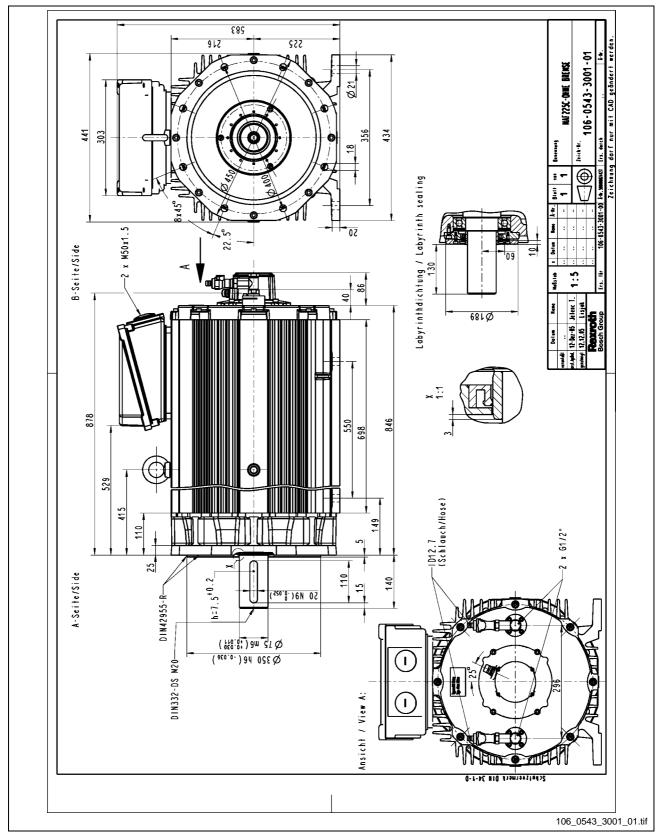


Fig. 5-45: Dimension sheet MAF225 (without Holding Brake)



# 6 Type Codes IndraDyn A

## 6.1 Introduction

IndraDyn A is the general product name for all new asynchronous housing motors by REXROTH.

The type code describes the available motor variants; it is the basis for selecting and ordering products from BOSCH REXROTH. This applies to both new products as well as spare parts and repairs.

The following descriptions provide an overview of the separate columns of the type code ("abbrev. column") and their meaning.

Note:

When selecting a product, always consider the detailed specifications in the chapter 4 "Technical Data", chapter 9 "Notes regarding Application", and chapter 13 "Motors for Hazardous Areas".

### **Definition**

#### 1. Product

Abbrev. column 1 2 3

**MAD** is the description of the new type series of air-cooled asynchronous housing motors.

**MAF** is the description of the new type series of liquid-cooled asynchronous housing motors.

### 2. Motor Frame Size

Abbrev. Column 4 5 6

The motor frame size is derived from the dimensions of the flange at the output end and represents different power ranges.

#### 3. Motor Frame Length

Abbrev. column 7

Within a series, the graduation of increasing motor frame length is indicated by ID letters in alphabetic order.

Frame lengths are, for example, B, C and E.

### 4. Winding Code

Abbrev. column <mark>9</mark> 10 11 <mark>12</mark>

The four-digit sequence of figures identifies the rated speed applicable for the respective type of winding. The last figure is omitted. Example: The winding code 0200 means a rated speed of 2000 min<sup>-1</sup>.

### 5. Type of Cooling

Abbrev. column 14 15

**MAD** motors must always be operated with a fan whose air currents are guided from the fan shroud over the surface of the motor ("surface ventilation"). The air current of the axial fan (Option "**SA**") is defined as "blowing" according to the following figure.

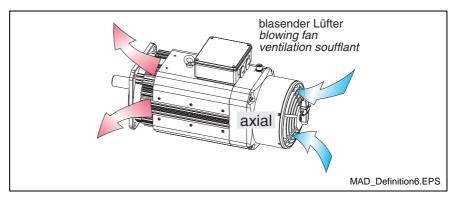


Fig. 6-1: MAD, blowing fan

The fan unit can be removed for maintenance. Operation without ventilation is not permissible.

For certain applications, MAD motors can also be operated with an external fan. To this effect, the motors are equipped with a fan cover and a fan cowl (option "SL") to connect the air hose.

**MAF** motors must always be operated with an external cooling system (not included in the delivery).

### 6. Motor Encoder

Abbrev. column 17 18 IndraDyn A motors are supplied with integrated encoders.

	Periods	Signal <sup>1</sup> )	Interface	Supply voltage
Incremental encoder	2048	1 V <sub>ss</sub>	-	5 V
Multiturn absolute encoder	512	1 V <sub>ss</sub>	I <sup>2</sup> C	8 V
Multiturn absolute encoder	2048	1 V <sub>ss</sub>	EnDat2.1	11 V
Multiturn absolute encoder for ATEX motors (length of cable set: 15 m)	2048	1 V <sub>ss</sub>	EnDat2.1	5 V
The motor is supplied without a factory-attached encoder unit. The rear of the motor is blocked by a cover.				
Singleturn absolute encoder	512	1 V <sub>ss</sub>	I <sup>2</sup> C	8 V
Singleturn absolute encoder	2048	1 V <sub>ss</sub>	EnDat2.1	11 V
Singleturn absolute encoder for ATEX motors (length of cable set: 15 m)	2048	1 V <sub>ss</sub>	EnDat2.1	5 V
	Multiturn absolute encoder  Multiturn absolute encoder  Multiturn absolute encoder for ATEX motors (length of cable set: 15 m)  The motor is supplied without a factory-attached Singleturn absolute encoder  Singleturn absolute encoder  Singleturn absolute encoder for ATEX motors	Multiturn absolute encoder 512  Multiturn absolute encoder 2048  Multiturn absolute encoder for ATEX motors (length of cable set: 15 m) 2048  The motor is supplied without a factory-attached encoder unit Singleturn absolute encoder 512  Singleturn absolute encoder 2048  Singleturn absolute encoder for ATEX motors (length of cable set: 15 m) 2048	Multiturn absolute encoder  Multiturn absolute encoder  Multiturn absolute encoder for ATEX motors (length of cable set: 15 m)  The motor is supplied without a factory-attached encoder unit. The rear of the Singleturn absolute encoder  2048  1 V <sub>ss</sub> Singleturn absolute encoder for ATEX motors (length of cable set: 15 m)	Multiturn absolute encoder  Multiturn absolute encoder  Multiturn absolute encoder  Multiturn absolute encoder for ATEX motors (length of cable set: 15 m)  The motor is supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached encoder unit. The rear of the motor is blocked by the supplied without a factory-attached by the supplied without a factory-attache

Fig. 6-2: IndraDyn A motor encoder

### 7. Electrical Connection

Abbrev. column 20

The motors of frame size 100..160 can be electrically connected optionally via flange socket or via terminal box. Motors of frame size 180...225 and ATEX version motors can only be connected by means of terminal box.

For more information, see the type code of the motor and chapter 8, "Connection Techniques".

### 8. Output Shaft

Abbrev. column 21

In order to connect the machine elements to be driven to the motor shafts, the following options are available for all IndraDyn A motors:

Output Shaft				
	Plain	with keyway		
	shaft	Balanced with complete key	Balanced with half key	
Without shaft sealing ring	н	Q	L	
With shaft sealing ring	G	Р	К	
with labyrinth seal (only for frame size 225)	F	R		

Fig. 6-3: Output shaft options

Motors with a keyway are always supplied with a key.

The motor drive shafts of frame sizes 130...225 have threaded centering holes on the end face in "DS" version in accordance with DIN 332, sheet 2. For details, see the respective motor dimension sheet.

Please observe the supplementary notes on shaft sealing ring, drive shaft, and labyrinth seal in chapter 9.12, "Drive Shaft".

#### 9. Holding Brake

#### Abbrev. column 22

Up to frame size 180, IndraDyn A motors are optionally available with integrated holding brake and different holding torques. Depending on the application, an "electrically-clamped" or "electrically-released" holding brake can be selected.

Note:

The motor holding brake is not suitable for the protection of personnel or as a service brake! Heed the notes regarding holding brakes in chapter 9 "Application Notes" and chapter 12 "Startup".

#### 10. Design

Abbrev. column 24 25

IndraDyn A motors are available in the design **05** (flange mounting) or design **35** (flange and foot installation). The permitted conditions of installation are explained in chapter 9 "Notes Regarding Application".

#### 11. Bearing

Abbrev. column 27

The standard bearing (option "N") consists of deep-groove ball bearings in all IndraDyn A motors.

Reinforced bearings (option "V") can be used to taking up high radial forces. With reinforced bearing, there is an additional cylindrical-roller bearing at the drive side next to the deep-groove ball bearing.

The high-speed suspension (option "H") consists of a deep-groove ball bearing; it permits higher speeds at a reduced axial and radial load-bearing capacity.

The bearing for the coupling connection (option "R") consists of a deep-groove ball bearing. This bearing variant has a special bearing seat for taking up rotating radial forces which may occur during motor operation with coupling.

Heed the notes regarding bearings in chapter 4 "Technical Data ...." and chapter 9.17 "Bearing Variants".

#### 12. Vibration Severity Level

Abbrev. column 28

IndraDyn A motors are dynamically balanced according to the requirements of DIN ISO 2373; the standard is step "R". With frame size MAD/MAF100-180, options "S" and "S1" can be selected.

## 6.2 Type Code MAD100

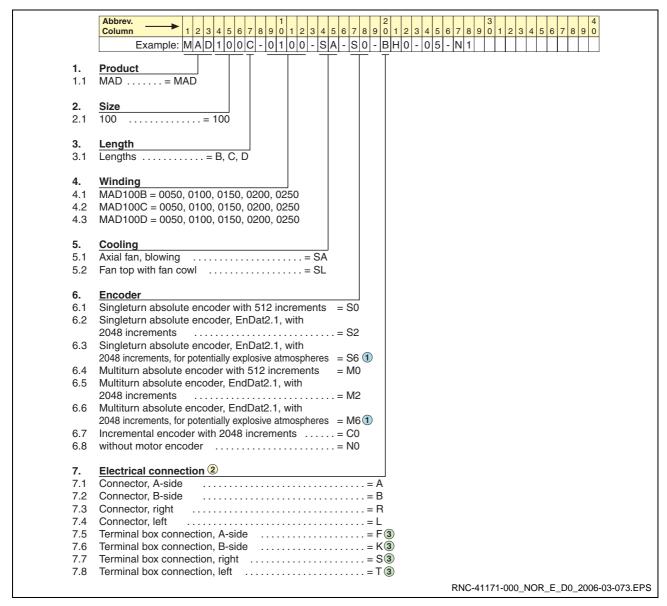


Fig. 6-4: Type code MAD100 (1/2)

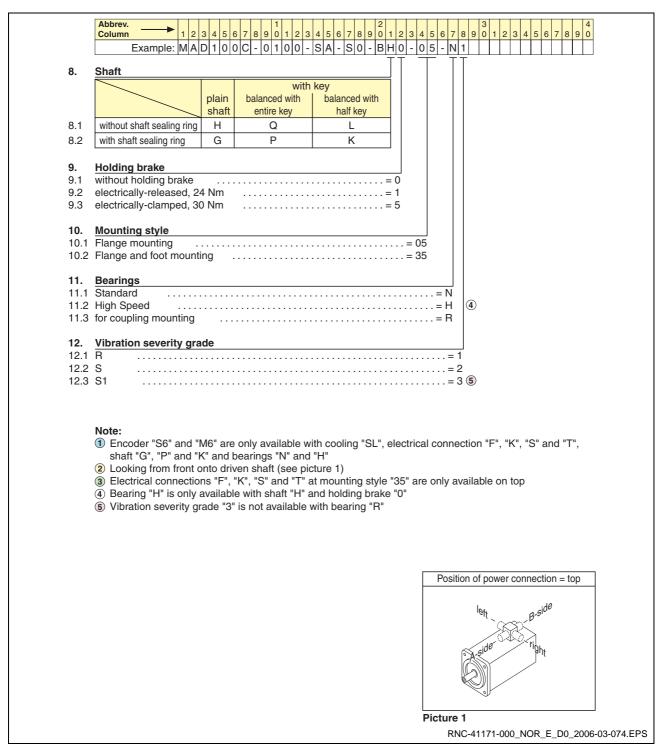


Fig. 6-5: Type code MAD100 (2/2)

## 6.3 Type Code MAD130

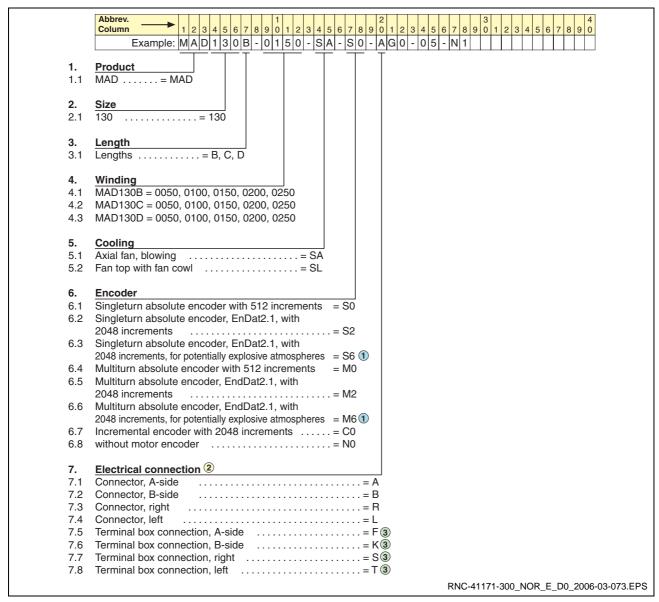


Fig. 6-6: Type code MAD130 (1/2)

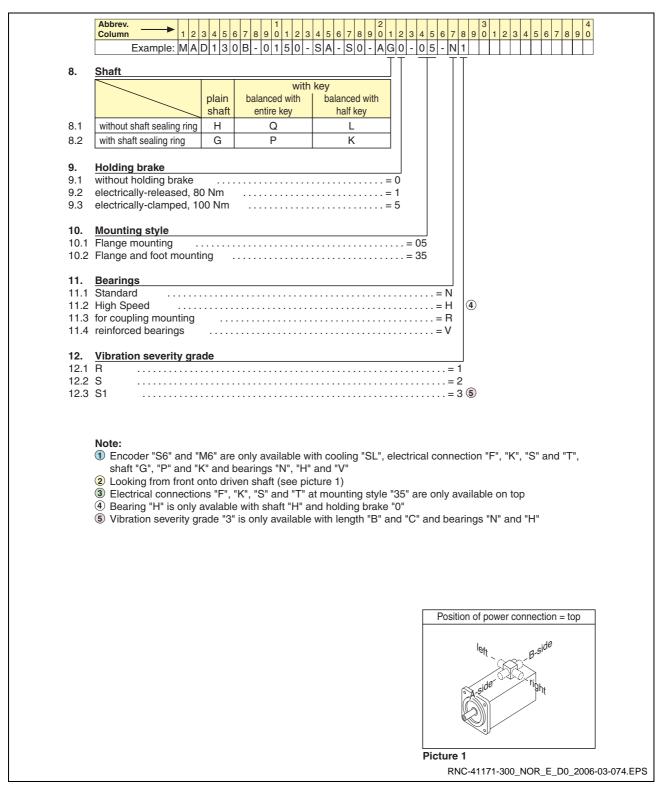


Fig. 6-7: Type code MAD130 (2/2)

## 6.4 Type Code MAD160

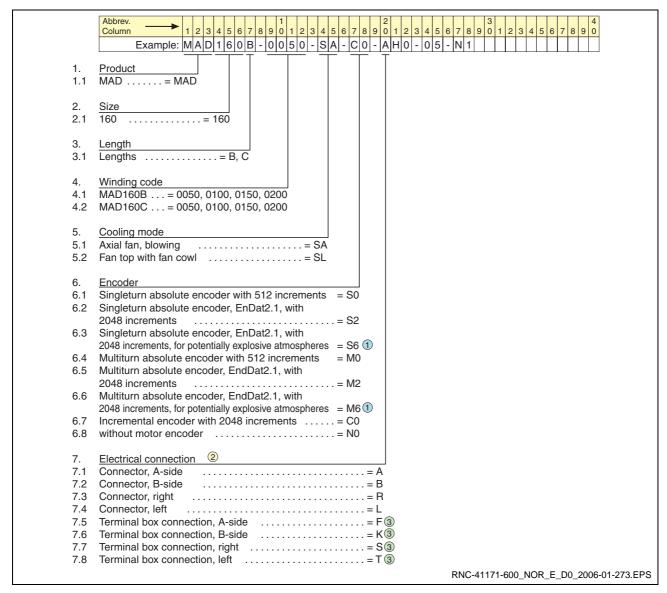


Fig. 6-8: Type code MAD160 (1/2)

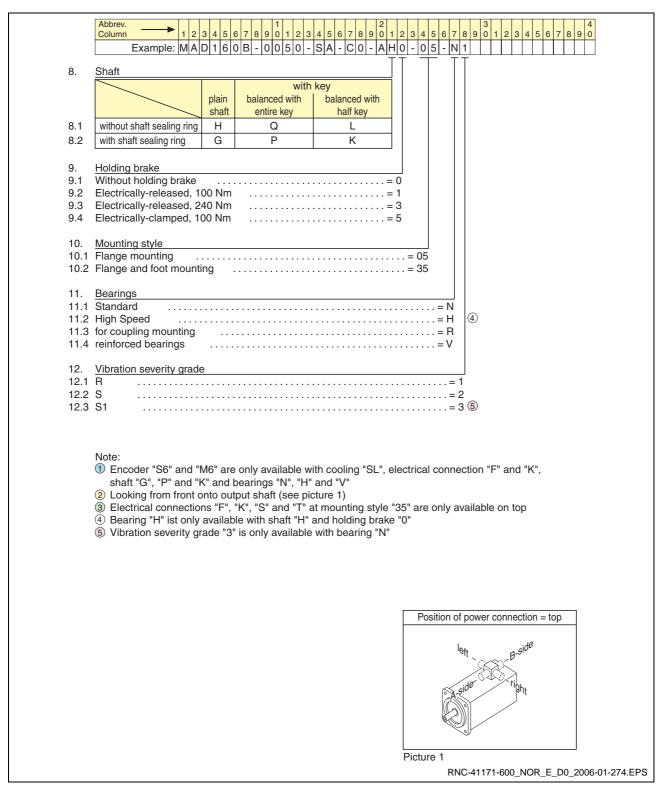


Fig. 6-9: Type code MAD160 (2/2)

## 6.5 Type Code MAD180

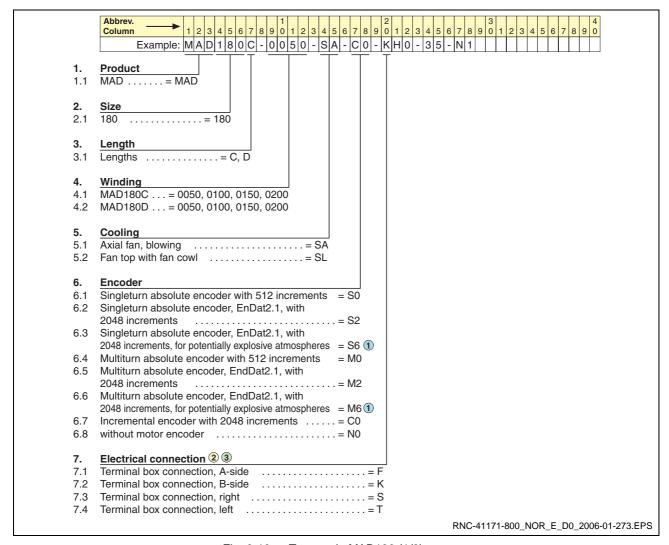


Fig. 6-10: Type code MAD180 (1/2)

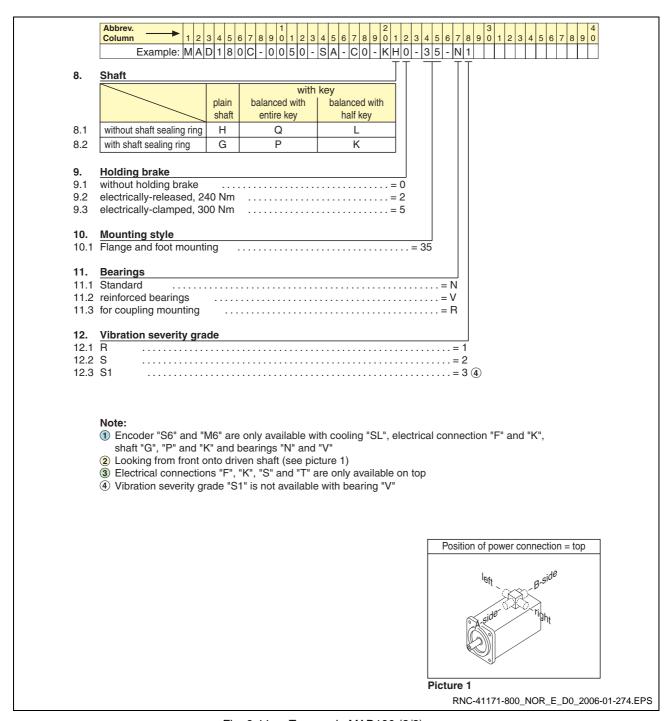


Fig. 6-11: Type code MAD180 (2/2)

## 6.6 Type Code MAD225

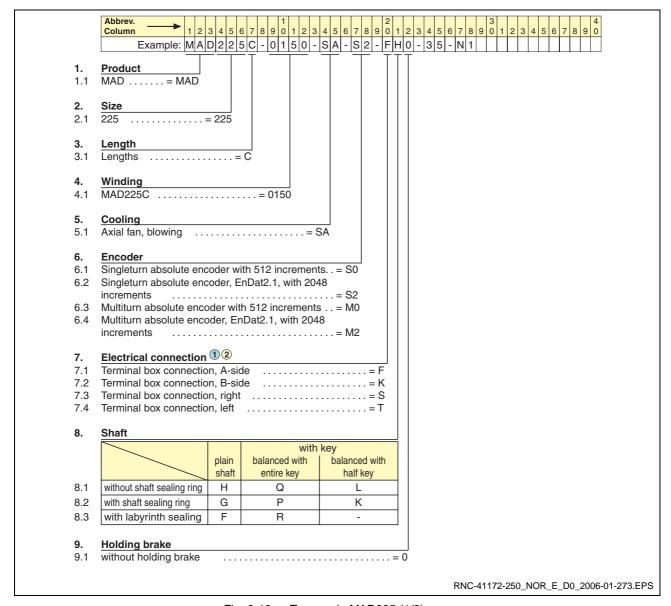


Fig. 6-12: Type code MAD225 (1/2)

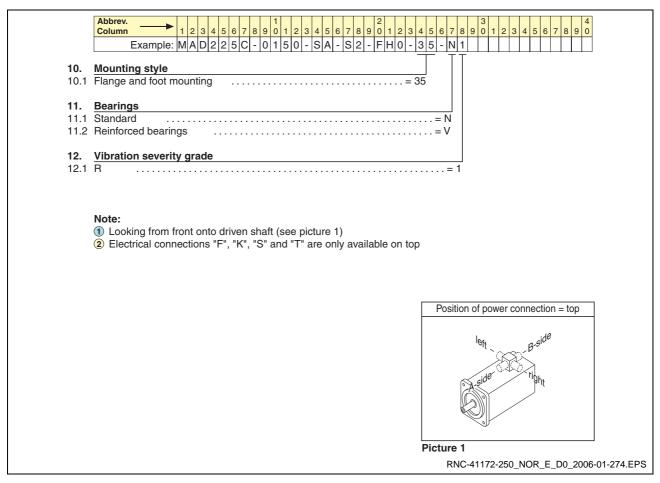


Fig. 6-13: Type code MAD225 (2/2)

## 6.7 Type Code MAF100

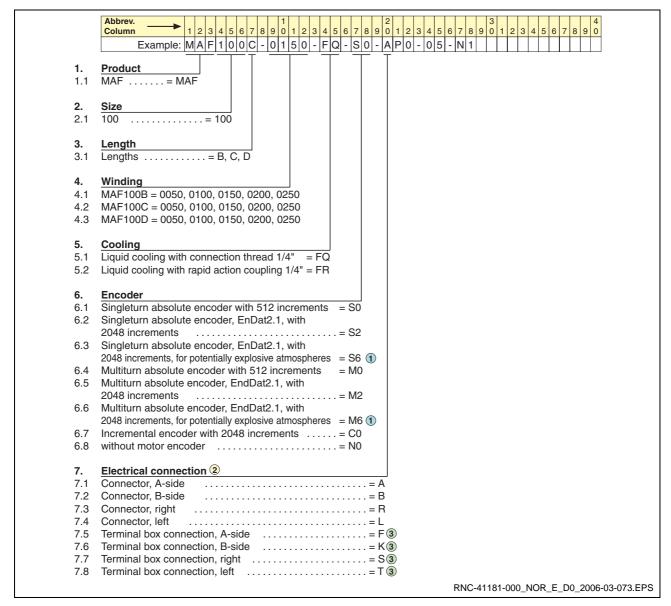


Fig. 6-14: Type code MAF100 (1/2)

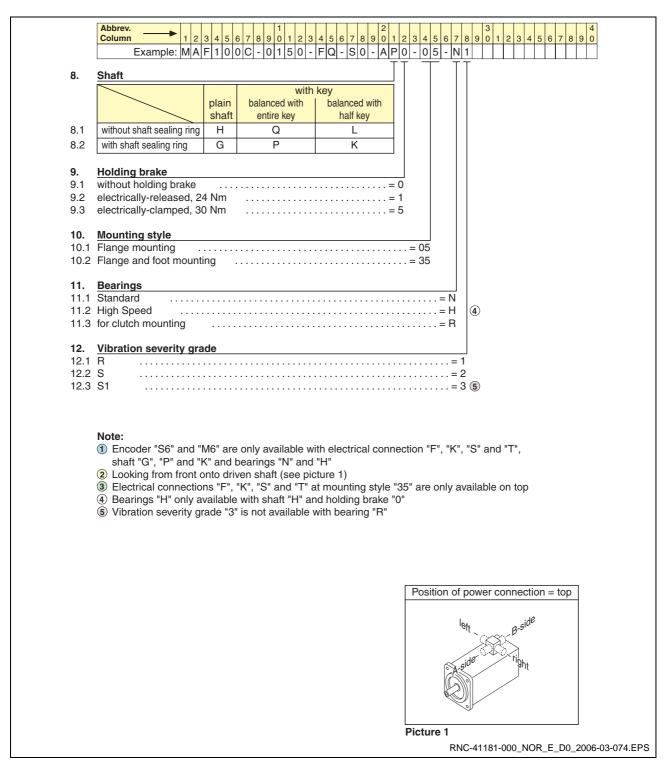


Fig. 6-15: Type code MAF100 (2/2)

## 6.8 Type Code MAF130

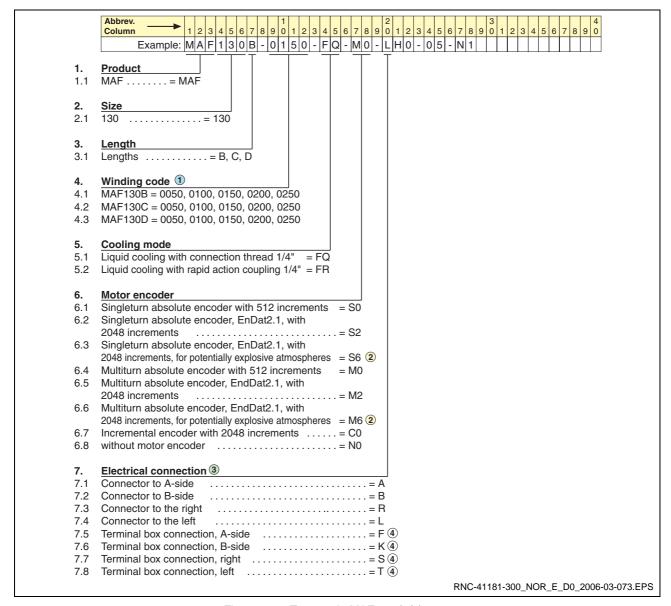


Fig. 6-16: Type code MAF130 (1/2)

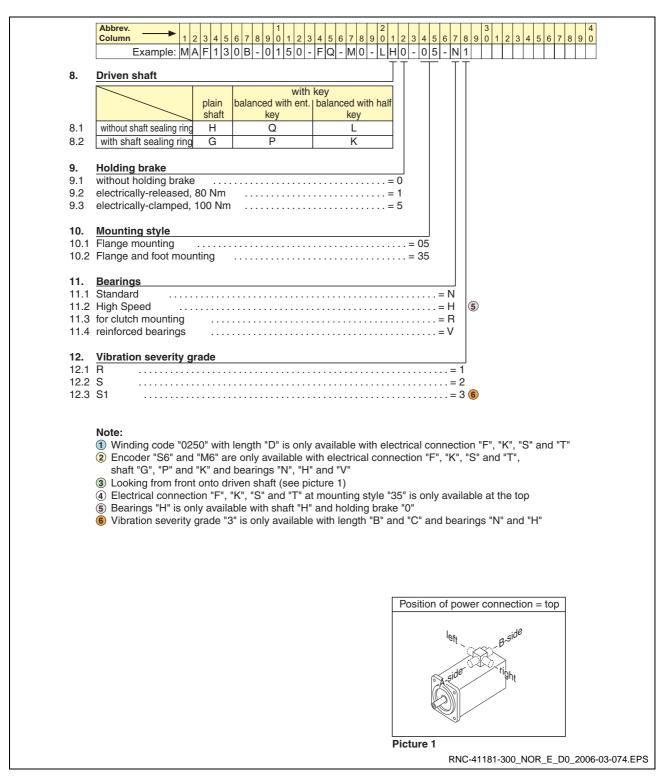


Fig. 6-17: Type code MAF130 (2/2)

## 6.9 Type Code MAF160

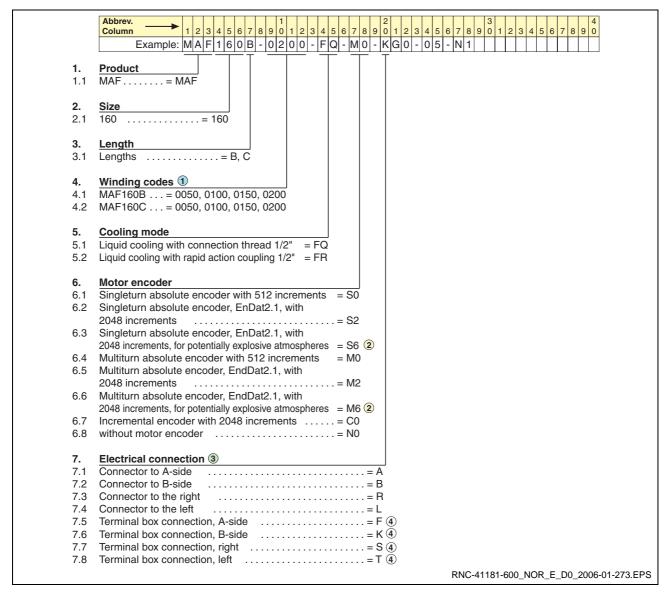


Fig. 6-18: Type code MAF160 (1/2)

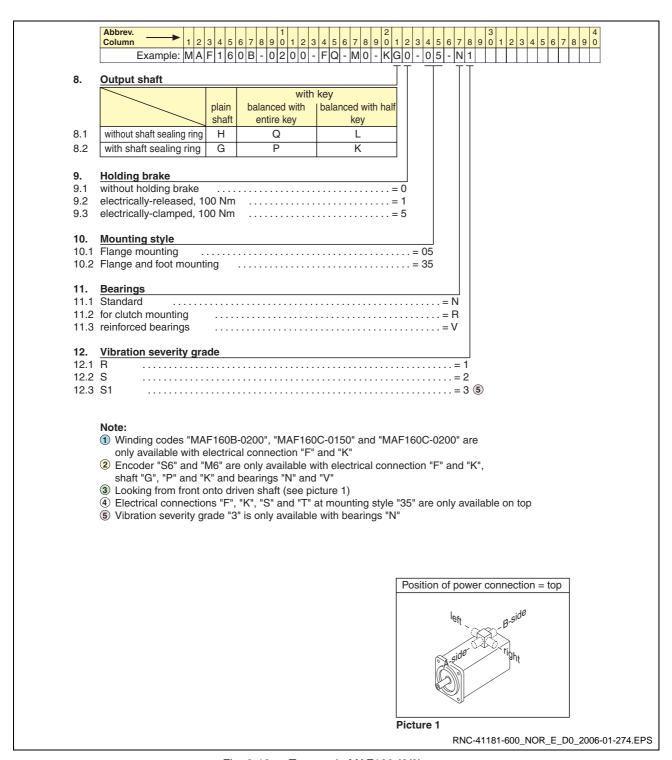


Fig. 6-19: Type code MAF160 (2/2)

## 6.10 Type Code MAF180

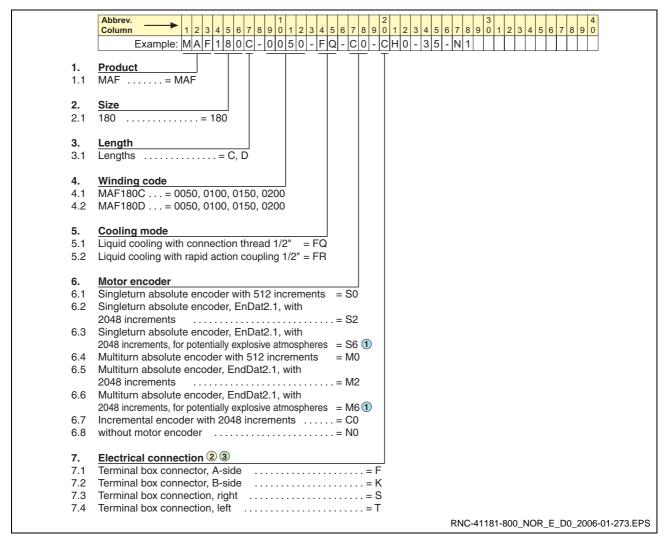


Fig. 6-20: Type code MAF180 (1/2)

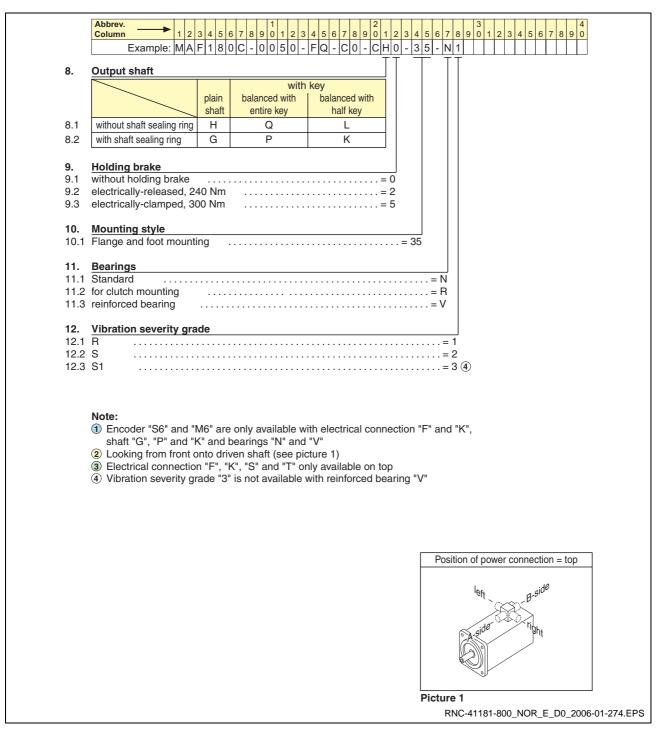


Fig. 6-21: Type code MAF180 (2/2)

## 6.11 Type Code MAF225

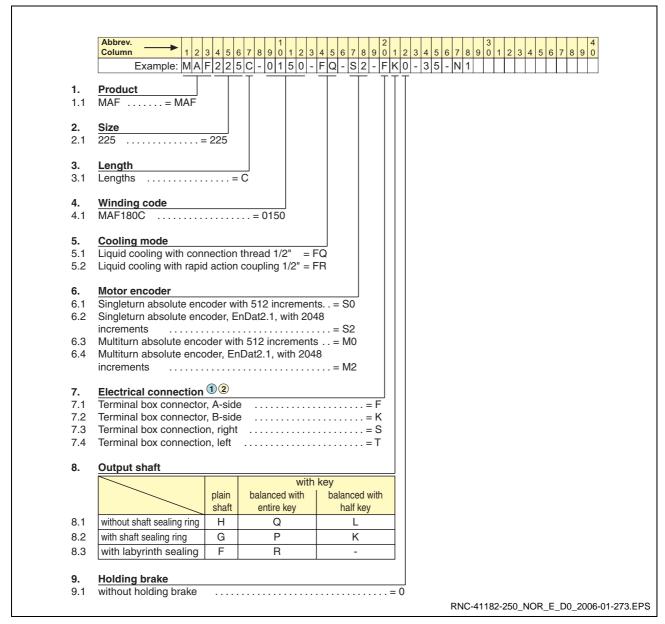


Fig. 6-22: Type code MAF225 (1/2)

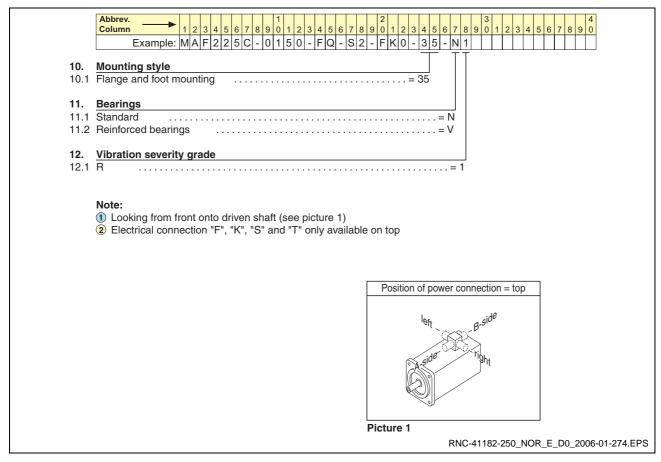


Fig. 6-23: Type code MAF225 (2/2)



Rexroth IndraDyn A Accessories 7-1

# 7 Accessories


# 7.1 Labyrinth Seal

To protect the motor output shaft against spraying fluids, IndraDyn A motors of frame sizes 130...180 that are already equipped with the "shaft sealing ring" option can be retrofitted with labyrinth seals (accessory SUP-M02-2AD...).

Labyrinth seal for	Туре	Material number	
MAD/MAF130	SUP-M02-2AD132	R911273268	
MAD160	SUP-M02-2AD160	R911272843	
MAF160	SUP-M02-ADF164	R911299702	
MAD/MAF180	SUP-M02-2AD180	R911273209	
MAD/MAF225	see "Labyrinth Seal" in chapter 9.12		

Fig. 7-1: Labyrinth seal

Accessory SUP-M02-xxx... is supplied complete with fastening screws and assembly instructions.

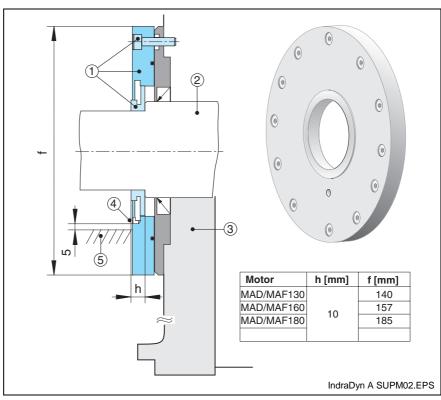

- (1): Labyrinth seal with fastening screws (within the scope of delivery)
- (2): Motor shaft A-side
- (3): Motor flange A-side
- (4): Drain hole
- (5): Max. permitted level of a fluid
- (h): Height of labyrinth seal

Fig. 7-2: Labyrinth seal mounted


#### Note:

- Pay attention to the assembly instructions for accessory SUP-M02-xxx... (in the scope of delivery).
- The labyrinth seal is effective only in horizontal installation position and from approx. 200 rpm. It may only be attached to motors with a factory-mounted shaft sealing ring.
- Seeping fluids can lead to damage to the motor. The tightness of the motor seal is ensured only according to the guidelines of the corresponding motor protection class.

## 7.2 Sealing Air Connection

When the motor is to be operated under adverse conditions, a higher protection class than the standard protection class with radial shaft sealing ring (IP65) may be required. High demands may be made on the tightness of motor seals when the motors are used in areas where oily coolants are used. We recommend to use sealing air in addition to the radial shaft sealing ring for these areas of application.

A defined excess pressure in the motor interior induced by the sealing air connection reliably prevents the penetration of, for example, creep oils and coolants.

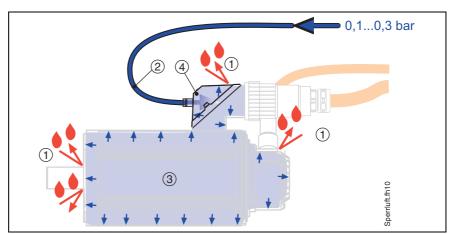

- (1): Splashing water, lubricant
- (2): Compressed air line
- (3): Excess pressure inside the motor
- (4): Lid for sealing air (with connector for compressed air line)

Fig. 7-3: Motor with sealing air connection

For IndraDyn A motors of frame sizes 100 to 160 with connector sockets for power connection, air pressure connector kits are available as accessory.


# Ordering name of accessory

Motor size MAD/MAF	Motor flange socket (type)	Description
100	INS0480	SUP-M01-MHD (MNR R911283006)
130160	INS0380	SUP-M02-MHD (MNR R911283007)

Fig. 7-4: Sealing air connection accessory

The air-pressure connector can be retrofitted by simply replacing the existing lid with the lid in the accessory kit. This lid comprises the connector for the compressed air line.

Rexroth IndraDyn A Accessories 7-3

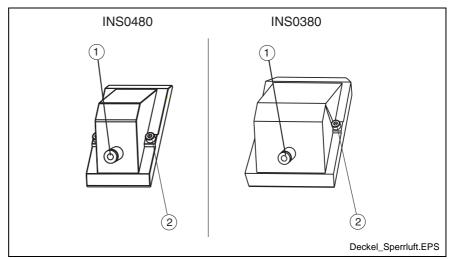

(1): Connector for compressed air line

(2): Fixing screws (2x)

Fig. 7-5: Lid for the air-pressure connector kit

#### Note:

When mounting the lid, make sure the O-ring is correctly positioned in the lid. The required motor protection class is only ensured when the O-ring is fitted correctly.

- Tightening torque of the two fixing screws: 3 Nm.
- An installation manual is included with the selected accessory kit.

#### **Technical data**

Motor operation with sealing is permitted only under the following conditions:

- system pressure at the motor
  - ⇒ 0.1...0.2 bar
- · properties of the compressed air
  - ⇒ as far as possible free of dust and oil (select corresponding filter)
  - ⇒ rel. air humidity 20...30%

#### Additional components

To operate the motor with sealing air under the above-named conditions, other devices or components as e.g.

- compressor
- · pressure regulator valve
- compressed air filter plus compressed air dryer, if applicable
- compressed air line (e.g. plastic tube PA 4 x 0.75)

are required. The user will have to procure and install these components as required.

For information on selection or dimensioning of suitable Rexroth accessories, please contact your sales partner, or directly

# Supplier of accessory components

Bosch Rexroth AG

**Pneumatics** 

Ulmer Str. 4

30880 Laatzen, Germany

Phone: +49 (511) 21 36-0 / Fax: +49 (511) 2 13 62-69

## 7.3 Gearboxes

In certain conditions, switched and planetary gearboxes can be attached to IndraDyn A motors.

Туре	Gearbox type	Motor requirements	Supplier
GTM	Planetary gearbox 1)	Plain motor drive shaft	ZF Maschinenbetriebe GmbH P.O. bpx 2549 88015 Friedrichshafen, Germany Tel. +49-(0)7541-77-0
58	Worm gear 1)	Plain motor drive shaft	ATLANTA Zahnrad- und Werkzeugfabrik Seidenspinner GmbH & Co. Karl-Benz-Str. 16 74321 Bietigheim-Bissingen, Germany Tel. +49-(0)7142-7001-0

Bosch Rexroth is not the manufacturer of these gearboxes.
 Clarify compatibility and technical details with the manufacturer.

Fig. 7-6: Gearboxes for IndraDyn A motors

#### Note:

Only low axial shaft loads are permitted for IndraDyn A motors (also see chapter 9.13 "Bearing and Shaft Loads"). Therefore, the motors are not or not fully suitable for machine elements that generate axial loading of the motor (e.g. helical driving pinions).

## 7.4 Thread Reducers

For all IndraDyn A motors with power connection via terminal box, reducers for the connecting threads of the terminal box are comprised in the scope of delivery.

Note:

The reducers are located in the terminal box and are comprised in the motor delivery. You do not need to order them separately.

To order additional reducers, please use the following order numbers:

Rexroth IndraDyn A Accessories 7-5

Motor Frame Size	Winding	Reducer 1	Reducer 2	Order number
MAD/MAF100	all	from M32x1.5 to M25x1.5		R911311878
MAD/MAF130	all	from M40x1.5 to M32x1.5	from M40x1.5 auf M25x1.5	(Reducer 1) R911310197 (Reducer 2) R911310332
MAD/MAF160	all*	from M50x1.5	from M50x1.5	(Reducer 1) R91131880
MAD/MAF180	all*	to M40x1.5	to M32x1.5	(Reducer 2) R911311876
MAF160C	0200			
MAF180C	0200	from M50x1.5 to M40x1.5	from M50x1.5 to M40x1.5	R911311880
MAF180D	0200			
MAD/MAF225	all	from M50x1.5 to M40x1.5	from M50x1.5 to M40x1.5	R911311880
*) Exceptions: MAF160C, MAF180C, MAF180D				


Fig. 7-7: Thread reducers for terminal box

## 7.5 Fan Cowl

When motors are used in a strongly polluted environment (e.g. dusts, oils, cutting materials and lubricants), clean air for motor cooling should by supplied from outside via a hose or an air duct.

For this application, Bosch Rexroth provides motors with a fan cover and fan cowl.

#### Sample application

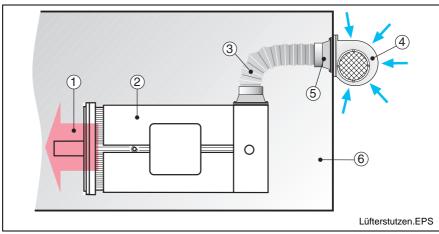

- (1): Air exit
- (2): Motor
- (3): Air duct (not included in scope of delivery)
- (4): air intake (radial fan not included in scope of delivery)
- (5): Fan cowl (accessory)
- (6): Working area
  Fig. 7-8: Fan cowl (example)

### Note:

- For the installation shown above, another fan cowl is required in addition to the fan cowl at the motor; this can be ordered as an accessory.
- Radial fan, air duct or hose and the respective mounting material do not belong to the scope of delivery of Rexroth.

Fan cowl for	Туре	Material n	umber
MAD100	SUP-M01-2AD100	R911249918	
MAD130	SUP-M01-2AD132	R911268753	
MAD160	SUP-M01-2AD160	R911275660	
MAD180	SUP-M01-2AD180	R911268606	

Fig. 7-9: Fan cowl (accessory)

#### Radial fans

For selection of suitable radial fans, please observe the notes on dimensioning, as well as the potential suppliers for radial fans in chapter 9.8 "Radial Ventilation in Hazardous Areas",

## 8 Connection Techniques

## 8.1 Notes



# Destruction of the motors by direct connection to the 50/60Hz mains network (three-wire or single-phase mains)!

⇒ The motors described here may be operated only with suitable drive control devices, with variable output voltage and frequency (converter mode) as specified by Rexroth.

Power cables and power plugs are not in the scope of delivery of the linear motor. They must be ordered as a separate position.

Rexroth offers a wide range of ready-made cables and plug-in connectors that are optimally adapted to the products and different demands.

Decisive advantages of Rexroth ready-made cables are:

- Pre-wired without additional finishing
- · Laid out for continuous alternate bending use
- Resistant against mineral oils, grease and biologic oils, silicon- and halogen-free, low adhesion
- Use of licensed cables acc. to UL and CSA
- Burning characteristics fulfill VDE0472-804 requirements
- Maintain EMC guidelines

Protection class up to IP67

#### Note:

Note that self-assembled cables or cable systems of other manufacturers may not fulfill these criteria.

Bosch Rexroth shall not be held responsible for resulting malfunction states or damages.



You can find additional information....

- to connect IndraDyn A motors in ATEX design in Chaptr 13.8;
- to select power and encoder cables for IndraDyn A motors from the following descriptions in this chapter;
- to select power and encoder cables for the IndraDyn A motors, refer to the documentation "Rexroth Connection Cables", MNR. R911282688:
- for assembling cables and plugs, as well as technical data, in the documentation "Rexroth Connection Techniques, Assembling and Tools...", MNR R911286117.

## 8.2 Power Connection

The power connection of the IndraDyn A motors is situated on the top of the motors. Depending on the motor type, it can be in the form of a **connector socket or a terminal box**. Please also refer to the data in the type code of the respective motor.

Note:

For the connection option "connector socket", please note:

 The power cable must be equipped on the motor side with a coupling with a bayonet connection.

For the connection option "terminal box", please note:

 Depending on the motor, the power cable must have wire end ferrules or ring cable lugs at U, V, W, and the PE must be equipped with a ring cable lug.

The design of the power cable also depends on the drive device used. Please observe the documentation of the drive device.

## **Overview**


			Terminal box			
Motor size MAD/MAF	Connector socket	U-V-W	Max. cross- section of connection	ØPE	Connecting thread	
100	INS480	WEF*	10mm²	Ring cable lug for M6 thread		
130	INS380	WEF*	25mm²	Ring cable lug for M8 thread	see motor	
160	INS380	WEF*	35mm²	Ring cable lug for M8 thread	dimension sheet and the information in Chapter 7,	
180	not available	Ring cable lug for M6 thread	50mm²	Ring cable lug for M10 thread	"Accessories"	
225	not available	Ring cable lug for M6 thread	2x 35mm²	Ring cable lug for M12 thread		
*) WES = wire end sleeve						

Fig. 8-1: Power connections - overview

## **Additional Grounding Wire at MAF225C**

In accordance with EN 60034--1:2004 (11.1 Grounding of Machines), motors of frame size MAF225C must additionally be grounded with a separate grounding wire with a minimum core cross-section of 16 mm<sup>2</sup>.


To this end, a connecting screw (Fig. 8-2) with thread M12 has been provided at the end shield of the MAF225C. By means of this connection screw, fasten the additional grounding wire with a ring cable lug for thread M12.

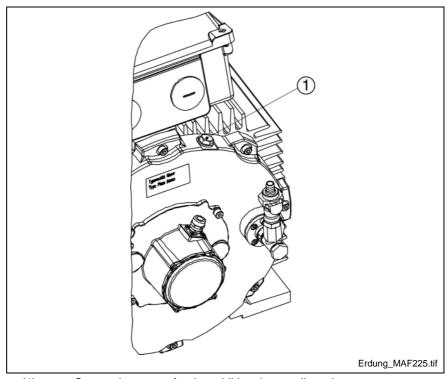

(1): Connecting screw for the additional grounding wire

Fig. 8-2: Additional grounding wire at MAF225C

## 8.3 Power Connection with Connector Socket

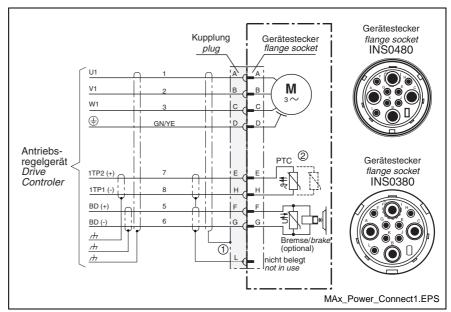

- (1): Shield connection via cable clamp of strain relief in the plug
- (2): Only one PTC sensor is applied. The cables for the spare sensor are in the connector housing

Fig. 8-3: Connector socket for power connection, diagram

## **Connector Socket**

Ready-made Rexroth power cables with coupling for connecting IndraDyn A motors are provided with a bayonet connection .

Connector socket	Coupling	Terminal area	Current rating
INS0480	INS048x	1.5 mm <sup>2</sup> - 10 mm <sup>2</sup>	max. 41 A
INS0380	INS038x	6.0 mm - 35.0 mm <sup>2</sup>	max. 100 A

Fig. 8-4: Couplings for connector sockets


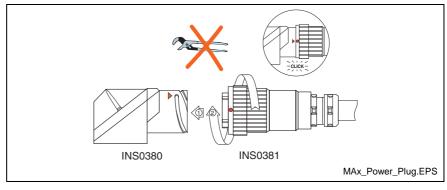


Fig. 8-5: Example, Plugged power connection

- 1. Insert the coupling into the connector socket; pay attention to the coding.
- 2. Manually tighten the union nut until it audibly locks in.
- 3. The red marks on the coupling and the connector socket are aligned when the bayonet connection is locked in.

## 8.4 Power Connection with Terminal Box

IndraDyn A motors for drive combinations with high DC bus voltage are equipped in the terminal box with a **terminal strip or terminal blocks** for cables with wire end ferrules

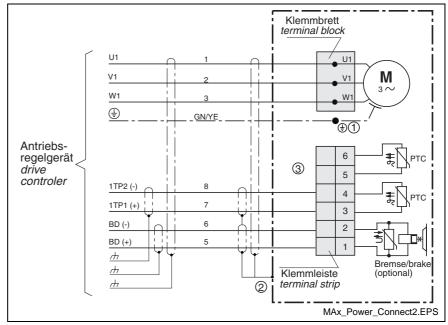


- (1): Electrically conducting connection to motor housing
- (2): Shield connection via cable clamp of strain relief in the screwed connection
- (3): Only one PTC sensor is evaluated. Connect the spare sensor only if necessary

Fig. 8-6: Terminal box, diagram

#### Note:

- The brake connections are assigned only if the motor was manufactured with the "brake" option.
- Only one of the PTC thermistor connector pairs (3-4 or 5-6) in the motor cable should be connected to the motor; the other one pairs serves a spare.
- Do not remove or damage the seal glued into the cover.
- Observe the size of the screwed cable connection and connection thread for the cable inlet into the terminal box.
- In particular, heed a sorted and de-energized laying of the connection cables within the terminal box to avoid abrasion or pressure marks on the cables.
- The connections of the motor-windings in the terminal box must not be removed.

Terminal box, frame size 100..180

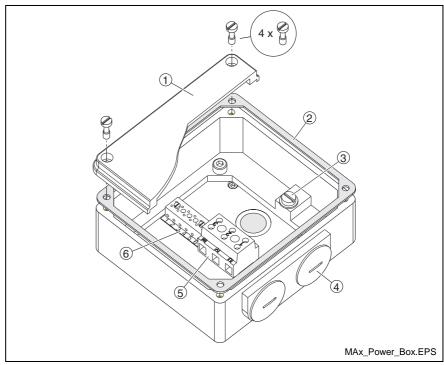


(1): Lid (3): PE connection

(5): U-V-W power connection

(2): Gasket(4): Cable entry(6): Terminal strip

Fig. 8-7: Terminal box

### Terminal box, frame size 225

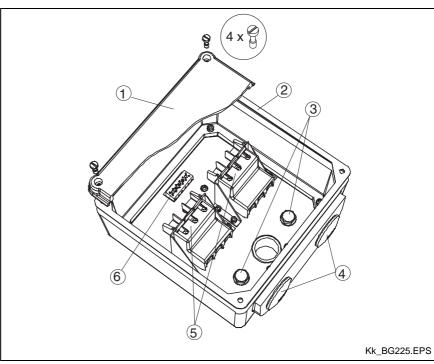

(1):Lid(2):Gasket(3):PE connection(4):Cable entry(5):U-V-W power connection(6):Terminal strip

Fig. 8-8: Terminal box, frame size 225

A schematic diagram of the respective connection is located in the lid of the terminal box.

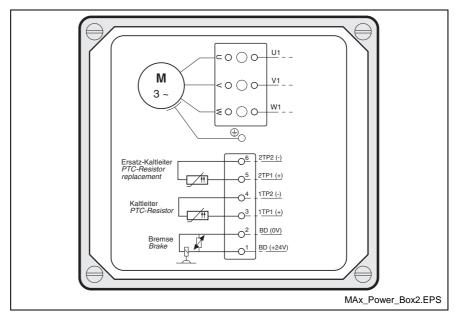


Fig. 8-9: Example of a terminal box lid

## 8.5 Connection Designations at the Drive Control Device

The following overview shows the connection and clamp designations for power connection, brake connection and the motor temperature monitoring at the respective Rexroth drive controller.

DEVDOTU	Clamp designation			
REXROTH drive control device	Power Temperature sensor		Holding brake	
arro control dovido	(terminal box X5)	(terminal box X6)		
IndraDrive	A1, A2, A3	MotTemp+ MotTemp-	+24VBr 0VBr	
DIAX04	A1, A2, A3	TM+ TM-	Br+ Br-	
ECODRIVE	A1, A2, A3	TM+ TM-	Br+ Br-	

Fig. 8-10: Clamp designations on drive control device

## 8.6 Double Cabling

A motor connection with two power cables is required if a corresponding single cable cannot be used due to the large bending radius or due to its dimensions.

**Note:** Double cabling can only be effected with power connection by means of terminal box.

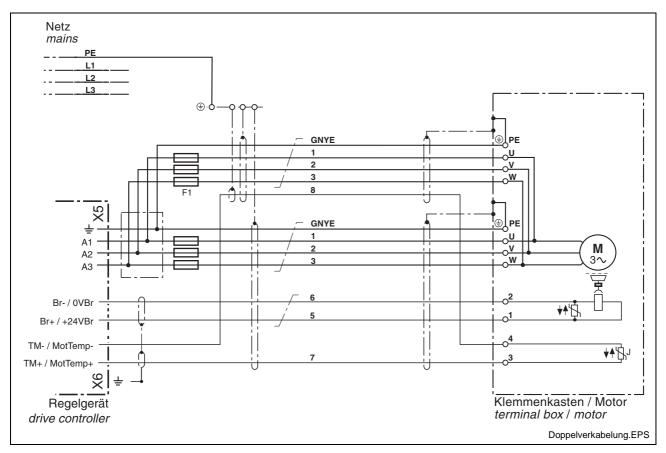


Fig. 8-11: Connection diagram double cabling

### Notes:

- When connecting motors in frame size 225, wires 5 and 6 are not required as these motors are only available without brake.
- Wires not shown in the switching diagram are not required and must not be connected.
- The fuses F1 (NH...) which protect the wires from overload in case of cable break are dimensioned in accordance with the current carrying capacity of the respective line crosssection.
- The fuses should be installed in the switch cabinet so that they are as close as possible to the power output of the drive device.
- The shields of the power cables should be connected to the switch cabinet with the largest possible surface area.
- Cable pairs must be properly connected to series terminal strips or to the terminal studs of the drive controllers; they must also fulfill safety requirements.

Furthermore, observe the following documentation:

- "Electromagnetic Compatibility (EMC) ..." MNR R911259740
- documentation of the motor used
- documentation of the drive device used
- "Rexroth Connection Cable", MNR R911282688



## 8.7 Encoder Connection

Depending on the encoder type, the connection of the encoder to IndraDyn A motors has a 10-pole, 12-pole or 17-pole connector socket at the motor housing.

Motor Frame Size		Connector socket (X3) for encoder connection			
		C0 M0/S0		M2/S2	
	100	INS0629	INS0524	RGS1003	
	130			RGS1004 *)	
MAD	160	INS0719	INS0638		
	180				
•	225	not available			
	100		INS0524	RGS1003	
	130	INS0629			
MAF	160	11130029			
	180				
	225	not available			

<sup>\*)</sup> Connector socket RGS1004 cannot be ordered as an individual component. It is a an inseparable part of the encoder connection cable to connect encoder option M2/S2.

Fig. 8-12: Designations of encoder connector sockets

In connection with the specified connector sockets, the following couplings can be used at the connection cable:


Connector socket (X3)	Coupling
INS0524	INS0510, INS0511, INS0713
INS0629	INS0379
INS0638	INS0510, INS0511, INS0713
INS0719	INS0379
RGS1003	RGS1001
RGS1004 *)	RGS1001

 $<sup>^\</sup>star)$  Connector socket RGS1004 cannot be ordered as an individual component. It is a an inseparable part of the encoder connection cable to connect encoder option M2/S2.

Fig. 8-13: Couplings for encoder connector sockets

See the following chart for the connector assignment:


## Pin assignment of encoder option C0

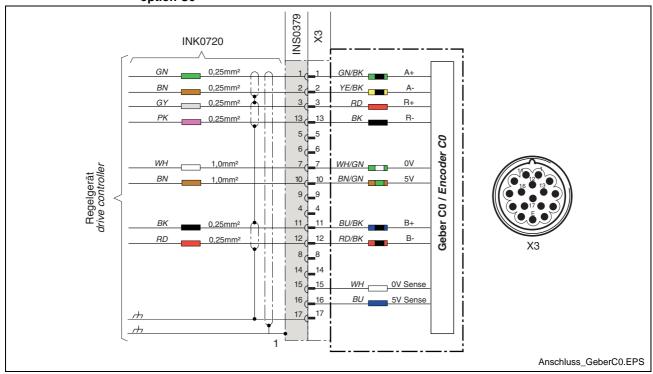

(1): Shield connection via cable clamp of strain relief

Fig. 8-14: Connection encoder type C0


## Connection assignment encoder option M0 / S0

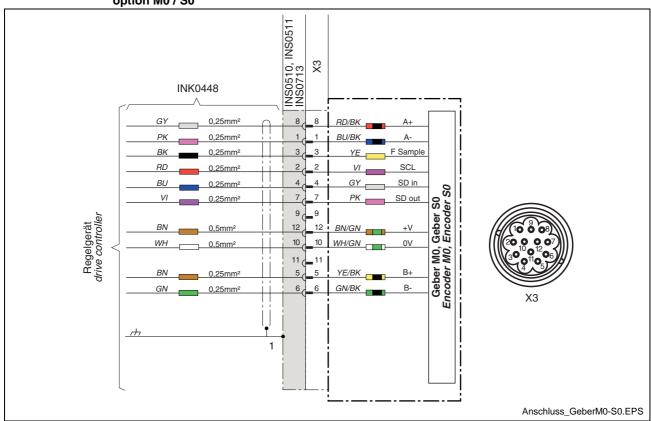

(1): Shield connection via cable clamp of strain relief

Fig. 8-15: Connection assignment encoder type M0 / S0

## Connection assignment encoder option M2 / S2

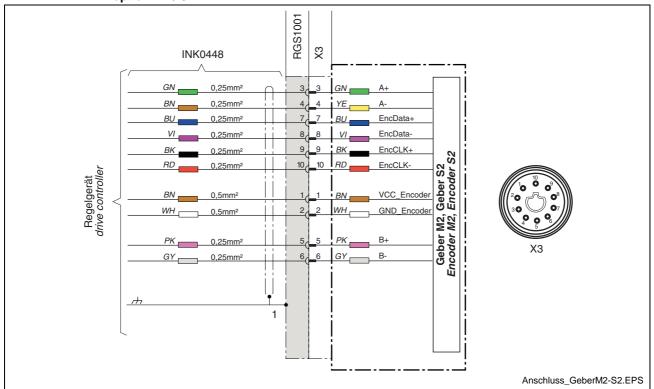

(1): Shield connection via cable clamp of strain relief

Fig. 8-16: Connection encoder type M2 / S2

The cable for connecting the motor encoder and the drive device must have a compatible coupling on the motor side.

The flange socket on the motor side and the coupling on the cable side are connected to each other and screwed on by hand. They are therefore structured as a mirror image, i.e. with different poles.

Please take note of the mechanical coding.

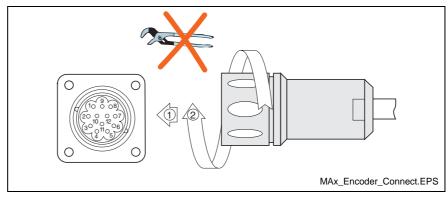


Fig. 8-17: Sample encoder plugged connection

- 1. Insert the coupling into the connector socket; pay attention to the coding.
- 2. Manually tighten the union nut.

## 8.8 Temperature sensor

IndraDyn A motors are equipped with two PTC temperature sensors KTY84-130 which are mounted stationary into the motor winding. For additional information on temperature sensors refer to Chapter 9.9 "Motor Temperature Overview".

#### Note:

- For the connection diagram, see Fig. 8-3 and Fig. 8-6 at the beginning of this chapter.
- Notice the correct polarity when using the sensor for temperature measurement external (see Fig. 9-18).
- The signal lines to the PTC sensors are routed to the controller via the motor power cable.
- Only one sensor is connected and evaluated. The function of the spare sensor cannot be guaranteed.

## 8.9 Holding Brake

The motor holding brake is triggered either directly through the drive device, or externally.

#### Note:

- For the connection diagram, see Fig. 8-3 and Fig. 8-6 at the beginning of this chapter.
- Control voltage is +24 V<sub>DC</sub> (+/-10%)
- Take note of the different functions of an electrically clamping and an electrically releasing brake (see chapter 9.10, "Motor Holding Brake").

## 8.10 Motor Cooling System

### **Fan Connection**

The motor fan is connected to the supply system via a cable and motor protecting switch and functions independent of the drive device.

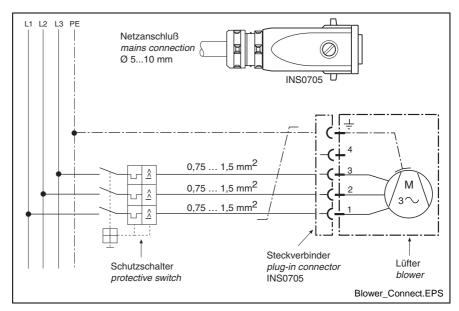


Fig. 8-18: Fan Connection

#### Note:

- To establish the connection, the fan plug must be opened and closed.
- The electric connection may be established by skilled personnel only. Please observe the safety notes.
- The tightness of the plug housing must not be reduced.
- The machine manufacturer selects the motor protecting switch and the electrical protection. Please observe the regulations in the country of installation.
- The plug for connecting the motor fan is included in the scope of delivery and is located on the fan.

### **Coolant Connection**

For liquid-cooled motors, two different coolant connections are possible.

	Connecti		
Motor MAF	Thread	snap-on coupling [Ø d <sub>i</sub> hose]	Note
100130	G1/4"	9.6 mm	Selection of
160225	G1/2"	12.7 mm	connection type by type code

Fig. 8-19: Overview coolant connections

Note:

The assignment of inflow (IN) and outflow (OUT) can be made as desired; it has no influence on the performance data of the motor.

**Thread** 

The connecting threads at the motor have been covered with protective caps at the factory. When the coolant is connected via the connecting threads at the motor side, please make sure that the value of the

tightening torque for the screwed connection specified in Fig. 8-20 is not exceeded.

Please note that depending on the type of fittings and pipes you have selected, it may not be possible to make full use of the maximum permissible tightening torque of the screwed connection at the motor side but that it may be necessary to reduce the value of the screwed connection at the customer side.

The data below have to be observed. Exceeding the tightening torque or depth of engagement can lead to irreversible motor damage.

#### Notes:

- Please take note of the manufacturer's information, particularly the values for the permissible tightening torque of the screwed connection of your choice.
- To avoid overloading of the insertion or seat of the screwed connection at the motor side, steady and counter it with a suitable spanner when tightening.

Frame size MAF	Thread	maximum permissible tightening torque	
100130	G1/4"	Values in proparation	
160225	G1/2"	- Values in preparation	

Fig. 8-20: Tightening torques for the connection thread at the motor

#### **Snap-on Coupling**

Another option for the coolant connection is a snap-on coupling which can also be released at full pressure. It has an integrated leak protection.

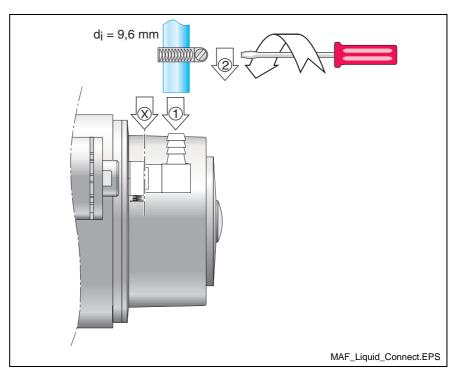


Fig. 8-21: Example for an MAF coolant connection

### Proceed as follows:

 Slip the hose on the motor connection (1). Avoid any bending or damaging of the screwed connection at the motor side.



- 2. With the fixing clamp (2), screw down the end of the hose over the connection.
- ⇒ For service purposes, the factory-attached screwed connection can be released at the point (X) (press bolt and withdraw the elbow in axial direction). It is not necessary to open the hose connection.



If you use another connection technology at the hose side, other assembly steps may be required. Refer to the manufacture for information on assembly.

To supply the MAF motors with cooling liquid, you will need additional installation material as e.g. hoses and fixing clamps (not included in the delivery). Select the supply hose with the correct inner diameter d<sub>i</sub>.

## **Operating Pressure**

A maximum coolant supply pressure of **3 bar** applies to all MAF motors, regarding the pressure effectively existing directly at the coolant connection of the motor.

Please note that additional screwed or branch connections in the cooling circuit can reduce the flow and supply pressure of the coolant.



## 9 Application Notes


## 9.1 Operating Conditions

## **Setup Elevation and Ambient Temperature**

The performance data specified for the motors apply in the following conditions:

- Ambient temperatures ranging from 0 °C to +40 °C
- Setup elevation of 0 m to 1,000 m above sea level.

If you want to use the motors in areas with values beyond these ranges, the performance data are reduced according to the following figure.

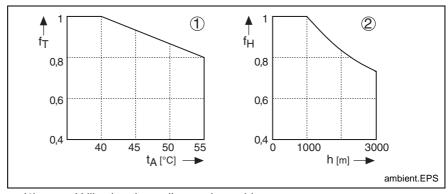

- (1): Utilization depending on the ambient temperature
- (2): Utilization depending on the setup elevation
- fτ: Temperature utilization factor
- ta: Ambient temperature in degrees Celsius
- fh: Height utilization factor h: Setup elevation in meters
- Fig. 9-1: Utilization factors

If **either** the ambient temperature **or** the setup height exceeds the nominal data:

- 1. Multiply the motor data provided in the selection data with the calculated utilization factor.
- 2. Ensure that the reduced motor data are not exceeded by your application.

If **both** the ambient temperature **and** the site altitude exceed the nominal data:

- 1. Multiply the determined utilization factors fT and fH by each other.
- 2. Multiply the value obtained by the motor data specified in the selection data.
- 3. Ensure that the reduced motor data are not exceeded by your application.

## 9.2 Air Humidity

Ambient climatic conditions are defined into different classes according to DIN EN 60721-3-3 (1995), Table 1. They are based on observations made over long periods of time throughout the world and take into account all influencing quantities that could have an effect, such as the air temperature and humidity.

Based on this table, Rexroth recommends class 3K4 for continuous use of the motors.

This class is excerpted in the following table.

Environmental factor	Unit	Class 3K4	
Low air temperature	°C	+5 <sup>1</sup> )	
High air temperature	°C	+40	
Low rel. air humidity	%	5	
High rel. air humidity	%	95	
Low absolute air humidity	g/m³	1	
High absolute air humidity	g/m³	29	
Speed of temperature change	°C/min	0,5	
1) Rexroth permits 0°C as the lowest air temperature.			

Fig. 9-2: Classification of climatic environmental conditions according to DIN EN 60721-3-3, Table 1

## 9.3 Vibration and Shock

### **Vibration**

Sine-shaped vibrations occur in stationary use; depending on their intensity, they have different effects on the robustness of the motors.

The robustness of the overall system is determined by the weakest component.

According to DIN EN 60721-3-3 and DIN EN 60068-2-6, the following values are approved for Rexroth IndraDyn A motors:

Direction	Amplitude 0 – 55 Hz	Acceleration 55 – 2000Hz
axial	0.3 mm	1 m/s²
radial	0.75 mm	30 m/s <sup>2</sup> (10 m/s <sup>2</sup> in connection with M2/S2 encoders)

Fig. 9-3: Maximum values for sine-shaped vibrations

### **Shock**

The shock load of the motors is indicated by specifying the maximum permitted acceleration in non-stationary use, such as during transport.

Damage to functions is prevented by maintaining the limit values specified.

According to DIN EN 60721-3-3 (1995), the values for IndraDyn A motors are as follows:

	Maximum permissible shock stress (duration 11 msec)		
Motor Frame Size	axial	radial	
100 225	10 m/s <sup>2</sup>	150 m/s <sup>2</sup>	

Fig. 9-4: Shock stress

**Note:** Please also observe the specifications in chapter 13.8 regarding transport and storage.



The construction and effectiveness of shock-absorbing or shock-decoupling attachments depends on the application and must be tested using measurements.

This does not lie within the area of responsibility of the motor manufacturer. Modifications of the motor construction result in nullification of the warranty.

## 9.4 Compatibility with Foreign Material

All Rexroth controls and drives are developed and tested according to the state of the art.


However, since it is impossible to follow the continuing further development of every material with which our controls and drives could come into contact (e.g. lubricants on tool machines), reactions with the materials that we use cannot be ruled out in every case.

For this reason, you will have to carry out a test for compatibility among new lubricants, detergents, etc. and our housing and device materials.

## 9.5 Protection Class

The protection classes according to IEC 60529 apply for IndraDyn A motors. It must be ensured that, in each and every installation position of the motor, the motors are not subjected to ambient conditions outside of the applicable degree of protection.

The degree of protection is defined by the abbreviation IP (International Protection) and two reference numbers specifying the degree of protection. The first code number describes the protection class against contact and penetration of foreign substances; the second code number describes the protection class against water penetration.

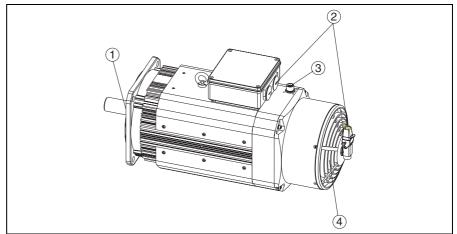

Pro	otection class range	Protection class	Note
	Output shaft without shaft sealing ring	IP 54	IP40 with vertical installation position (see Fig. 9-9)
1	Output shaft with shaft sealing ring	IP 65	Option
	Output shaft with labyrinth seal	IP 65	Accessory; seal effective starting at 200 rpm.
2	Power connection fan connection	IP 65	Terminal box or plug
3	Connection of motor encoder	IP 65	
4	Motor Fan	IP 65	Fan motor IP 65 Fan cowl IP 24

Fig. 9-5: Definition of the protection class ranges at the motor

It must be ensured that, in each and every installation position, the motors are not subjected to ambient conditions outside of the particularly applicable degree of protection according to IEC 60529.



Products and ranges with a low degree of protection are not suited for cleaning procedures with high pressures, vapors or water jets.


## 9.6 Frame Shape and Installation Position

IndraDyn A motors are available in frame shapes B05 and B35. Please refer to the table below for the conditions of installation permissible according to EN 60034-7.

Motor frame	Permissible conditions of installation			
shape	Description	Sketch	Setup	
	IM B5		Flange mounting on the drive end of the flange	
B05	IM V1		Flange attached on the drive side of the flange; drive side pointing down	
	IM V3		Flange attached on the drive side of the flange; drive side pointing up	
	IM B3		Foot installation feet pointing down	
B35	IM B5		Flange mounting on the drive end of the flange	

Fig. 9-6: Installation positions

IndraDyn A motors in motor frame shape B35 can either be fixed by means of foot assembly or flange assembly.

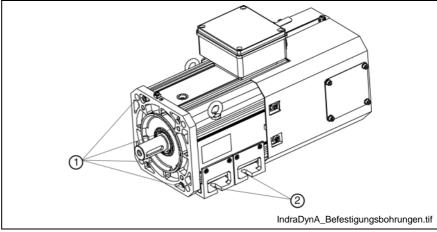


- (1): Flange for flange assembly
- (2): Assembly feet (both sides)

Fig. 9-7: Mounting types of the IndraDyn A motors

## **Foot Assembly**

As opposed to flange assembly, the radial forces in the case of foot assembly may act on the assembly surface ( $\pm$  15°) only in the vertical direction. The transfer of forces with other effective force directions is not permitted.

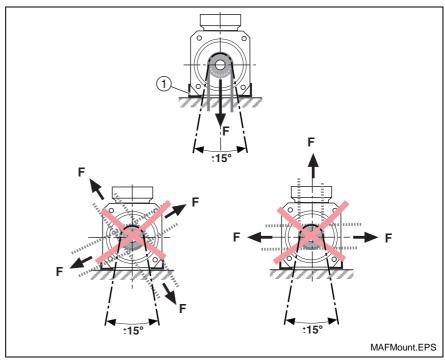

(1): Assembly feet

Fig. 9-8: Sample, MAF foot assembly

## Notes: When using foot assembly, please pay attention to the following:

- Forces affecting the motor feet that are transferred from a gearbox are not permitted.
   Forces that are effective via a gearbox shaft must be supported on the gearbox.
- An improper installation situation results in forces that can quickly lead to motor damage.
- Note the information in chapter 11.2 on foot assembly.
   Check the alternative "flange assembly".

### **Vertical Installation Position**

Output shaft pointing up


In the case of vertical installation positions of motors with output shafts pointing up (Fig. 9-9), dirt and fluids can enter the motor interior more easily, causing malfunctions or failure.

The degree of protection on the flange side of motors with a shaft sealing ring is IP 65. Hence, tightness is ensured only in case of splashing fluids. Fluid levels present on A-side require a higher degree of protection.

For motors of frame size 225, note as well that by reason of the high rotor weight and the bearing pre-tension, the axial bearing load (on the B-side) occurring with this installation position is so high that the useful life of the bearing must be expected to be significantly reduced to approx. 30% of the originally calculated bearing life.

Note:

With vertical installation position in case of output shaft pointing up (Fig. 9-9), the useful life of the bearing will be reduced to approx. 30% in case of motors of frame size 225.

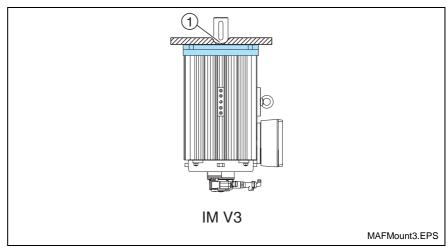

(1): Shaft duct IP 40 (standard)

Shaft duct with radial shaft sealing ring IP 65 (option)

Fig. 9-9: Example for MAF in vertical installation position, output shaft pointing up

#### Notes:

- Shaft end: The degree of protection on the flange side of motors with a shaft sealing ring is IP 65. However, sealing is ensured only in case of splashing fluids. Liquid levels present on the shaft end require a higher degree of protection.
- **B side:** The degree of protection for the fan screens in axial fans is IP 24. Chips or larger dirt particles can penetrate the fan screen as well.
- Protection class: The factory-attached protection class of IndraDyn A motors must not be reduced by modifications or by retrofitting accessories.

### Output shaft pointing down

When motors of frame size 225 are operated in vertical installation position with output shaft pointing down and in connection with a coupling, pay attention to the following facts when selecting a suitable coupling:

The axial pre-tensioning force of the coupling in pre-tensioned state must not exceed **400 Nm**.

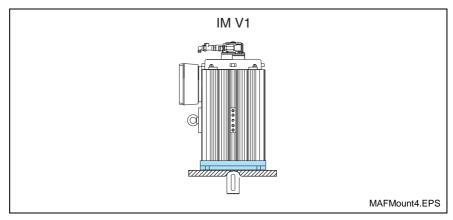


Fig. 9-10: Example for MAF in vertical installation position, output shaft pointing down

## 9.7 Housing Painting

The housing painting of the motors consists of a black (RAL9005) 2K epoxy resin coating based on epoxy polyamide resin in water.

Chemical resistance against	Limited resistance against	No resistance against
diluted acids and alkaline solutions	organic solvents	concentrated acids and alkaline solutions
water, sea-water, sewage	hydraulic oil	
commercial machine oils		

Fig. 9-11: Painting resistance



It is permitted to provide the housing with additional painting (coat thickness no more than 40  $\mu$ m).

Check the adhesion and resistance of the new paint coat before applying

## 9.8 Motor Cooling System

### Fan

**MAD motors** may be operated only with fans. Cooling occurs using air currents that are guided through air plates over the surface of the motor.


**Axial fan** 

An axial fan is used for cooling purposes. The fan is only available with the "blowing" option. Please note the information included in the type code.

Fan Cowl

For applications where an external fan needs to be attached to the motor, e.g. in heavily soiled or hazardous areas, the motors are equipped with a fan cowl for connecting the air hose. Please note the respective information in the type code and in chapter 7, "Accessories".

In order to ensure that the required air amount (see Chapter 4, "Technical Data") can be routed by the axial fan, a minimum distance between the fan screen and the machine must be kept so that the air can be sucked in and flow off. The distance (2) is determined by the motor construction.

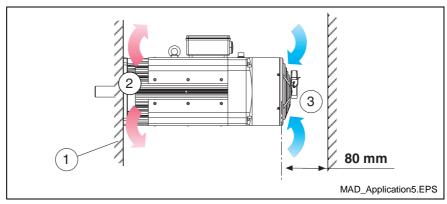

- (1): Machine
- (2): Air flow-off space(3): Air suck-in space

Fig. 9-12: MAD ventilation

- $\Rightarrow$  Observe the air flow in the machine construction. The minimum distance is 80 mm for all MAD motors.
- ⇒ The design for all fan variants is "blowing".

Pollution can reduce the performance of the fans and lead to thermal overload of the motors.

When the machine is operated in a polluted environment, increase the system availability by regularly cleaning the fan and motor radiator fins.




The machine construction must allow easy access to the motor and the fans for maintenance work purposes.

## **Radial Ventilation in Hazardous Areas**

When IndraDyn A motors in ATEX version are operated in a potentially explosive atmosphere, clean air for the motor cooling must be supplied from the outside via a hose or an air channel.

⇒ For this application, select motors with fan cover and fan cowl to connect an air hose.

#### Sample application

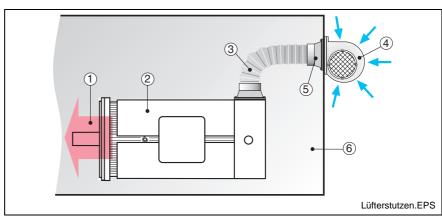

- (1): Air exit
- (2): Motor
- (3): Air duct (not included in scope of delivery)
- (4): Air entry (not included in scope of delivery)
- (5): Working area

Fig. 9-13: Example for radial ventilation via fan cowl

The machine manufacturer must select a suitable radial fan for potentially explosive areas under consideration of the machine specification. Radial fans for IndraDyn A motors are generally not comprised in the Rexroth scope of delivery. Please heed the additional information on the ATEX motors in chapter 13, "Motors for Hazardous Areas".

#### Notes:

After installation of the ventilation system, a specified air volume flow must be available at the motor (see the information on average air volume in the motor data sheet in chapter 4, "Technical Data"). Accordingly, when selecting radial fans, or in case of central ventilation, the installed length of hose or of air channel and the type of air supply (straight or angled) must be taken into consideration.

- The machine manufacturer carries out the calculation of the required air supply capacity using the system specifications.
- Air channel and fan hoses do not belong to the Rexroth scope of delivery.

The following manufacturers can supply powerful radial fans (list with no claim for completeness):

Suppliers of radial fans (excerpt)					
ЕВМ	EBM Werke GmbH & Co. Bachmühle 2 74673 Mulfingen, Germany Tel. +49-(0)7938 / 81-0 Fax +49-(0)7938 / 81-110 http://www.ebm-werke.de/				
ZIEHL-ABEGG	Ziehl-Abegg GmbH & Co. KG Zeppelinstraße 28 74653 Künzelsau, Germany Tel. +49-(0)7940 / 16-0 Fax +49-(0)7940 / 16-300 http://www.ziehl-abegg.de/				

Fig. 9-14: Manufacturers of radial fans

### **Coolants**

**MAF motors** must only be operated via an external cooling system.

The heat of the transformed motor power loss  $P_V$  is dissipated using the cooling system. Accordingly, MAF motors may only be operated if coolant supply is ensured. The cooling system must be rated by the machine manufacturer in such a way that all requirements regarding flow, pressure, purity, temperature gradient etc. are maintained in every operating state.



## Impairment or loss of motor, machine or cooling system!

- ⇒ It is essential that you take into account the motor data and the explanations and conceptions of the cooling systems in the documentation "Liquid Cooling, Dimensioning, Selection", MNR R911265836.
- ⇒ Heed the manufacturer's instructions when constructing and operating cooling systems.
- ⇒ Do not use any lubricants or cutting materials from operating processes.

All information and technical data are based on water as the coolant. If other coolants are used, these data no longer apply and must be recalculated.

A cooling with floating water from the supply network is not recommended. Calcareous water can cause deposits or corrosion and damage the motor and the cooling system.

For corrosion protection and for chemical stabilization, the cooling water must have an additional additive which is suitable for mixed-installations with the materials acc. to Fig. 9-16.

The utilization of aggressive coolants, additives, or cooling lubricants can cause irreparable motor damages.

- ⇒ Use systems with a closed circulation and a fine filter ≤ 100 μm.
- ⇒ Heed the environmental protection and waste disposal instructions at the place of installation when selecting the coolant.

#### **Aqueous Solution**

Aqueous solutions ensure reliable corrosion protection without significant changes of the physical property of the water. The recommended additives contain no materials harmful to water.

## Emulsion with Corrosion Protection

Corrosion protection oils for coolant systems contain emulsifiers which ensure a fine distribution of the oil in the water. The oily components of the emulsion protect the metal surfaces of the coolant duct against corrosion and cavitation. Herewith, an oil content of 0.5-2 volume percent has proved itself.

Does the corrosion protection oil compared with the corrosion protection has also the coolant pumping lubricant, then the oil content of 5 volume percent is necessary.

⇒ Heed the instructions of the pumping manufacturer!

#### **Coolant additives**

Example for coolant additives:

Description	Manufacturer			
1%3%-Solutions				
Aquaplus 22	Petrofer, Hildesheim			
Varidos 1+1	Schilling Chemie, Freiburg			
33%-Solutions				
Glycoshell	Deutsche Shell Chemie GmbH, Eschborn			
Tyfocor L	Tyforop Chemie GmbH, Hamburg			
OZO antifreeze	Deutsche Total GmbH, Düsseldorf			
Aral cooler antifreeze A	ARAL AG, Bochum			
BP antifrost X 2270 A	Deutsche BP AG, Hamburg			
Mineral grease concentrate – emulsive				
Shell Donax CC (WGK: 3)	Shell, Hamburg			

Fig. 9-15: Coolant additives

#### Note:

Bosch Rexroth can give no general statements or investigations regarding applicability of process-related coolants, additives, or operating conditions.

The performance test for the used coolants and the design of the liquid coolant system are generally the responsibility of the machine manufacturer. See also Chapter 9.4 "Compatibility".

### **Used Materials**

When used with MAF motors, the coolant comes into contact with the following materials:

Motor, housing	Screwed connections	Snap-on coupling
CU, CuZn39Pb2	Brass chromium-plated	Brass chromium-plated

Fig. 9-16: MAF material

In dimensioning and operating the cooling system, the machine manufacturer has to exclude all chemical or electro-chemical interactions with subsequent corrosion or decomposition of motor parts.

## **Coolant Inlet Temperature**

IndraDyn A motors are designed according to DIN EN 60034-1 for operating with +10...+40°C coolant inlet temperature. This temperature range must be strictly observed. At higher coolant temperatures, the reduction of the available torque is increased. Because of high coolant temperature gradients, lower temperatures can lead to destruction of the motor.

Note:	Install	systems	in	the	cooling	circuit	for	monitoring	flow,
	pressu	ire and ter	npe	eratur	e.				

#### Setting of the inlet temperature

Observe the temperature range permitted and consider the existing ambient temperature when setting the coolant inlet temperature.

The lower limit of the recommended coolant inlet temperature can be limited compared to the existing ambient temperature. To avoid condensation, a value of max. 5°C below the existing ambient temperature is permitted as the lowest temperature to be set.

#### Example 1:

Permitted coolant inlet temperature range +10... +40°C

Ambient temperature: +20°C

Set coolant inlet temperature: +15... +40°C

#### Example 2:

Permitted coolant inlet temperature range +10... +40°C

Ambient temperature: +30°C

Set coolant inlet temperature: +25... +40°C

Note:

The coolant inlet temperature must be set in a temperature range of +10°C - +40°C and may be only max. 5°C under the existing ambient temperature to avoid condensation.

## 9.9 Motor Temperature Overview

In their standard configuration, stators of IndraDyn A motors are equipped with built-in motor protection temperature sensors.

This sensor has a nearly linear characteristic curve (see Fig. 9-18).

## Temperature measurement sensor

Туре	KTY84-130
Resistor at 25°C	577 Ohm
Resistor at 100°C	1000 Ohm
Continuous current at 100°C	2 mA

Fig. 9-17: Temperature measurement sensor

The activation temperatures set on the controller side for protection of the motor are specified at:

- ⇒ 110°C pre-warning temperature
- ⇒ 120°C switch-off temperature

#### **Exception:**

- frame size MAD225 ⇒ 120°C pre-warning temperature
- frame size MAD225 ⇒ **130°C** switch-off temperature

**Note:** Ensure correct polarity when using the sensor for an external temperature measurement.

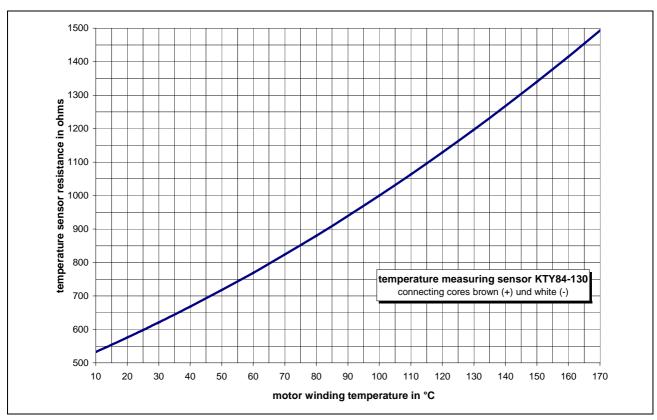


Fig. 9-18: Characteristic of temperature measurement sensor KTY84-130 (PTC)

A polynomial of degree 3 is sufficient for describing the resistance characteristic of the sensor used for temperature measurement (KTY84-130). In the following, this is specified for determining a temperature from a given resistance and vice-versa.

## Temperature depending on resistance

$$T_{w} = A \cdot R_{KTY}^{3} + B \cdot R_{KTY}^{2} + C \cdot R_{KTY} + D$$

Tw: Winding temperature of the motor in °C

Resistance of the temperature sensor in Ohms A: 3.039 ·10<sup>-8</sup>

A: 3.039 ·10<sup>-8</sup>
B: -1.44 ·10<sup>-4</sup>
C: 0.358
D: -143.78

Fig. 9-19: Polynomial used for determining the temperature with a known

sensor resistance (KTY84)

## Resistance depending on temperature

$$R_{KTY} = A \cdot T_w^{-3} + B \cdot T_w^{-2} + C \cdot T_w + D$$

Tw: Winding temperature of the motor in °C

R<sub>KTY</sub>: Resistance of the temperature sensor in Ohms

A: 1.065 ·10<sup>-6</sup>
B: 0.011
C: 3.93
D: 492.78

Fig. 9-20: Polynomial used for determining the sensor resistance (KTY84) with

a known temperature

Note: Note the correct polarity when using the sensor for

temperature measurement.

You can find further details on connecting the temperature sensors in chapter 8, "Connection Techniques".

## 9.10 Holding Brake (Option)

In **normal operation**, use the brake only when at a standstill and when performing the drive-internal brake check. The motor holding brake is required for holding the axle when the machine is in a de-energized state.



## Dangerous movements! Persons endangered by falling or descending axles!

- ⇒ Observe supplementary DIN and recommendations. For European countries:
  - DIN EN 954 / 03.97 on security-related parts of controllers.
  - Instruction sheet for vertical axes

Editor:

Süddeutsche Metall-Berufsgenossenschaft

Fachausschuss Eisen und Metall II

Wilhelm-Theodor-Römheld-Str. 15

55130 Mainz, Germany

USA: See National Electric Code (NEC), National Electrical Manufacturers Association (NEMA) as well as local building regulations.

The following is generally valid: the national terms must be observed!

- ⇒ The serially delivered motor holding brake does not suffice to ensure protection of persons!
- Ensure protection of persons by superordinate failsafe measures.
- Cordon off the hazardous area by means of a safety fence or a safety screen.
- ⇒ Additionally secure vertical axes to prevent them from sinking or descending after having shutdown the motor, for instance as follows:
  - lock the vertical axes mechanically,
  - provide an external braking / collecting / clamping device, or
  - ensure sufficient weight compensation of the axes.
  - Miscellaneous suitable measures.

#### **Brake control**

The brake's control mechanism must ensure this function in normal operation. Under the worst load condition of the power supply with a voltage of 24  $V_{DC}$  +/- 10% must provided the motor. To identify a failure on time during operation, the power supply for the brakes must be monitored by an undervoltage detection system.

#### **Functional test**


Before startup and during operation specifications the brake function must be tested with the "brake command" function. By applying a small amount of motor torque, the brake is checked for slippage. Additional information and specifications of this function may be found in the ECODRIVE firmware functional descriptions.



(2): Electrically releasing brake

## **Selecting Holding Brakes**

Brakes are either electrically clamping or electrically releasing.. Due to functional differences, different brakes should be used for main spindle and servo-axles. Observe the safety requirements during the system design.

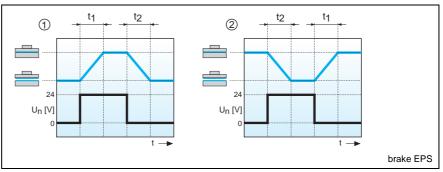

(1): Electrically clamping brake

Combination delay Release delay

Fig. 9-21: Holding brake diagram

t1:

t2:

## **Main Spindle Applications**

## Electrically clamping holding brake

An **electrically clamping** holding brake can be used to lock a main spindle during standstill and when the control "controller enable" signal is off, e.g. when a tool change is performed without a closed position loop.

Clamp the motor only at standstill, after the controller has signaled the motor is at standstill.

The **electrically releasing** holding brake should not be used for main spindles. Unintentional clamping of the holding brake at a high engine speed can lead to extreme deterioration or even demolition of the brake (e.g. in the case of power loss or wire breakage).

### **Servo Applications**

## Electrically releasing holding brake

The **electrically releasing** holding brake is used to hold the axes at a standstill and when the "controller enable" signal is off. When the supply voltage fails and the controller is enabled, the **electrically releasing** brake will automatically close.

⇒ Do not use the holding brake as an operational brake for moving axles.

If the brake is engaged repeatedly on a drive in motion or the rated brake torque is exceeded, premature brake wear can occur.

The **electrically clamping** holding brake is inappropriate for servo applications because clamping in a de-energized clamping state is not possible.

## **Sizing of Holding Brakes (Application)**

The physical conditions of holding brakes require consideration of two states. In addition to normal operation, failures must also be considered. The effective braking torques are physically different.

### **Normal Operation**

In **normal operation**, using the holding brake for clamping of an axis standstill, the brake's static torque (M4) rating in the data sheets applies directly as static friction (M4) – stiction (friction coefficient  $\mu_H$ ).

### **Fault Condition (EMERGENCY STOP)**

In fault conditions (i.e., EMERGENCY STOP), where the holding brake is used to stop a moving axis, the "dynamic braking torque", or sliding friction (friction factor  $\mu_G$ ) applies.

The dynamic braking torque is reduced in comparison to the indicated static holding torque M4. Therefore, note the following description of dynamic sizing.

#### Dynamic sizing

The load torque must be lower than the minimum dynamic torque which the brake can provide. Otherwise the dynamic brake torque is not sufficient to stop the axis.

If a mass is to be decelerated in a defined time or in a defined way, the additional moment of inertia of the whole system must be taken into account.

### Further important aspects for sizing:

The holding brake is not a safety brake (see DIN EN 954 / 03.97 and vertical axis data sheet SMBG). Due to uncontrollable influencing factors such as a rust film on the brake surface, the brake holding torque can be reduced. Additionally, excessive voltages and temperatures can weaken the permanent magnets and the brake.

#### Sizing recommendation

Bringing these factors together, the following recommendations can be given for sizing the holding brakes to the axles.

The necessary holding torque required for the application must not exceed a maximum of 60% of the static holding torque (M4) of the used holding brake.

#### Note:

Holding torque reduction and premature wear occur when braking moving axles!

Do not use the holding brake to stop a moving axle! This is permitted for EMERGENCY STOP situations only. In this situation, the specified rated torque of the holding brake (M4) is reduced to the value of the available dynamic braking torque. Complete deterioration of brake holding capability can be expected after approximately 20,000 revolutions of the brake when clamped.

Observe the instructions on commissioning holding brakes as described in chapter 12 "Startup, Operation, and Maintenance".



## 9.11 Motor Encoder

## **Options**

"**S0**": Singleturn absolute encoder with I<sup>2</sup>C interface. 1V<sub>ss</sub> sine/cosine signals with 512 lines per rotation and absolute period assignment within one shaft rotation.

"S2": Singleturn absolute encoder with EnDat2.1 interface.  $1V_{ss}$  sine/cosine signals with 2048 lines per rotation and absolute period assignment within <u>one</u> shaft rotation. The encoder has a data memory which comprises all relevant motor parameters required for commissioning the motor.

"S6": Encoder option for hazardous areas in pressure-resistant encapsulation with connection cable length 15 m. Technical characteristics same as option "S2".

"M0": Multiturn absolute encoder with I<sup>2</sup>C interface. 1V<sub>ss</sub> sine/cosine signals with 512 lines per rotation and absolute period assignment within 4096 shaft rotations. The axle position is recorded if the power fails.

"M2": Multiturn absolute encoder with EnDat2.1 interface.  $1V_{ss}$  sine/cosine signals with 2048 lines per rotation and absolute period assignment within  $\underline{4096}$  shaft rotations. The axle position is recorded if the power fails. The encoder has a data memory which already contains all relevant motor parameters required for commissioning the motor.

"M6": Encoder option for hazardous areas in pressure-resistant casing with connection cable length 15 m Technical characteristics same as option "M2".

"C0": Incremental encoder sine-/cosine signals 1Vss with 2048 lines per revolution.

"N0": The motor is supplied without a factory-attached encoder unit. The rear of the motor is blocked by a cover.

## Compatibility

Due to different encoder technologies, the motor encoders can be connected to only certain drive controllers and interfaces. The encoder data must be parameterized in the controller. The compatibility can be seen in the following table:

	ECO03	DIAX04	IndraDrive					
Encoder option	DKC 40200	HDD, HDS	ADVANCED	BASIC OPENLOOP	BASIC SERCOS	BASIC PROFIBUS	BASIC ANALOG	BASIC UNIVERSAL
C0, M0, S0	+	+	+	-	-	-	-	+
M2, S2 M6, S6	-	-	+	+	+	+	+	+
+ compatible	- incor	mpatible						

Fig. 9-22: Encoder compatibility



## **Accuracy**

There are two types of accuracy for rotary encoders: "absolute accuracy" and "relative accuracy".

#### **Absolute**

The absolute accuracy of rotary encoders is determined primarily by the quality and precision of the encoder construction as well as by the mechanical attachment to the motor.

The following values apply to IndraDyn A motors:

Encoder option acc. to type code	Technical Data	Absolute accuracy
C0	Incremental encoder sinus/cosine signal 1Vss with 2048 lines	± 0,0056° (± 20")
МО	Multiturn absolute encoder with I <sup>2</sup> C interface. Sinus/cosine signal 1Vss with 512 lines	± 0,0167° (± 60")
M2, M6	Multiturn absolute encoder with EnDat2.1 interface. Sinus/cosine signal 1Vss with 2048 lines	± 0,0056° (± 20")
S0	Singleturn absolutel encoder with I <sup>2</sup> C interface. Sinus/cosine signal 1Vss with 512 lines	± 0,0167° (± 60")
S2, S6	Singleturn absolute encoder with EnDat2.1 interface. Sinus/cosine signal 1Vss with 2048 lines	± 0,0056° (± 20")

Fig. 9-23: Absolute encoder precision

#### Relative

The relative accuracy of encoder systems is also referred to as "repeatability". It is determined primarily by the interpolation variances during further processing of the measured signals in the installed and in the external interpolation and digitization electronics.

For 2AD motors, the following guidelines apply for operation with Rexroth drive controllers (as of the publishing date of this documentation):

Encoder option acc. to type code	Technical Data	Relative accuracy
C0	Incremental encoder sinus/cosine signal 1Vss with 2048 lines	± 0,01'
МО	Multiturn absolute encoder with I <sup>2</sup> C interface. Sinus/cosine signal 1Vss with 512 lines	± 0,005'
M2, M6	Multiturn absolute encoder with EnDat2.1 interface. Sinus/cosine signal 1Vss with 2048 lines	± 0,005'
S0	Singleturn absolute encoder with I <sup>2</sup> C interface. Sinus/cosine signal 1Vss with 512 lines	± 0,001'
S2, S6	Singleturn absolute encoder with EnDat2.1 interface. Sinus/cosine signal 1Vss with 2048 lines	± 0,001'

Fig. 9-24: Relative encoder precision



Continuous further development of the hardware and firmware for drive controllers may result in variances from the above values. Therefore, always observe the information in the current drive controller documentation.

The accuracy of encoder systems is only a secondary factor for the precision of processing and positioning processes in a system.

Determining factors for the precision that can be attained include the functions of the system and the quality of the mechanical construction, among other things.

### Connection

The encoder connection is always on the same side of the motor as the power connection. The position of the encoder connection can not be changed after the motor has been delivered. For more details, refer to the motor dimension sheet and to chapter 8, "Connection Techniques".

Detailed information on the encoder connection on the controller side and on setting its parameters can be found in the documentation of the drive controllers.


## 9.12 Output Shaft

### **Plain Shaft**

The recommended standard model for all IndraDyn A motors provides a non-positive, zero backlash shaft-hub connection with a high degree of quiet running. Use clamping sets, clamping sleeves or clamping elements to couple the machine elements to be driven.

# **Output Shaft With Key**

The optional key according to DIN 6885, Sheet 1, version 08-1968, permits keyed transmission of torques with constant direction, with low requirements for the shaft-hub connection.

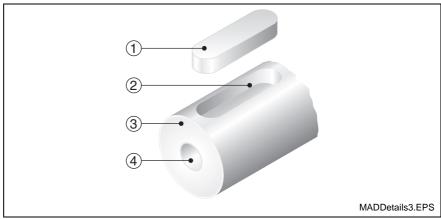

(1): Key (2): Keyway (3): Motor shaft (4): Center hole

Fig. 9-25: IndraDyn A output shaft with key

The machine elements to be driven must additionally be secured in the axial direction via the centering hole on the end face.

Note:

Avoid strong reversing operation. Deformations in the area of the keyway can lead to breakage of the shaft.

#### Balancing with a half key

The motor is balanced by a half key. The mass relationships are similar to those for a plain shaft. Inserting a complete key results in an imbalance that must be compensated on the machine element that is to be driven.

The hub of a machine element that is to be driven (pinion, pulley, etc.) should correspond to the key length.

Note:

If the hub is shorter, use a graduated key.

#### Balancing with a complete key

The motor is balanced using the included key. Hence, the machine element to be driven must be balanced without a key. The groove length in the hub is independent of the length of the key.

Modifications to the key may be made only by the user himself and on his own responsibility.

Bosch Rexroth does not provide any warranty for modified keys or motor drive shafts.

### **Output Shaft with Shaft Sealing Ring**

With the optional radial shaft sealing ring according to DIN 3760 – Design A, gearboxes with oil bath or circulating oil lubrication can be attached to IndraDyn A motors. IndraDyn A motors can also be operated in a dusty or humid environment.

Note:

With open oil-lubricated gearboxes, heavy sprays or speeds exceeding 4,000 rpm, we recommend to use an additional labyrinth seal which can be ordered or refitted as an accessory (see chapter 7).

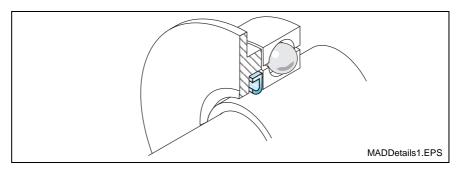


Fig. 9-26: Shaft sealing ring

Wear

Radial shaft sealing rings are rubbing seals. Hence, they are subject to wear and generate frictional heat.

Wear of the rubbing seal can be reduced only if lubrication is adequate and the sealing point is clean. Here, the lubricant also acts as a coolant, supporting the discharge of frictional heat from the sealing point. The useful life of the sealing lip at the radial shaft sealing ring depends in cleanliness, lubrication and motor speed.

Note:

Prevent the sealing point from becoming dry and dirty. Always ensure sufficient cleanliness and lubrication.

#### Resistance

The materials used for the radial shaft sealing rings are highly resistant to oils and chemicals. The performance test for the particular operating conditions lies, however, within the machine manufacturer's responsibility.

As of the publication date of this document, the following material assignment is applicable:

MAD/MAF motor	Sealing material	Abbreviation
100160	Polytetrafluorethylene	PTFE
180	Viton	FKM
225	Polytetrafluorethylene	PTFE

Fig. 9-27: IndraDyn A shaft sealing ring

The complex interactions between the sealing ring, the shaft and the fluid to be sealed, as well as the particular operating conditions (frictional heat, soiling, etc.), do not allow accurate calculation of the lifetime of the shaft sealing ring.

However, with a circumferential speed of 5 m/s and under favorable conditions (e.g. sufficient cleanliness and lubrication), a useful life of 5,000...10,000 h can be realized.

# Vertical mounting positions IM V3/IM V6

The degree of protection on the flange side of motors with a shaft sealing ring is IP 65. Hence, tightness is ensured only in case of splashing fluids. Fluid levels present on the A-side require a higher degree of protection. In the case of the vertical installation position of the motor, also heed the notes in the "9.6" section of this chapter ("Vertical Installation").


## **Labyrinth Seal**

To protect the motor output shaft against spraying fluids, IndraDyn A motors of frame size 225 can be directly ordered with labyrinth seal Please heed the correct order designation of the motors according to chapter 6, "Type Codes".

The labyrinth seal is provided to prevent the penetration of oil and splashing water (lubricating coolants etc). into the motor.

However, correct functioning of the labyrinth seal is only ensured when the motor installation position is horizontal, the position of the drain hole is always below the output shaft, the fluid level present at the motor is at least 5 mm below the drain hole (Fig. 7-2), the motor speed is at least 200 rpm.

On delivery, the labyrinth seal at the motor is installed in such a way that when looking at the A-side of the motors, the terminal box points up and the drain hole points down (below the output shaft).

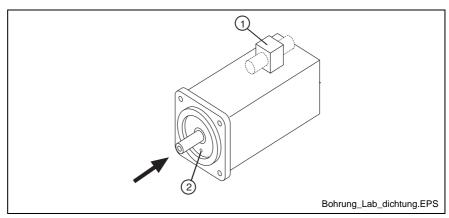


- 1: Terminal box = pointing up
- 2: Drain hole = pointing down

Fig. 9-28: Position of the drain hole in the motor as delivered

In certain installation situations, it may be necessary to install the motor with the terminal box positioned at the side or pointing down.

In these cases, turn the flange of the labyrinth seal before installing the motor until the drain hole is once more below the output shaft. In this way, correct functioning of the labyrinth seal is ensured.

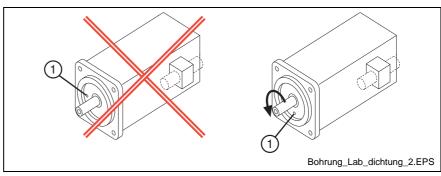

(1): Drain hole

Fig. 9-29: Example for a permissible position of the drain hole of the labyrinth seal

For this purpose, the flange has a hole circle with additional mounting holes in a 30° grid. To bring the drain hole of the labyrinth seal into the required position, perform the following assembly steps:

- 1. Unscrew the mounting screws (4x M6 DIN912).
  - If necessary, heat the screws to approx. 70°C to loosen them as they are glued in with Loctite 243.
- 2. Turn the flange on its center so that the drain hole points down once more.
- 3. Moisten the mounting screws (4x M6 DIN912) with Loctite 243 and screw them into the aligned threaded holes through the holes in the flange.
  - Tightening torque 9 Nm.
- 4. Attach the motor.

**Note:** For motors of frame sizes 130 to 180, Rexroth offers suitable accessories for retrofitting the motors. For more information, please refer to chapter 7.1 "Labyrinth Seal".

# 9.13 Bearing and Shaft Loads

During operation, both radial and axial forces act upon the motor drive shaft and thus upon the bearings. Machine design and motor type must be carefully adapted to make sure that the specified load limits are not exceeded.

### Radial Load, Axial Load

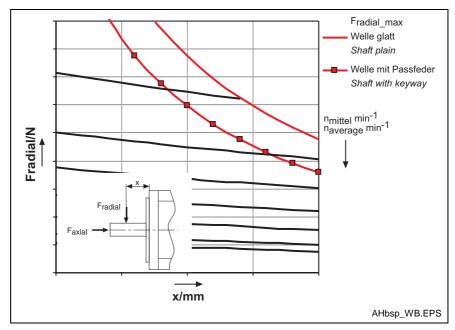


Fig. 9-30: Example of a shaft load diagram

Maximum permissible radial force F<sub>radial\_max</sub>

The maximum permissible radial force F<sub>radial\_max</sub> depends on the following factors:

- Shaft break load
- Point of force application (see Fig. 9-30)
- Shaft design (plain; with key)

Permitted radial force Fradial

The permitted radial force F<sub>radial</sub> depends on the following factors:

- Arithmetic mean speed (n<sub>mean</sub>)
- Point of force application (see Fig. 9-30)
- Bearing Lifetime

Permitted axial force Faxial

For IndraDyn A motors, only low axial shaft loads are permitted.

MAD/MAF	100	130180	225
perm. axial load [N]	30	50	100


Fig. 9-31: Axial load

The permitted axial load applies for all installation positions. Therefore, the motors are **not** suitable for machine elements that generate axial loading of the motors (e.g. helical driving pinions).

**Note:** Avoid impermissible axial loads or jolting of the motor drive shaft.

#### Mean speed

The initialization and deceleration times can be ignored in the calculation if the time in which the drive is operated at a constant speed is significantly higher than the acceleration and deceleration time. In the exact calculation of the mean speed according to the following example, the run-up and braking times are taken into account.

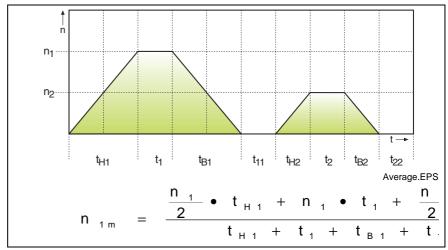

 $\begin{array}{ll} n_{1m} \colon & \text{mean speed in section 1} \\ n_{1m} \colon & \text{processing speed} \\ t_{H1} \colon & \text{run-up time} \\ t_{1:} & \text{processing time} \\ t_{B1} \colon & \text{braking time} \\ t_{1:} \colon & \text{standstill time} \end{array}$ 


 $n_{2m}$ : mean speed in section 2

n<sub>2</sub>: processing speed
t<sub>H2</sub>: run-up time
t<sub>2</sub>: processing time
t<sub>B2</sub>: braking time
t<sub>22</sub>: standstill time

Fig. 9-32: MAD mean speed

A complete processing cycle can consist of several sections with different speeds. In this case, the average is to be generated from all the sections.

#### Shaft load frame size 100

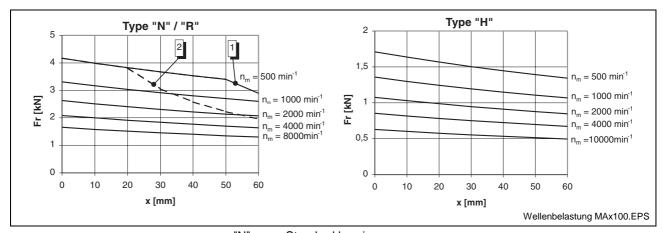

"N": Standard bearings

"R": Bearing for coupling connection


"H": High-speed bearing

(1): Load limit for drive shaft without key(2): Load limit for drive shaft with key

n<sub>m</sub>: Mean speed

Fig. 9-33: Shaft load frame size 100 (L<sub>h</sub>=30,000 operating hours)

#### Shaft load frame size 130

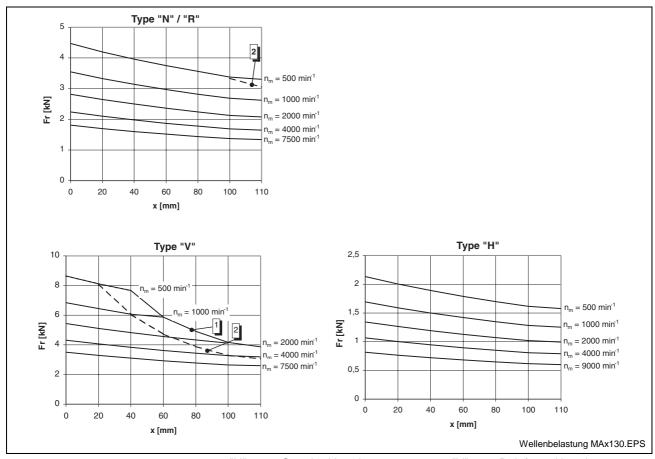


"N": Standard bearings "V": Reinforced bearing "R": High-speed bearing

(1): Load limit for drive shaft without key(2): Load limit for drive shaft with key

n<sub>m</sub>: Mean speed

Fig. 9-34: Shaft load frame size 130 (L<sub>h</sub>=30,000 operating hours)

#### Shaft load frame size 160

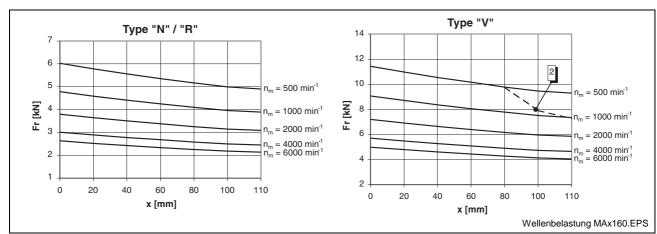

"N": Standard bearings

"R": Bearing for coupling connection


"V": Reinforced bearing

(1): Load limit for drive shaft without key(2): Load limit for drive shaft with key

n<sub>m</sub>: Mean speed

Fig. 9-35: Shaft load frame size 160 ( $L_h=30,000$  operating hours)

#### Shaft load frame size 180

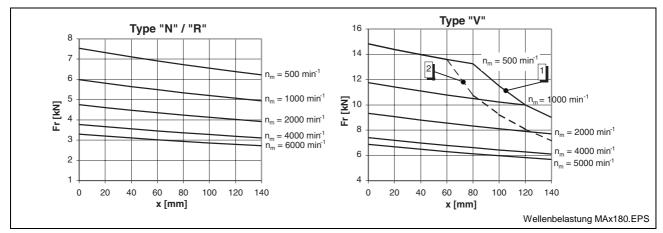

"N": Standard bearings

"R": Bearing for coupling connection


"V": Reinforced bearing

(1): Load limit for drive shaft without key(2): Load limit for drive shaft with key

n<sub>m</sub>: Mean speed

Fig. 9-36: Shaft load frame size 180 (L<sub>h</sub>=30,000 operating hours)

#### Shaft load frame size 225

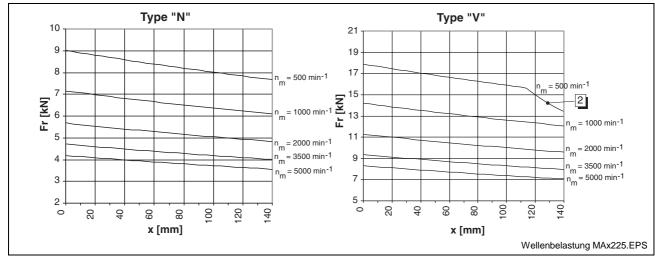

"N": Standard bearings "V": Reinforced bearing

(2): Load limit for drive shaft with key

n<sub>m</sub>: Mean speed

Fig. 9-37: Shaft load frame size 225 (L<sub>h</sub>=30,000 operating hours)

### 9.14 Attachment of Drive Elements

For all attachments of drive elements to the drive shaft, such as

- gearboxes
- couplings
- pinions

it is imperative that the following notes are observed.

#### **Redundant bearings**

Generally, overtermined bearings are to be avoided by all means when connecting drive elements. The tolerances inevitably present in such cases will lead to additional forces acting on the bearing of the motor shaft and, should the occasion arise, to a distinctly reduced service life of the bearing and/or to fatigue transverse rupture/vibration rupture of the motor shaft.

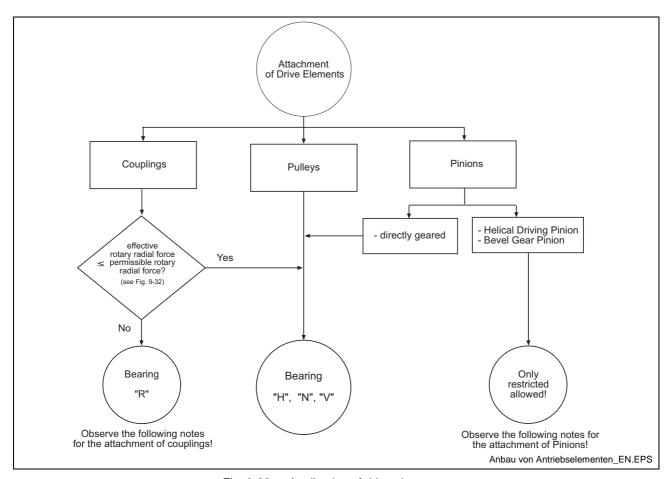


Fig. 9-38: Application of drive elements

**Note:** If redundant attachment cannot be avoided, it is absolutely necessary to consult with Bosch Rexroth.

### Couplings

Couplings are attached to transmit torques of two separate shaft ends. Usually, shaft offset, angle errors or axial distances must be offset. When an excessively stiff coupling is attached, a rotating radial force (= one which constantly causes change of angle position) may occur on the shaft end. This rotating radial force can cause an impermissibly high stress on the bearing seat and thus a significant reduction of bearing lifetime.

Note: For coupling attachment to IndraDyn A motors, Rexroth offers bearing variant "R".

When bearing "R" is used, higher rotating radial forces can be absorbed. Furthermore, couplings with higher radial stiffness can be used.

Motor size	Permitted rotating radial forces			
MAD/MAF	with bearing "R"	with bearing "N", "H", "V"		
100B	800 N	25 N		
100C	800 N	25 N		
100D	800 N	30 N		
130B	1000 N	40 N		
130C	1000 N	50 N		
130D	1000 N	55 N		
160B	1300 N	65 N		
160C	1300 N	65 N		
180C	1600 N	95 N		
180D	1600 N	100 N		
225C	not available	120 N		

Fig. 9-39: Permitted rotating radial forces

Note:

When bearing "R" is used, a limited maximum speed is available.

For information on maximum speed of the respective motor, please refer to chapter 4 "Technical Data".

#### **Coupling recommendations**

Rexroth recommends that you use axially offsetting couplings in connection with bearing "B", for example

- Spring flange couplings with two sets of springs (double cardanic)
- Metal bellow couplings

These coupling variants are backlash-free and have a high torsion stiffness along with low radial spring stiffness.

Note: Should you be unable to use the recommended coupling variants, it is imperative that you contact Bosch Rexroth.

We recommend e.g. the following manufacturers of the above-named couplings:

A. Friedrich Flender GmbH Phone: +49 (0) 2871 920 Alfred Flender Strasse 77 Fax +49 (0) 2871 922 596 46395 Bocholt, Germany Web: www.flender.com

JAKOB GmbH&CoKG
 Daimler Ring 42
 Phone: +49 (0) 6022 2208 0
 Fax +49 (0) 6022 2208 22

63839 Kleinwallstadt, Germany Web: www.jakobantriebstechnik.de

R+W Antriebselemente GmbH Phone: +49 (0) 9372 9864 0
Alexander-Wiegand-Strasse 8 Fax +49 (0) 9372 9864 20
Web: www.rw-kupplungen.de

### **Skew Bevel Driving Pinions**

Owing to thermal effects, the flange-sided end of the output shaft may shift by 0.6 mm in relation to the motor housing. If skew bevel driving pinions directly attached to the output shaft are used, this change in position will lead to

a shift in the position of the axis to be driven.

Note:

It is generally not permitted to directly attach skew bevel driving pinions. With skew bevel driving pinions, only drive elements with their own bearings may be used which are connected to the motor shaft via axially compensating couplings.

#### **Bevel Gear Pinions**

Owing to thermal effects, the flange-sided end of the output shaft may shift by 0.6 mm in relation to the motor housing. If bevel gear pinions directly attached to the output shaft are used, this change in position will lead to

 a thermally depend ent component of the axial force if the driving pinions are defined axially on the machine side. This causes the risk of exceeding the maximum permissible axial force or of the play within the gears increasing to an impermissible degree.

For this reason, bevel gear pinions must not be attached directly to the motor shaft. With bevel gear pinions, only drive elements with their own bearings may be used which can be connected to the motor shaft via axially compensating couplings.

**Note:** Direct attachment of bevel gear pinions to the motor shaft is not permitted.

# 9.15 Bearing Lifetime

The bearing lifetime is an important criterion for the availability of IndraDyn motors. When the lifetime is considered, the "mechanical lifetime" of bearing components and materials is differentiated from the "grease lifetime" of the bearing lubricant.

If IndraDyn motors are operated within the limits specified for radial and axial loads, the mechanical service life of the bearings is as follows:

# Mechanical service life of bearings

 $L_{10h} = 30,000$  operating hours

(calculated according to ISO 281, ed. 1993.01)

This applies to all IndraDyn motors based on the following:

- The permitted load of the motor from chapter 9.13 "Shaft Load" is never exceeded.
- The motor is operated under the permitted conditions for use and in the permitted ambient temperature range of 0° C to +40° C.
- The "mean speed" driven over the entire processing cycle conforms with the characteristic curves for the grease lifetime, whereby

$$n_m < n_{m(t_f = 30000 \, h)}$$

n<sub>m</sub>: mean speed

 $n_{\text{m(tf)}}$ : mean speed for which a grease lifetime of 30,000 h can be

expected.

Fig. 9-40: Mean speed

#### Differing loads can have the following effects:

- Premature failure of the bearing due to increased wear or mechanical damage.
- Reduction of the grease lifetime, leading to premature failure of the bearing.
- Avoid exceeding the load limits.

# Mechanical bearing lifetime with increased radial force

In other cases, the bearing lifetime is reduced as follows:

$$L_{10h} = \left(\frac{F_{radial}}{F_{radial\_ist}}\right)^{3} \cdot 30000$$

 $L_{10h}$ : (Bearing lifetime according to ISO 281, ed. 12/1990)  $F_{radial}$ : Determined permissible radial force in N (Newtons)

F<sub>radial\_act</sub>: Actually acting radial force in N (Newtons)

Fig. 9-41: Calculation of the bearing service life  $L_{10h}$  if the permissible radial force  $F_{radial}$  is exceeded

Note: Under no circumstances may the actually acting radial force

 $F_{\text{radial\_act}}$  be higher than the maximum permissible radial force  $F_{\text{radial\_max}}.$ 

### 9.16 Grease Service Life

Grease service life  $(t_f)$  is defined as the time from start-up until breakdown of a bearing as a consequence of lubrication failure.

Note that unfavorable operating and ambient conditions reduce the grease service life. When calculating the grease service life to be expected  $(T_{fq})$ , consider certain reduction factors for unfavorable operating and ambient conditions for each individual application. The following table indicates the reduction factors in accordance with the publication no. WL 81 115/4 DA by FAG Kugelfischer AG.

#### **Reduction factors**

Description	Description	Influence	Factor	Comment
Influence of dust and		moderate	0,90,7	For this environment, Rexroth offers the
moisture at the function surfaces of	f <sub>1</sub>	strong	0,70,4	option "radial shaft sealing ring".  When this option is used,
the bearing		very strong	0,40,1	f <sub>1</sub> = 1
Influence of impact		moderate	0,90,7	e.g. for machine tools and printing presses
load, vibrations and oscillations	f <sub>2</sub>	strong	0,70,4	e.g. for materials-handling technology (portals)
		very strong	0,40,1	e.g. for punches, presses
		moderate (up to 75°C)	0,90,6	The bearing temperature depends on the motor load.
Influence of higher bearing temperatures	f <sub>3</sub>	strong (7585°C)	0,60,3	Use of a special high-temperature grease results in
		strong (85120°C)	0,30,1	- load 070% $f_3 = 1$ - load 71100% $f_3 = 0.990.7$
	f <sub>4</sub>	P/C=0.10.15	1,00,7	With corresponding load of the shaft/bearing according to the respective
Influence of high load		P/C=0.150.25	0,70,4	shaft load diagram, the following applies to IndraDyn A motors
		P/C=0.250.35	0,40,1	$ \begin{array}{lll} - \text{load } 070\% & \text{f}_4 = 1 \\ - \text{load } 71100\% & \text{f}_4 = 0.990.7 \end{array} $
Influence of air flows through the bearing	f <sub>5</sub>	insignificant flows	0,70,5	With correct operation, there is no influencing air flow in the motor
		significant flows	0,50,1	f <sub>5</sub> = 1
With centrifugal effect or vertical shaft depending on sealing	f <sub>6</sub>	vertical	0,70,5	With horizontal motor installation $f_6 = 1$

Fig. 9-42: Reduction factors for grease service life

#### Calculation

$$\mathbf{t}_{\mathsf{f}_{\mathsf{G}}} = \mathbf{t}_{\mathsf{f}} \times \mathbf{f}_{\mathsf{1}} \times \mathbf{f}_{\mathsf{2}} \times \mathbf{f}_{\mathsf{3}} \times \mathbf{f}_{\mathsf{4}} \times \mathbf{f}_{\mathsf{5}} \times \mathbf{f}_{\mathsf{6}}$$

Fig. 9-43: Calculation of the expected grease service life

**Note:** Ensure that the permitted loads from chapter 9.13 "Shaft Loads" are not exceeded.

If the deployment duration of the motor is limited by the expected grease service life, the deployment duration of the motor can be increased in marginal cases by using the standard bearing in place of the reinforced

bearing in exceptional cases. In this case, the expected grease service life increases. However, the increased loading of the standard bearing reduces the available mechanical lifetime below 30000 operating hours.


⇒ This requires subsequent calculation of the bearing lifetime by Rexroth. In this case, contact one of our branch offices and explain your application with all relevant application data (load cycle, axial and radial loads, speeds).

The calculation and dimensioning of the bearing is based on standard DIN ISO 281.

See the diagrams below for the available grease service life of the deepgroove ball bearings and cylindrical roller bearings in IndraDyn A motors.

The diagrams show different characteristic curves depending on bearing type, standard, high-speed, or reinforced bearing, and bearing for the coupling connection.

# Grease service life frame size 100

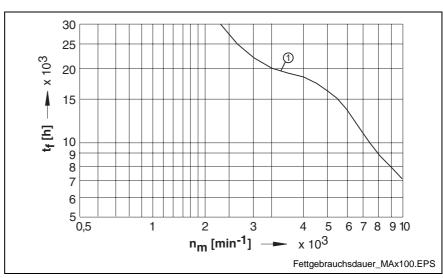


t<sub>f</sub>: Grease service life (without reduction factors)

(1): Standard and high-speed bearings, and bearing for coupling connection

n<sub>m</sub>: mean speed (calculation see Fig. 9-40)

Fig. 9-44: Grease service life frame size 100

# Grease service life frame size 130

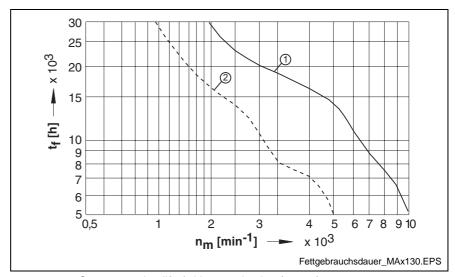

t<sub>f</sub>: Grease service life (without reduction factors)


n<sub>m</sub>: mean speed (calculation see Fig. 9-40)

(1): Standard and high-speed bearings, and bearing for coupling connection

(2): Reinforced bearing

Fig. 9-45: Grease service life frame size 130

# Grease service life frame size 160

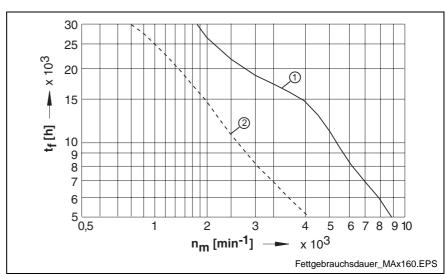

t<sub>f</sub>: Grease service life (without reduction factors)


n<sub>m</sub>: mean speed (calculation see Fig. 9-40)

(1): Standard bearing and bearing for coupling connection

(2): Reinforced bearing

Fig. 9-46: Grease service life frame size 160

# Grease service life frame size

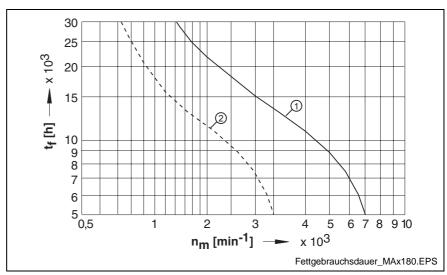

t<sub>f</sub>: Grease service life (without reduction factors)


n<sub>m</sub>: mean speed (calculation see Fig. 9-40)

(1): Standard bearing and bearing for coupling connection

(2): Reinforced bearing

Fig. 9-47: Grease service life frame size 180

# Grease service life frame size 225

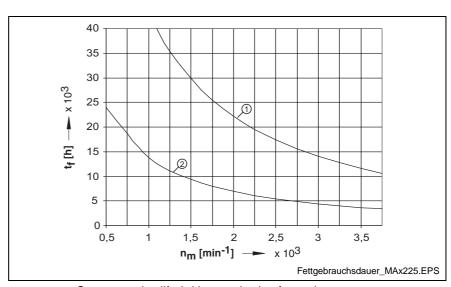

t<sub>f</sub>: Grease service life (without reduction factors)

n<sub>m</sub>: mean speed (calculation see Fig. 9-40)

(1): Standard bearing(2): Reinforced bearing

Fig. 9-48: Grease service life frame size 225

## 9.17 Bearing Variants

Depending on the frame size of the IndraDyn A motors, the following bearing variants are available:

- Standard bearing "N" = deep-groove ball bearing
- Reinforced bearing "V" = deep-groove ball bearing + cylindrical roller bearing
- high-speed bearing "H" = deep-groove ball bearing, light construction
- bearing for coupling connection "R" = deep-groove ball bearing + special bearing seat

#### Standard bearing

Universal bearing (type key option "N"), suitable for taking up low to medium radial and axial forces.

#### Advantages:


- · Easily available and high lifetime
- Suitable for high speeds
- · Low-noise running

#### Disadvantage:

· Suitable only for low to medium radial and axial loads.

#### Reinforced bearing

The reinforced bearing (type code option "V") is equipped with an additional cylindrical roller bearing on the drive side.

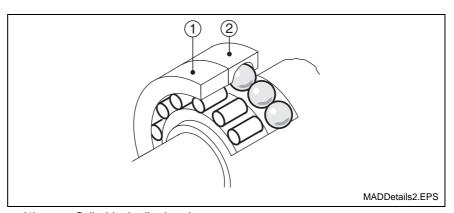

(1): Cylindrical roller bearing
(2): Deep-groove ball bearing

Fig. 9-49: Reinforced bearing

#### Advantage:

Can absorb higher radial forces

#### Disadvantage:

- The grease service life of reinforced bearing is reduced to half of the standard value.
- In certain motors, a reduction of the maximum permitted speed results.

 Motors with a reinforced bearing may be operated only with a permanent radial load (see Fig. 9-50). The bearings could be damaged by resulting sliding friction

Motors with a reinforced bearing must be operated as a minimum with the following radial loads.

Frame size	130	160	180	225
Minimum radial load [kN]	1	1,5	2	2

Fig. 9-50: Minimum radial load with reinforced bearing

#### **High-speed bearing**

The high-speed bearing (type code option "H") permits very high speeds due to a deep-groove ball bearing with an accordingly low-weight construction.

#### Advantage:

· Very high speeds are possible

#### Disadvantage:

- Can only be used with low radial load
- Use in motor frame sizes 100...130 only
  - · with horizontal motor installation position, and
  - without shaft sealing ring at the output shaft

#### Bearing for coupling connection

Bearing for coupling connection (type code option "R") allows for absorption of higher rotating radial forces which can occur when the motor is operated in connection with a coupling.

#### Advantages:

- Couplings with higher radial stiffness can be used.
- High resistance to rotating radial forces which may occur when the motor is operated with coupling

### Disadvantage:

• The available maximum motor speed is reduced



### **Tips for Selection**

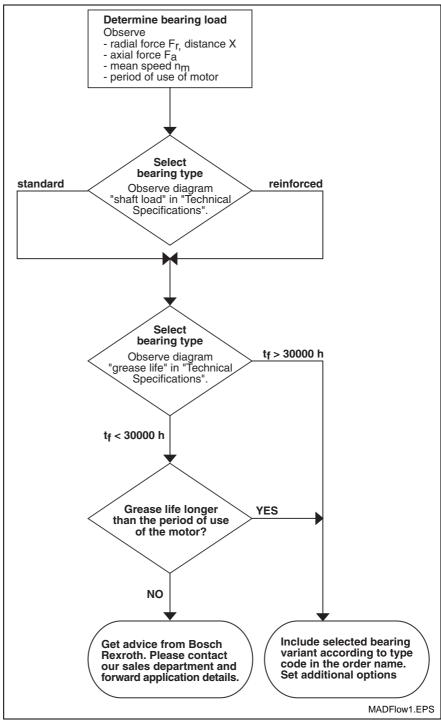


Fig. 9-51: Bearing selection process

## 9.18 Vibration Severity Level

IndraDyn A motors are dynamically balanced according to DIN ISO 2373.

Vibration severity step R is standard for all IndraDyn A motors. Steps S and S1 are available for certain motors in case of special demands on the mechanical running smoothness. Pay attention to the limitations in the individual type codes.

<u>d</u>		Effective vibration speed V <sub>eff</sub> in [mm/s]							
step		MAD/	MAF100	)130		MAD/MAF160180			80
sev	Speed n [rpm]					Speed	n [rpm]		
Vibr. sev.	600- 1800	1800- 3600	3600- 6000	6000- 9000	9000- 12000	600- 1800	1800- 3600	3600- 6000	6000- 9000
R	0,71	1,12	1,8	2,8	4,5	1,8	1,8	2,8	4,5
S	0,45	0,71	1,12	1,8	2,8	0,71	1,12	1,8	1,8
S1	0,28	0,45	0,71	1,12	1,8	0,45	0,71	1,12	1,8

Fig. 9-52: Effective vibration speed

The vibration behavior of attached or driven machine elements can cause repercussions on the motor; in unfavorable cases, they can cause premature deterioration or loss.

Due to the system-specific influences on the vibration behavior of the system as a whole, the machine manufacturer must determine the specific circumstances.

In certain cases, the machine elements may need to be balanced in such a manner that no resonance or repercussions occur.

⇒ Already take the vibration behavior of the motor and the machine elements into account when designing the system.

## 9.19 Explosion Protection



#### Danger of explosion! Invalidation of warranty!

- ⇒ The motor admitted for operation in hazardous areas and labeled accordingly is merely a part of a drive concept. Commissioning of the motors in such areas may be carried out only with a control device that is classified and permitted according to the conditions of the areas subject to explosions.
- ⇒ It is imperative that you pay attention to the information and notes in respect of project planning for the selected control device for motor scavenging already during project planning and before commissioning the system.

Under certain preconditions, IndraDyn A motors are admitted for use in hazardous areas. However, the ATEX motors (components for Group II, Category 2G, ATEX guideline 94/9/EG, Appendix II, Section 2.2.1) may only be used in certain defined environments. In this respect, please note the required selection criteria in the type code of the respective motor, as well as the additional information e.g. on selection, protection principle and required labeling of the motors in chapter 13, "IndraDyn A for Hazardous Areas".

The motors with the explosion-protection design are merely a part of a drive system which provides explosion protection only in combination with a control device for motor scavenging.

#### EEx p control device

The control device, which is required to safely operate the motor in an area subject to explosions, does not belong to the Bosch Rexroth scope of delivery and must be provided by the user.

Note:

For detailed information on selection, intended use and commissioning of ATEX motors, please see chapter 13, "IndraDyn A for Hazardous Areas".

# 9.20 Acceptances and Authorizations

### **CE symbol**

Declarations of conformity which confirm the construction and compliance with the valid EN standards are available for the IndraDyn A motors. If necessary, these certificates of conformity can be requested from the responsible sales office.

The CE symbol is applied to the motor type label of IndraDyn A motors.



Fig. 9-53: CE symbol

## **UR, cUR Listing**

IndraDyn A motors have been presented to and approved by the UL authorities "Underwriters Laboratories Inc.®".

The appropriate identification of the motors is specified on the motor name plate.



Fig. 9-54: cUR mark

# **Certificate of Conformity for ATEX Motors**

A declaration of conformity which confirms the construction and compliance with the valid EN standards is available for the IndraDyn A motors in ATEX version. A copy of the Certificate of Conformity is enclosed in chapter 13.12, "Certificate of Conformity".



# 10 Handling and Transport

## 10.1 Supplied Condition

IndraDyn A motors are delivered in wooden crates or in cartons. Packing units on pallets are secured by retaining straps.



# Injuries due to uncontrolled movement of the retaining straps when cutting!

Maintain a sufficient distance and carefully cut the retaining straps.

On delivery from the factory, the motor drive shaft and the connectors have protective sleeves. Remove the protective sleeves just before assembly.

### **Factory Inspection**

All IndraDyn A motors undergo the following inspections, among others, at the factory:

#### **Electrical test**

- High-voltage test according to EN 60034-1 (= VDE 0530-1).
- Insulation resistance according to EN 60204-1/1.92, Section 20.3.
- Ground terminal connection according to EN 60204-1/1.92, Section 20.3.

#### **Mechanical test**

- Concentricity and position tolerances of shaft end and fastening flange according to DIN 42955.
- Vibration measurement according to DIN 2373.

## Inspection by Customer

Since all IndraDyn A motors undergo a standardized inspection procedure, high-voltage tests on the customer side are not required. Motors and components could be damaged if they undergo several high-voltage tests.



**CAUTION** 

Destruction of motor components by improperly executed high-voltage test! Invalidation of warranty!

- ⇒ Avoid repeated inspections.
- $\Rightarrow$  Observe the regulations of EN 60034-1 (= VDE 0530-1).

### 10.2 Identification

The total scope of a delivery can be seen in the delivery note or waybill. However, the contents of a delivery can be distributed over several packages.

Each individual package can be identified using the shipment label attached to the outside.

Each device has an individual name plate containing the device designation and technical information.

⇒ After receiving the goods, compare the ordered and the supplied type. Submit claims concerning deviations immediately.

# 10.3 Designation

The type designation of the complete product results from the options selected. These designations, along with additional product data, are impressed on the name plate.

Using the designation and the serial number, every Bosch Rexroth product can be uniquely identified.

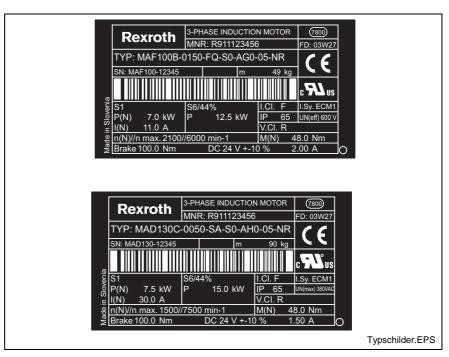


Fig. 10-1: IndraDyn A type labels

IndraDynA motors are supplied with 2 name plates each.

Attach the second name plate to an easily visible portion of the machine. Thus, you will be able to read the motor data at any time without having to get into inaccessible places where the built-in motor may be situated.

Before sending questions to Bosch Rexroth, always specify the full type identification data and serial number of the products involved.

# 10.4 Transport and Storage

#### **General Information**



# Damages or injuries and invalidation of the warranty due to improper handling!

- ⇒ Protect the products from dampness and corrosion.
- ⇒ Avoid mechanical stressing, throwing, tipping or dropping of the products.
- ⇒ Only use lifting equipment suitable for the weight of the motor.
- ⇒ Never lift the motor out of the fan housing.
- ⇒ Use suitable protective equipment and wear protective clothing during transport.

#### Notes:

- Permitted **transport temperature range**: -20°C to +80°C.
- Permitted storage temperature range: 0°C to +45°C.
- After storage of one to five years, the motor must warm up for one hour at 1000 rpm before starting normally.
- The max. permitted storage duration of the motors is 5 years. After the max. storage duration is exceeded, the bearing grease must be replaced.
- Also observe the notes regarding storage and transport on the packages.

## **Notes for Transport**

To protect the motor from dirt, dust etc., Bosch Rexroth recommends to transport the motor

- to the intended installation site and
- to keep it until the actual time of installation into the machine

in the packaging in which it has been delivered from Rexroth.

To lift the motor from the transport crate or to install it into the machine, use the transport or lifting eye bolts at the motor.

The lifting eye bolts comply with the requirements of DIN 580 as a minimum. Before each transport, ensure that the lifting eye bolts are screwed down fully to the stop face and that your selected lifting equipment and lifting method will not overload the lifting eye bolts.

#### Note:

Please note the DIN 580 standard on transport of motors by means of the attached lifting eye bolts. Non-observance of the information in this standard may cause overload of the lifting eye bolts and result in injury to persons or damage to products.

### Information on Storage

#### **Ambient Mechanical Conditions**

According to EN60721-3-2 (1997) class 2M2, the IndraDyn A motors should not exceed the following load limit during transport and storage.

Random noise spectrum		
Spectral acceleration data	1 m²/s³	0.3 m <sup>2</sup> /s <sup>3</sup>
Frequency range	10–2000 Hz	200–2000 Hz

Fig. 10-2: Mechanical ambient conditions during transport or storage

When delivered, IndraDyn A motors are equipped with protective sleeves and covers. During transport and storage, the protective sleeves must remain on the motor.

- ⇒ Remove the protective sleeves just before assembly.
- ⇒ Also use the protective sleeves if you return the goods.



Rexroth IndraDyn A Installation 11-1

### 11 Installation

## 11.1 Safety



# Risk of injuries due to live parts! Lifting of heavy loads!

- ⇒ Install the motors only when they are de-energized and not connected electrically.
- ⇒ Use suitable lifting equipment and protective equipment and wear protective clothing during transport.
- ⇒ Do not lift or move the motor by the fan unit.
- ⇒ Please note the safety information from the preceding chapters, and in particular the notes on transport of motors in chapter 10, "Handling and Transport".

Carry out all working steps especially carefully. In this way, you minimize the risk of accidents and damage.

IndraDyn A motors from frame size 130 have additional threaded holes on their long sides for inserting eyelets (for details, see the dimension sheet). Additional eyelets can simplify handling and transport.

### 11.2 Mechanical Attachment

**Fastening screws** 

To attach the motors correctly and safely to the machine, Bosch Rexroth recommends the following screws and washers for motor mounting.

#### ⇒ Motor frame size 100

- pan-head machine screw DIN 912 M12 x ... 8.8
- washer ISO 7092 12 200 HV

#### ⇒ Motor frame size 130...225


- hexagonal screws DIN 931 M... x ... 8.8 or
- pan-head machine screw DIN 912 M... x ... 8.8
- washer ISO 7090 ... 200 HV

Note:

If other screws and washers than those listed in this recommendations are used, the property class of the screws and the hardness class of the washers must be equivalent to allow for transmission of the required tightening torques (see Fig. 11-2).

11-2 Installation Rexroth IndraDyn A

### **Fastening Types**

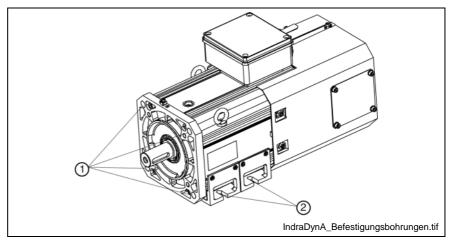

(1): Flange assembly(2): Foot assembly

Fig. 11-1: Motor fastening types

IndraDyn A motors are manufactured either for flange assembly (B05) or for foot assembly (B35). Details for the fastening holes can be found in the corresponding dimension sheet. For fastening, the following general assignment applies:

	B05 (flange assembly)			B35 (Foot as:		mbly)
	Hole	Threa	d (8.8)	Hole	Threa	d (8.8)
MAD/MAF	Ø [mm]	Туре	M <sub>GA</sub> [Nm]	Ø [mm]	Туре	M <sub>GA</sub> [Nm]
100	14	M12	87	11	M10	51
130				12	M10	51
160	18	MAC	045	14	MAO	0.7
180	10	M16	215	14,5	M12	87
225				21	M20	415
M <sub>GA</sub> = Torque given in Newton meters.						

Fig. 11-2: Fastening holes and tightening torques of the screws

#### Foot assembly

Before fastening IndraDyn A motors by means of foot assembly, please pay attention to the distance from motor shaft center to lower foot edge specified in the respective motor dimension sheet. Compare this value with the connection dimension present on the machine side.

Note:

Before fastening the motor to the machine, it must be aligned so that the center line of the motor shaft is in true alignment with the center line of the connection shaft.

Additionally, please observe the information in chapter 9.6 on foot assembly.

For foot assembly of the motors, we recommend to proceed as follows:

- 1. With MAD130...225: Dismount the lower air plates on the side to get free access to the mounting holes.
- 2. Align the motor so that the center line of the motor shaft is in true alignment with the center line of the connection shaft of the machine. To align the motor, use lengths of steel plate as a base.
- 3. Tightly connect the motor to the machine (tightening torques see Fig. 11-2)

Rexroth IndraDyn A Installation 11-3

4. With MAD130...225: Re-install the fan shrouds dismounted at the beginning to the motor.

Frame size	Type of motor fastening	Number of mounting holes	Peak-to-valley height of the screwing surface to the machine
100	Assembly feet (4)		
130	Feet plates (2)	4	Rz32
160	Assembly feet ()	7	11232
180225	via stator profile		

Fig. 11-3: Overview foot assembly

### **Assembly Preparation**

⇒ Log all measures taken in the commissioning log.

Prepare motor assembly as follows:

- 1. Check the components for visible damage. Defective components may not be mounted.
- 2. Ensure that dimensions and tolerances on the system side are suitable for motor attachment (for details, see the dimension sheet).
- 3. Ensure that mounting can be done in a dry, clean and dust-free environment.
- 4. Keep tools and auxiliary material, as well as measuring and testing equipment, ready at hand.
- Check whether all components, assembly surfaces and threads are clean
- 6. Ensure that the holder for the motor flange on the machine side has no burrs.
- Remove the protective sleeve of the motor drive shaft. Retain the sleeve for later use.

## **Motor Assembly**

⇒ Mount the motor.

#### Note:

- ⇒ With flange assembly: Avoid clamping or jamming the centering bundle on the motor side.
- $\Rightarrow$  With flange assembly: Avoid damage to the insertion fitting on the system side.
- ⇒ With foot assembly: Align the center line of the motor shaft in true alignment to the connection shaft. Please note the information in section 'Foot Assembly' in this chapter.
- ⇒ Connect the motor to the machine (tightening torques see Fig. 11-2).
- ⇒ Check the fit and accuracy of the connection before you proceed.

After having mounted the motor mechanically as prescribed, establish the electrical connections.

11-4 Installation

### 11.3 Electrical Connection

Use preferably ready-made connection cables by Bosch Rexroth. These cables provide a number of advantages, such as extreme load capability and resistance as well as a design suitable for EMC.

⇒ Complete the electrical connection of the IndraDyn A motors according to the information in chapter 8 "Connection Techniques", or for ATEX motors according to chapter 13 "Motors for Hazardous Areas".

#### Notes:

- In the case of self-made cables, pay attention that the design and installation are EMC-compatible.
- The terminal diagrams of the product documentation are used to generate the system circuit diagrams. Solely the system circuit diagrams of the machine manufacturer are decisive for connecting the drive components to the machine.

## **Additional Grounding Wire at MAF225C**

When connecting the MAF225C, note that this motor must be equipped with an additional grounding wire. See chapter 8.2 "Power Connection" for information on this additionally required grounding wire.



# 12 Operating IndraDyn A Motors

# 12.1 Commissioning



# Material damage due to errors in the controls of motors and moving elements! Unclear operating states and product data!

- ⇒ Do not carry out commissioning if connections, operating states or product data are unclear or faulty!
- ⇒ Do not carry out commissioning if the safety and monitoring equipment of the system is damaged or not in operation.
- ⇒ Damaged products may not be operated!
- Contact Bosch Rexroth for missing information or support during commissioning!

The following notes on commissioning refer to IndraDyn A motors as part of a drive system with drive and control devices.

### **Preparation**

- 1. Keep the documentation of all applied products ready.
- 2. Log all measures taken in the commissioning log.
- 3. Check the products for damage.
- 4. Check all mechanical and electrical connections.
- 5. Activate the safety and monitoring equipment of the system.

### **Execution**

#### When all prerequisites have been fulfilled, proceed as follows:

- Activate the fan at the MAD or the external cooling system for supply of the MAF motors, and check for regular condition. Heed the notes of the manufacturer.
- Carry out the commissioning of the drive system according to the instructions of the corresponding product documentation. You can find the respective information in the functional description of the drive control device.
- 3. Log all measures taken in the commissioning report.

Commissioning of drive controllers and the control unit may require additional steps. The inspection of the functioning and performance of the systems is not part of the commissioning of the motor; instead, it is carried out within the framework of the commissioning of the entire machine. Observe the information and regulations of the machine manufacturer.

### 12.2 Deactivation

# In the case of malfunctions or maintenance, or to deactivate the motors, proceed as follows:

- 1. Observe the instructions of the machine documentation.
- Use the machine-side control commands to bring the drive to a controlled standstill.
- 3. Switch off the power and control voltage of the drive device.
- Only for MAD: Switch off the motor protection switch for the motor fan.
- 5. Switch off the main switch of the machine.
- 6. Secure the machine against accidental movements and against unauthorized operation.
- 7. Wait for the discharge time of the electrical systems to elapse and then disconnect all electrical connections.
- 8. Before dismantling, secure the motor and fan unit against falling or movement before disconnecting the mechanical connections.
- 9. Log all measures taken in the commissioning report.

# 12.3 Dismantling



# Fatal injury due to errors in activating motors and working on moving elements!

- ⇒ Do not work on unsecured and operating machines.
- $\Rightarrow$  Secure the machine against accidental movements and against unauthorized operation.
- ⇒ Before dismantling, secure the motor and power supply against falling or movement before disconnecting the mechanical connections.
- 1. Observe the instructions of the machine documentation.
- 2. Please heed the safety notes and carry out all steps as described in the above instructions in the "Deactivation" section.
- 3. Before dismantling, secure the motor and power supply against falling or movement before disconnecting the mechanical connections. At the MAF motor, also empty the coolant channels.
- 4. Dismantle the motor from the machine. Store the motor properly!
- 5. Document all executed measures in the commissioning report and the machine maintenance plan.

### 12.4 Maintenance

Asynchronous motors of the IndraDyn A series operate without wear within the given operating conditions and service life. However, operation under unfavorable conditions can lead to limitations in availability.

- ⇒ Increase availability with regular preventive maintenance measures. Heed the information in the maintenance schedule of the machine manufacturer and the service measures described below.
- ⇒ Log all maintenance measures in the machine maintenance plan.

### **Measures**



### Danger of injury due to moving elements! Danger of injury due to hot surfaces!

- ⇒ Do not carry out any maintenance measures when the machine is running.
- ⇒ During maintenance work, secure the system against restarting and unauthorized use.
- ⇒ Do not work on hot surfaces.

Bosch Rexroth recommends the following maintenance measures, based on the maintenance plan of the machine manufacturer:

Measure	Interval
Only for MAF: Check the functioning of the coolant system	According to the guidelines in the machine maintenance plan, but at least every 1,000 operating hours.
<b>Only for MAD</b> : Check the functioning of the motor fan and the air circulation.	According to the guidelines in the machine maintenance plan, but at least every 1,000 operating hours.
Check the mechanical and electrical connections.	According to the guidelines in the machine maintenance plan, but at least every 1,000 operating hours.
Check the machine for smooth running, vibrations and bearing noises.	According to the guidelines in the machine maintenance plan, but at least every 1,000 operating hours.
Remove dust, chips and other dirt from the motor housing, cooling fins and the connections.	Depending on the degree of soiling, but after one operating year at the latest.

Fig. 12-1: Maintenance measures

#### MAD - Motor Fan

It may become necessary to dismantle the fan unit for maintenance measures or troubleshooting.


- ⇒ This work must be carried out only by skilled personnel.
- ⇒ Do not carry out any maintenance measures when the machine is running. Please observe the safety notes.
- ⇒ During dismantling, keep the strips, screws and nuts with which the fan units are fastened.

Parts of the fan unit housings consist of several elements that are screwed together. Remove only the indicated screws.

The fastening and basic housing of the fan unit are essentially identical for axial and radial fans.

### General procedure for maintaining the fan:

- 1. Switch off the system and disconnect the electrical fan connection.
- 2. Before loosening the fixing screws, make sure the fan unit does not drop; carefully remove the fan unit from the motor.
- 3. After completing cleaning or troubleshooting, reattach the fan unit. Secure the fastening screws with "LOCTITE 243 screw fastener" and reestablish the connections.
- 4. Check the functioning of the motor fan and the air circulation.
- 5. Log all maintenance measures in the machine maintenance plan.

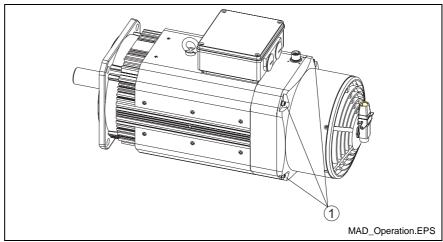

(1): Fastening screws (also on rear)

Fig. 12-2: MAD fan

## MAF – Coolant Supply

It may become necessary to dismantle the coolant supply for maintenance measure or troubleshooting.

- ⇒ This work must be carried out only by skilled personnel.
- ⇒ Do not carry out any maintenance measures when the machine is running. Please observe the safety notes.
- ⇒ Protect open supply cables and connections against penetration of pollution.

### **Maintaining Holding Brakes**

In order to ensure proper functioning of the holding brake, it must be checked before the motor is installed.

#### Before initial startup

Measure the holding torque of the brake; grind in the holding brake, if necessary.

#### Proceed as follows:

- 1. De-energize the motor and secure it against re-energization.
- 2. Measure the transmittable holding torque of the holding brake using a torque wrench. The holding torque of the brakes is specified in the data sheets.
- If the holding torque specified in the data sheets is attained, the holding brake is ready for operation.
   If the holding torque specified in the data sheets is not attained, the holding brake must be ground in as described in step 4.

#### 4. Grinding in:

Recommendation for grinding in			
Interval	1x		
Grinding-in speed	100 rpm / 30s duration		
Program	500ms, clocked		
Ambient temperature	-20°C to +50°C		

Fig. 12-3: Recommended procedure for grinding in motor holding brakes

- ⇒ If the holding torque specified in the data sheets is attained, the holding brake is ready for operation.
- ⇒ If the holding torque specified in the data sheets **is not attained**, repeat step 4 (grinding-in process).
- ⇒ If the specified holding torque is not attained after the second grinding-in process, the holding brake is not operable. Notify Bosch Rexroth Service.

#### **During operation**

If holding brakes are required only sporadically (braking cycle >48 h) during operation, film rust may develop on the brake friction surface.

To prevent the holding torque from dropping below the specified holding torque, we recommend the grinding procedure described below:

Recommendation for grinding in			
Interval	Once in 48 h		
Grinding-in speed	100 rpm		
Number of grinding-in revolutions	1		
Ambient temperature	-20°C to +50°C		

Fig. 12-4: Recommended procedure for grinding in motor holding brakes

#### Note:

The option of automatically implementing the grinding-in routine in the program run is described in the documentation of the particular drive controllers.

During normal operation, it is <u>not necessary</u> to grind in the brake. It is sufficient if the brake is activated twice a day by removing the controller enable signal.

# 12.5 Troubleshooting



### Danger of injury due to moving elements! Danger of injury due to hot surfaces!

- ⇒ Do not carry out any maintenance measures when the machine is running.
- ⇒ Switch off the control device and the machine and wait for the discharging time of the electric systems to elapse.
- ⇒ During maintenance work, secure the system against restarting and unauthorized use.
- ⇒ Do not work on hot surfaces.

Possible causes for the malfunctioning of IndraDyn A motors can be limited to the following areas:

- Motor-cooling circuit, fan function and temperature curve
- internal temperature sensor
- motor encoder or encoder connection
- mechanical damage of the motor
- · mechanical connection to machine

The encoder connection and the temperature sensor are controlled by the drive controller or control unit; corresponding diagnoses are indicated. Observe the notes in the corresponding documentation.

Some sample faults are shown below, along with potential causes. This list does not lay claim to completeness.

### **Excess Temperature of Motor Housing**

**Status** The housing temperature of the motor climbs to unusually high values.



## Damage of motor or machine by restarting after increased motor temperature!

- Liquid-cooled motors should not be restarted or supplied with cold coolant immediately after failure of the coolant system and an increased motor temperature. Danger of damage!
- ⇒ Wait until the motor temperature has dropped to approx. 40° C before restarting.

#### Possible causes

- 1. Loss or malfunction in the fan or cooling system.
- 2. Original operating cycle has been changed.
- 3. Original motor parameters have been changed.
- 4. Motor bearings worn or defective.

#### **Measures**

- With MAD, check fan function. Clean if necessary. In the case of a malfunction, contact Bosch Rexroth Service. With MAF, check the cooling system. Clean or rinse the cooling circuit if required. Contact the machine manufacturer if the coolant system malfunctions.
- 2. Check the layout of the drive for changed requirements. If overloading occurs, stop operation. Danger of damage!
- 3. Reset to the original parameters. Check the layout of the drive in the case of changed requirements.
- 4. Contact the machine manufacturer.

### High Motor Temperature Values, but Housing Temperature is Normal

### **Status**

The diagnostics system of the drive controller shows unusually high values for the winding temperature via the display or control software. However, the motor housing has a normal temperature.

### Possible causes

- 1. Wiring error or cable break in sensor cable.
- 2. Diagnostics system defective.
- 3. Winding temperature sensor malfunction (PTC).

### Measures

- 1. Check the wiring and connection of the temperature sensor according to the terminal diagram.
- 2. Check the diagnostics system on the drive device or the control unit.
- 3. Check the resistance value of the temperature sensor using a multimeter.
  - Set the measuring instrument to resistance measurement.
  - Shut down the system and wait for the discharging time to elapse.
     Separate the temperature sensor connection from the drive device and connect the wire pair with the measuring instrument (this includes the sensor cable in the test). Check values according to the characteristic curve in Fig. 9-18.



### Motor or Machine Table Generate Vibrations

Status Audible or tactile vibrations occur on the motor.

#### Possible causes

- 1. Driven machine elements are insufficiently coupled or damaged.
- 2. Motor bearings worn or defective. Available bearing lifetime or grease lifetime elapsed.
- 3. Motor mount loose.
- 4. Drive system is instable from a control point of view.

#### Countermeasures

- 1. Contact the machine manufacturer.
- 2. Contact the machine manufacturer.
- 3. Check the mechanical connection. Do not continue to use damaged parts. Contact the machine manufacturer.
- 4. Check parameters of the drive system (motor and encoder data). Observe the notes in the documentation for the drive controller.

### **Specified Position is not Attained**

#### **Status**

The positioning command of the control unit is not precisely executed, or not at all. No malfunction display on the device controller or the control.

### Possible causes

- 1. Wiring of encoder cable is incorrect or defective. Pin assignment (encoder signals) in cable or plug may be switched.
- 2. Insufficient shielding of encoder cable against interference.
- 3. Incorrect encoder parameters set in drive controller.
- 4. Motor-machine connection loose.
- 5. Encoder defective.

### Countermeasures

- 1. Check wiring according to terminal diagram and check state of cables for damage.
- Check shielding; if necessary, increase effective contact surfaces of shielding.
- 3. Correct the parameters. Observe the commissioning log.
- 4. Check the mechanical connection. Do not continue to use damaged parts. Contact the machine manufacturer.
- 5. The encoder must be replaced. Contact the machine manufacturer.

### **Waste Disposal**

### Manufacturing process

The products are manufactured such that the associated manufacturing process saves energy and raw material to an optimum extent while simultaneously permitting recycling and utilization of incidental waste.

Bosch Rexroth regularly tries to replace polluted raw materials and supplies by environmentally friendly alternatives.

#### **Application**

Bosch Rexroth products do not contain any kind of dangerous substances which could be released with proper use. Normally, negative effects on the environment must not be expected.

#### Forbidden substances

We guarantee that our products include no substances according to chemical ban regulations. Furthermore, our products are free of mercury, asbestos, PCBs and chlorinated hydrocarbons.

### **Material composition**

Basically our motors contain

- steel
- aluminum
- copper
- brass
- · magnetic materials
- Electronic components and assemblies
- Insulation material

#### Recycling

Most of the products can be recycled due to the high metal proportion. To reach optimum metal recovery, disassembly into individual components is necessary.

The metals also contain electrical and electronical components that can be recycled using special separation processes. The hereby arising plastics could be thermally recycled.

### Returns

The products manufactured by us can be returned to our premises for waste disposal at no charge. This is possible only if the product does not contain any disturbing adhesions such as oil, grease or other contamination.

Furthermore, it is not permitted that the product contains inappropriate foreign materials when it is returned.

The products must be delivered free domicile to the following address:

Bosch Rexroth AG

**Electric Drives and Controls** 

Buergermeister-Dr.-Nebel-Straße 2

97816 Lohr am Main, Germany

### **Packaging**

High-quality products need optimal packaging. The packaging material consists of paper, wood and polystyrene. They can be recycled everywhere.

For ecological reasons, a return transport of the packaging should not take place.



### 13 Motors for Hazardous Areas

### 13.1 General Information

EX motors themselves are not certified as explosion-protected components, but are only prepared as a part of an overall system. Any additionally required safety equipment as described in this chapter is to be provided by the user.

According to ATEX regulation 94/9/EC, Rexroth IndraDyn A EX motors are equipment of

- ⇒ device group II
  - device category 2G
  - device category 3G

and suitable for application in the following hazardous areas:

- ⇒ Zone 1
- ⇒ Zone 2

When delivered from the factory, operating Instructions are included with the EX motors. These operating instructions form a part of the product and must be kept by the user of motors over the entire operation and lifetime of the product. If the product is passed on or sold, these instructions must also be passed on to each new owner or user.

### Note:

The operating instructions are available in several languages. Should you not have the operating instructions in your language, contact your Bosch Rexroth sales partner before installing the motor.

You must not install or commission EX motors without having read and understood the enclosed documentation, and without having implemented the described measures.

### Device group / device category

## Device group II, device category 2G

Equipment designed to be capable of functioning in conformity with the operational parameters established by the manufacturer and ensuring a high level of protection. Equipment in this category is intended for use in areas which has to be calculated that an explosive atmosphere of dust/air mixture can occur **occasionally**. The means of protection relating to equipment in this category ensure the requisite level of protection, even in the event of frequently occurring disturbances or equipment faults which normally have to be taken into account.

## Device group II, device category 3G

Equipment designed to be capable of functioning in conformity with the operational parameters established by the manufacturer and ensuring a high level of protection. Equipment in this category is intended for use in areas in which explosive atmospheres caused by dust/air mixtures are unlikely to occur or, if they do occur, are likely to do so **only infrequently and for a short period only.** Equipment in this category ensures the requisite level of protection during normal operation.

### Zones of hazardous areas

#### Note:

The following information is based on EN 60079-14: 2003 and the BGBI: 1996 Part 1, page 1914. It is referred to this scripts for detailed information.

Hazardous areas are classified into the following zones in accordance with the probability that an explosive atmosphere is present:

#### Zone 0

... includes areas in which an explosive atmosphere which contains a mixture of air and gas, vapors and mists exists permanently, over a long period, or frequently.

Electrical equipment is only allowed for zone 0 if it complies with the specifications according to EN 50020: 1994 (self-security "i").

#### Zone 1

... comprises areas in which an explosive atmosphere of gas, vapors or mists is to be expected occasionally.

Electrical equipment is permissible for use in zone 1 if it is designed according to the requirements for zone 0 or for one of the degrees of protection described in Fig. 13-2.

#### Zone 2

... comprises areas in which the presence of an explosive atmosphere caused by gas, vapors or mists is not to be expected, or - should it still occur - in all likelihood rarely or for a short period of time.

Electrical equipment is permissible for use in zone 2 if it:

- is designed according to the requirements for zone 0 or 1;
- is specifically designed for zone 2.
- corresponds to the requirements of a recognized standard for industrial electrical equipment and has no ignitable hot surfaces when in undisturbed operation.

## Device groups, types of protection, and temperature classes

The electrical equipment for hazardous areas is classified into:

### **Device groups**

- **Group I:** Electrical equipment for mines susceptible to fire damp.
- **Group II:** Electrical equipment for paces with a potentially explosive athmosphere, other than mines susceptible to fire damp.

The electrical equipment of Group II can be further classified according to the character of the explosive atmosphere for which they are intended.

For the degree of protection pressure resistant casing "d" and intrinsic safety category "i" all electrical apparatus of Group Ii are classified in IIA, IIB and IIC (see appendix A according to EN 50014:1992).



## Classification of the gases and vapors

Explosion sub-group	Gases and vapors			
IIA	Ammonia methane ethane propane	Ethanol cyclohexane n-butane	Gasolines in general I.P. fuel n-hexane	Acetaldehyde
IIB	Town gas acrylonitrile	Ethylene ethylenoxide	Ethylene glycol hydrogen sulphide	Ethylene ether
IIC	Hydrogen	Ethine (acetylene)	Carbo-bisulphide	

Fig. 13-1: Explosion sub-group gases and vapors

For all types of protection, the equipment of Group II must be labeled in accordance with their maximum surface temperature as shown in Fig. 13-3.

### Types of protection

The electrical equipment is designed according to the type of protection. The requirements are stipulated in special standards.

Type of protection	Designation	Standard (predecessor)	
Pressure-resistant casing	EEx d	EN 60079-1 (EN 50018)	
Increased safety	EEx e	EN 60079-7 (EN 50019)	
Intrinsic safety	EEx i	EN 60079-11 (EN 50020)	
Pressurizing	EEx p	EN 60079-2 (EN 50016)	
Encapsulation	EEx m	EN 60079-18 (EN 50028)	
Oil immersion	EEx o	EN 60079-6 (EN 50015)	
Powder filling	EEx q	EN 60079-5 (EN 50017)	
Degree of protection 'n'	EEx n	EN 60079-15 (EN 50021)	

Fig. 13-2: Degree of protection

Electrical equipment of these degree of protection are certified by way of a prototype test by a neutral body.

### **Temperature classes**

Electrical equipment of group II must be labeled according to EN 60079-0:2004, chapter 5.3.2.2, and either

- classified (preferably) in a temperature class in compliance with Fig. 13-3, or
- labeled with the respective maximum surface temperature, or
- if applicable, restricted to the action of a specific gas for which the equipment is intended.

Temperature class	Maximum surface temperature [°C]
T1	450
T2	300
T3	200
T4	135
T5	100
T6	85

Fig. 13-3: Classification of the maximum surface temperature in classes for electrical equipment of Group II

### 13.2 Appropriate Use

#### Note:

IndraDyn A EX motors themselves are not certified as explosion-protected devices, but are only prepared for acceptance as a part of an overall system. Please also observe the notes in Chapter 13.6 "Additional Components".

Necessary safety equipment is to be prepared by the user.

### Range of application

The motors described here (components for Group II, Category 2G, ATEX guideline 94/9/EG, Appendix II, Section 2.2.1) may only be used in an environment in which

- no explosive atmosphere due to gases, vapors or mist/fog is likely to develop, or
- an explosive atmosphere due to gases, vapors or mist/fog can occasionally occur.

The system and the components must thus be designed and manufactured by the user in such a manner that sources of ignition are avoided assuming that device malfunctions occur frequently and that operating states occur that are usually unexpected.

### 13.3 Conditions for Application



### Danger of explosion!

- ⇒ To ensure protection from explosion, only use scavenging devices with an ATEX protection type suitable for the motor, or higher.
- ⇒ The values indicated on the identification label (Fig. 13-5), for example for scavenging volume, scavenging gas, initial pressure, excess pressure etc. must be ensured and monitored by the scavenging device.

### **Connection specifications**

The motors may only be operated with Bosch Rexroth drive control devices of the IndraDrive series. Control devices from other manufacturers are not permitted. The connector terminals in the terminal box must be screwed on tightly. Do not disconnect or connect connectors when they are energized due to the danger of sparking within hazardous areas!

### Grounding

Speed-controlled drive systems contain unavoidable discharge currents above ground. For this reason the motors have to be grounded over the motor cable and over a separate ground wire with min. 4mm² cross-section, as specified in the connection diagram. Check that the position of the grounded conductor is fixed before commissioning.

If the grounded connector in the motor cable and the second separate grounded connector on the motor housing are not connected or are interrupted by corrosion or other defects during their lifetime, the discharge current flows (as leakage current) over conducting housing parts. This must be prevented using the measures mentioned above (ATEX guideline 94/9/EG, Appendix II, Chapters 1.2.3, 1.3.3, and 1.4).

### Danger of corrosion

Corrosion of the motor housing due to aggressive substances (such as certain coolants, lubricants, cutting oils or salt mists) is to be prevented.

#### **Emergency stop**

Energies stored in the drive device must be discharged or isolated as quickly as possible when the **emergency-stop device** is pressed so that the risk that the danger zone is affected during a malfunction is reduced (ATEX guideline 94/9/EG, Appendix II, section 1.6.2)

There are for example the following options:

- · discharge of the energies via an intermediate circuit short-circuit
- disconnect the power to the cables and motors before the transition to the area subject to explosions in order to isolate the energies from the area subject to explosions.

### Other environmental influences

Heed the following regarding dangers caused by other disturbances:

- Operation only inside the specified ambient conditions,
- · Maximum vibration and impact loads
- Protect the ground conductor connection from dirt, corrosion, humidity and/or aggressive substances, ...
- ..

### **Internal Motor Brake (optional)**

In **normal operation**, use the brake located within the motor only when at a standstill and when performing the drive-internal brake check. In these cases, only low temperatures (<100° C) occur and no sparks are generated because critical grinding of the brake linings does not occur.

### **Brake control**

The brake's control mechanism must ensure this function in normal operation. Under the least favorable installation conditions for the power supply cables to the brake and under the least favorable load condition for the power supply, a supply voltage of 24 V +/- 10% must be supplied to the motor. If a voltage divergence occurs due to a failure during operation, this failure must be identified and corrected immediately. The failure can be identified, for example, using a monitoring device for undervoltage.

### Malfunctions

Only during a **malfunction**, i.e. in the case of a fault in the system, may the brake be activated when the motor is turning to, for example, prevent dangerous dropping of vertical axes. In this case, sparks may be generated in the brake and increased temperatures may occur within the motor. When a malfunction occurs, the operator must eliminate it immediately.

### **Functional test**

Before commissioning and in operation in periodic intervals (e.g. every 8 hours), the functioning of the brake is to be checked with an appropriate braking test. By applying a defined amount of motor torque, the brake is tested for slippage. For certain drive control devices, it is possible to carry out an integrated brake test using the Brake Monitor command. Further information can be found in the respective firmware operation manual for the drive control device.

### 13.4 Residual Risks

Failure of the protective equipment

If the scavenging device and the monitor for maintaining the protective measures fail simultaneously, explosion protection in a hazardous area is no longer ensured and a danger of explosion exists.

Overloading

When the motor is overloaded, including the case where errors in the mechanical or electrical equipment of the machine occur, high temperatures that result in the danger of explosions can occur.

Grounding and discharge currents

Variable-speed drive systems cause unavoidable discharge currents. If the grounded connector in the motor cable and the second separate grounded connector on the motor housing are not connected as specified or are interrupted by corrosion or other defects during their lifetime, the discharge current flows (as leakage current) over conducting housing parts, resulting in the dangers of sparking at joints and, if explosive materials are present, explosions. Therefore, check the proper conditions of both grounded conductors in regular intervals.

Material aging

The periods of action and penetration of explosive materials depend on the application. They depend on the aging of the seals, the mechanical design of the motor, the characteristics of the explosive materials and the average temperature that occurs during the operating time as a consequence of the load cycles.

### 13.5 Selection and Labeling of Ex-Motors

Selection of the motors

If an Ex version of a motor is required, the motor must be selected and ordered on the basis of a predefined encoder type in the respective motor type code.

Ex motors are defined by way of selecting the encoder option

- M6
- S6

in the motor type code.

Accordingly, the figure **6** on the 18<sup>th</sup> position of the type code signifies an explosion-protected motor. This applies to the following motors:

- MAD1 ....-...-...6-....
- MAF1aaa-aaa-a6-aaa-aa-aa

Labeling

IndraDyn A motors in EX design have an additional label that is located on the side of the motor housing, next to the motor type label. It shows:

- the classification of the motor according to ATEX
- important details for adjusting the motor scavenging device.

Fig. 13-4: Motor type label (example: MAD-motor)

## Additional designation label on the EX motor

### Bosch Rexroth Electric Drives and Controlls GmbH

 $\langle \mathbf{\xi_X} \rangle$  II 2G EEx pd IIB T3 TPS 05 ATEX 57401 1

Spülvolumen: 5 Liter

zu verwendendes Spülgas: Instrumentenluft

Technik: Ausgleich der Leckverluste

Minimaler Vordruck (Spülgas): 2 bar Überdruck Minimale Vorspülzeit: 2 bar Überdruck 1 Minute pro Motor

Minimaler Überdruck: 1 mbar

Maximaler Überdruck: 23 mbar

Maximale Leckverluste: 10 Liter / min

Max. Umgebungstemperatur: 0°C bis +40°C

Typenschild2\_ATEX.EPS

CE: CE symbol

d:

0102: code number of the test authority

Ex: ATEX symbol

II: Device Group II, which is suitable for all hazardous areas

except mines susceptible to firedamp

2G: Device Category 2: the device is suitable only for explosion-

endangered atmospheres that are caused by gas that can

occur occasionally

EEx: the European standard for explosion protection has been

applied

p: ignition protection class p means that an explosion-endangered

atmosphere is kept away from the ignition source (EN 50016) ignition protection class d means that an explosion cannot

be transferred to the outside (EN 50018)

IIB: Explosion sub-group of certain gases and vapors

T3: the max. permitted surface temperature (inside and outside of

the housing) is 155° C

TPS\*\*\*: motor registration number

Fig. 13-5: Type label of EX motors

### 13.6 Additional Components

To operate a motor as part of an overall system within an explosion-protected area, further components are necessary. Not all required components are in the scope of delivery of Bosch Rexroth. Components that are not available from Bosch Rexroth are signified as additional components and have to be ordered by the manufacturer of the system.

An overall system mainly consists of:

- 1. Bosch Rexroth components
  - MAD or MAF EX motors
  - IndraDrive motor drive
  - connection cable
- 2. Additional components of other manufacturers to be provided
  - Scavenging equipment and monitoring unit with connection hoses, accepted as an overall system and certified for the required protection class.
  - For MAF motors: External cooling system (liquid cooling) For specification refer to the motor project planning manual
  - For MAD motors: External cooling system (fan) For specification refer to motor project planning manual and the following notes.

### **Motor Fan**

Cool the MAD motors for explosion-protected areas during operation with a forced ventilation. We recommend using a radial fan, which must be mounted outside of the hazardous area (see Fig. 13-13). Mounting a fan directly on the motor is not permitted within hazardous areas. Observe the information in the project planning manual regarding motor cooling when calculating and selecting a suitable motor fan.

Note:

Fans, an air hose and the small parts required for connection (hose clamps, etc.) do not belong to the Bosch Rexroth scope of delivery.

### **EEx p Control Device for Motor Scavenging**

The IndraDyn A motor with the explosion-protection design is merely a part of a drive system which provides explosion protection only in combination with an EEx p control device for motor scavenging.



### WARNING

# Danger of explosion! Danger to life and high material damage by improper handling!

⇒ The motor within hazardous areas may only be commissioned as an overall system with a control device for motor scavenging. The control device must be classified and certified according to a protection class that is the same as or higher than that of the motor.

Note:

The control device, which is required to safely operate the motor in an area subject to explosions, does not belong to the Bosch Rexroth scope of delivery and must be provided by the user.

Certification of the motors according to the ignition protection class

- EEx d (encoder housing)
- EEx p (motor housing)

according to EN 50018:2001 and EN 50016:2003 was made using a control device of type 07-3711-2213/1002, manufactured by

⇒ **BARTEC GmbH**Tel. +49 (0)7931 597-0

Max-Eyth-Str. 16

97980 Bad Mergentheim, Germany Email info@bartec.de

PO Box 1166 97961 Bad Mergentheim, Germany

Observe the notes of the manufacturer when selecting and commissioning the control device when designing the drive system.

### **Connection cable**

Thermal stability

Use cables with a thermal stability of at least 80°C (176°F) to operate the motor in hazardous areas.

Bosch Rexroth provides suitable ready-made connection cables for the motors. They are checked on conformity with the ATEX guidelines and relevant DIN and EN standards. When selecting cables, use the following documentation: **DOK-CONNEC-CABLE-\*STAND-AUxx-EN-P** (MNR R911282688).

### 13.7 Mechanical Attachment

### Preparation

Before installing the motor, check whether the required information is present on the type label of the motor, such as the

- · device group and device category,
- explosion subgroup,
- maximum permitted surface temperature,


correspond to the local permitted conditions for use in hazardous areas.

Check the components for visible damage. Defective components may not be mounted.

Before installation, ensure that the environmental conditions at the location of use, such as the ambient temperature, the humidity, the vibration, and shock stresses do not exceed the details in the project planning manual of the motor.

### Mounting

IndraDyn A motors are manufactured either for flange assembly (design 05) or for foot assembly (design 35). You can find details regarding the fastening holes in the motor dimension sheet in the project planning manual. For fastening, the following general assignment applies:

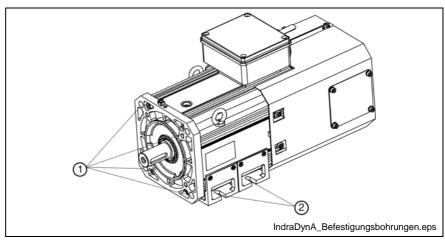

(1): Holes for flange assembly

(2): Assembly feet (on both sides) for foot assembly

Fig. 13-6: Motor mounting holes

	B05 (flange assembly)			B35 (Foot assembly)		
	Hole	Thread 1)		Hole	Thre	ad <sup>1)</sup>
MAD/MAF	Ø [mm]	Туре	M <sub>GA</sub> [Nm]	Ø [mm]	Туре	M <sub>GA</sub> [Nm]
100	14	M12	87	11	M10	51
130				12	M10	51
160	18	M16	215	14	M12	0.7
180				14,5	IVIIZ	87

<sup>1)</sup> Recommended torques for bolts of fastening class 8.8 class 8.8.  $M_{GA}$  = Torque given in Newton meters.

Fig. 13-7: Mounting holes

### Notes: Avoid...

- pinching or jamming the centering (pilot) diameter on the shaft side of the motor installation.
- damaging the insertion fitting on the system side.

Check the fit and precision of the connection before carrying out the electrical connection.

### 13.8 Connection Techniques



## Danger of explosion due to improper handling when connecting the motor!

- Ensure that the power is off and that the motor is connected only in an atmosphere that is not capable of explosions.
- ⇒ Before working on the system, always use a suitable measuring instrument (e.g. multimeter) to check whether parts are still under a residual voltage (e.g. due to the residual energies of capacitors in filters, drive devices, etc.); let their discharge times elapse.
- ⇒ The connection between the ground-reference lug and the grounding conductor must be made before any other connections.
- ⇒ In particular, heed a sorted and de-energized laying of the connection cables within the terminal box to avoid abrasion or pressure marks on the cables.
- ⇒ The connection points to or on the control device must be located outside of the hazardous area.
- ⇒ The motors may be operated only with Rexroth IndraDrive drive control devices. Control devices from other manufacturers are not permitted.

The motors have to be grounded over the motor cable and over a separate grounding wire (potential equalization) with min 4 mm<sup>2</sup> cross-section (see Fig. 13-10).

The power connection is located on the top and is provided only as a terminal box in the case of explosion-protected motors.


The following connections must be made to ensure safe operation of the motors:

- power connection (incl. temperature sensor and holding brake)
- Encoder Connection
- equipotential bonding conductor connection (according to EN 50014:2000, Chapter 15)
- Coolant Connection
- Connection of the scavenging device with safety control.

### **Power Connection**

Proceed as follows to connect the power cable in the terminal box of the motor:

1. Unscrew and remove the 4 fastening bolts on the lid (1) of the terminal box and open the lid.

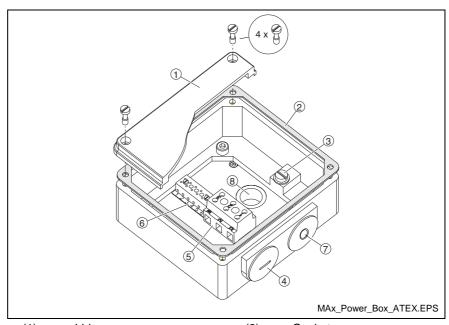

Lid (1): (2): Gasket PE connection (3): (4): Cable entry U-V-W power connection Terminal strip (5): (6): (7): Scavenging hole (8): Through hole

Fig. 13-8: Terminal box

- 2. Remove the screw plug (4) of the metric screw on the side of the terminal box and guide the power cable through this opening and into the terminal box. Attach the power cable to the terminal box. Use the cable gland located on the power cable. Connect the wires of the power cables with the appropriate junction within the terminal box. The wires are arranged according to Fig. 13-10.MAx\_Power\_Connect\_ATEX\_EN.EPS
- 3. Screw down the connections of the wires with the wire end ferrules sufficiently tight. The connections of the wires with the ring cable lugs must be tightened with the following tightening torques:

Thread	M6	M8	M10
Tightening torque	4 Nm	9 Nm	18 Nm

Fig. 13-9: Tightening torque for power connection

4. Fasten the lid (1) of the terminal box using all 4 fastening bolts secured with Loctite 243. Before tightening the bolts, make sure that the gasket (2) between the lid and the terminal box housing is correctly positioned.

### Notes:

- The brake connections are assigned only if the motor was manufactured with the "brake" option.
- Only one of the PTC thermistor connector pairs (3-4 or 5-6) in the motor cable should be connected to the motor; the other one pairs serves a spare.
- Do not remove or damage the gasket located in the lid.
- Observe the size of the screwed cable connection and connection thread for the cable inlet into the terminal box.
- The connections of the motor-windings in the terminal box must not be removed.
- The through hole (8) in the motor housing may not be closed or sealed off.

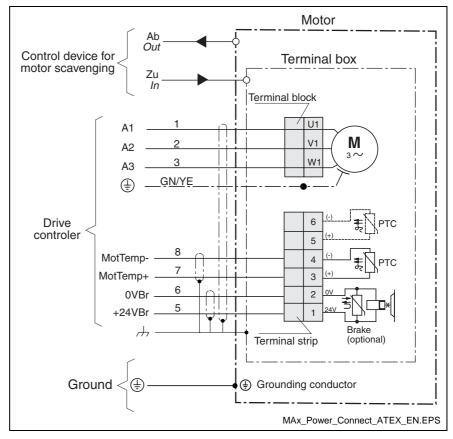


Fig. 13-10: Connection diagram for explosion-protected areas

### **Encoder Connection**

A 15 meter-long connection cable is connected with the explosion-protected motors. This connection cable has been connected with the encoder at the factory. After motor assembly, this cable must be connected with the drive device.



## Danger of explosion due to improper handling when connecting the encoder!

⇒ The junction to/on the motor drive device must be located outside of the area subject to explosions.

**Notes:** Observe the following when connecting the encoder:

- The encoder housing on the motor may no longer be opened! Do not remove any of the screws on the encoder housing. The connection cable has already been connected with the motor encoder at the factory.
- Work may be carried out only if the electrical system is not under power.
- Heed the information on projecting planning in respect of the drive device, and the information on connector assignment in chapter 8.7 "Encoder Connection".


### **Grounding Conductor**



## Danger of explosion due to improper handling when connecting the motor!

⇒ The ground conductor on the motor must be additionally connected to the protective conductor with a separate cable with 4 mm² cross-section.

The motors for areas subject to explosions have an additional ground lug on the motor flange for this purpose. Use the grounding cable to connect the ground-reference lug of the motor with the ground reference of the machine or system and tighten the screw connection.

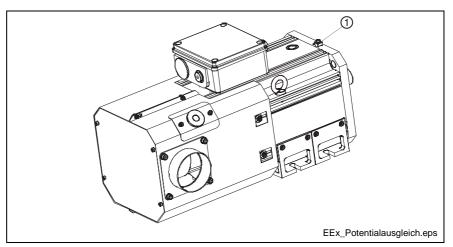

(1): Terminal for grounding conductor

Fig. 13-11: Grounding conductor

Protective conductor terminal on motor size	Nominal cross-section	Terminal area
100130	4 mm²	4 mm² (finely stranded) 6 mm² (single-wire)
160180	10 mm²	10 mm² (finely stranded) 10 mm² (single-wire)

Fig. 13-12: Terminal for grounding conductor


### **Coolant Connection to MAD Motors**

MAD motors with explosion-protection design are prepared with a fan cowl for operation with an external fan.

Note:

The required fan and corresponding connection materials (air hose, connection clamps, etc.) do not belong to the scope of delivery of the motor; these must be provided by the machine manufacturer.

MAD motors may be operated only if the fan provides the specified minimum amount of air flow on the motor side. Therefore, when selecting radial fans or central ventilation systems, already take the installed hose or air duct length, as well as the air baffles, into account. Please also observe the notes in Chapter 9.8 "Motor Cooling".

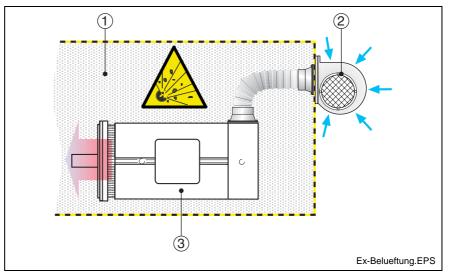

- (1): Explosion-endangered area
- (2): Radial fan (not included in scope of delivery)
- (3): MAD motor in EX version

Fig. 13-13: Fan connection in the explosion-protected area

### **Coolant Connection to MAF Motors**

Regarding the coolant connection to MAF motors, please heed the information in chapter 8, Connection Techniques.

### **Purging Connections**

The connection of an EX motor with an EEx p control device has to be done with a pipe or a tube with a maximum internal diameter of 8 mm.


If plastic pipes are used, the maximum outer diameter is 13 mm.



## Possible electrostatic discharge from plastic pipes!

⇒ Use only plastic pipes that are certified for use in explosion-protected areas.

Connect the pneumatic purging gas lines by heeding the **maximum permitted bending cycles** according to Fig. 13-14.

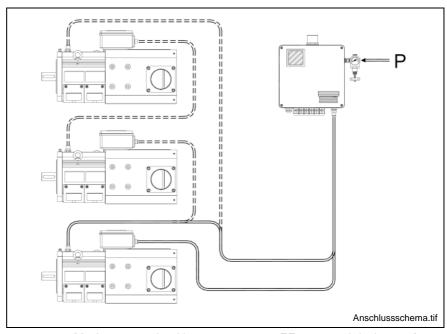

p: Maximum permitted input pressure on EEx p control device = **3 bar** 

Fig. 13-14: Purging gas connection layout

**Note:** To operate more than one motor with a control device, apply them in a row when connecting the scavenging lines (Fig. 13-14).


The motor scavenging lines are screwed directly to the corresponding connecting threads. The connecting threads have been covered with protective caps at the factory. Remove the protective caps just before assembly.

Motor size MAD/MAF	Connecting threads for scavenging gas	
100 180	G1/4"	

Fig. 13-15: Connection thread of the scavenging holes

When connecting the scavenging lines, pay attention to the specified flow directions:

- inflow (IN) via scavenging hole on terminal box.
- outflow (OUT) via scavenging hole on motor housing.

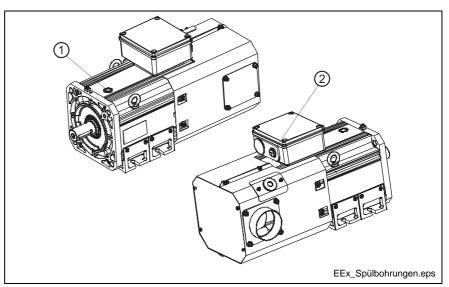

- (1): Scavenging hole on motor housing (OUT)
- (2): Scavenging hole on terminal box (IN)

Fig. 13-16: Connection for scavenging gas at EX motors

### Connection of scavenging gas lines

Proceed as follows to connect the scavenging gas lines:

- 1. Remove the protective caps on both scavenging holes.
- 2. Fasten the scavenging lines in the appropriate connection threads on the motor.
  - When connecting the scavenging lines, pay attention to the correct flow direction.
- 3. Firmly tighten the connection.

### Scavenging gas

Only inert gas or cleaned and dried industrial air is permitted to be used as scavenging gas. In any case, a filter must be installed upstream if the quality in terms of foreign particles cannot be ensured.

Note:

Also observe the manufacturer's information regarding the assembly and commissioning of the control device.

### 13.9 Commissioning



## Danger of explosion due to failure to accept the overall system!

- ⇒ Taking the correspondent national regulations into account, EX motors may be commissioned only by a skilled electrician.
- ⇒ Commissioning in explosion-protected areas is prohibited until it has been ascertained that the overall system corresponds to the demands and certification conditions for explosion protection.
- ⇒ After repairs and disassembly in the course of the maintenance of safety-relevant motor parts, the motor must be tested individually again according to EN 50014:1997 (section 26) and EN 50016 if the explosion-protection characteristics were changed due to the repairs or disassembly.





# Material damage due to errors in the controls of motors and moving elements! Unclear operating states and product data!

- Do not carry out commissioning if connections, operating states or product data are unclear or faulty!
- ⇒ Do not carry out commissioning if the safety and monitoring equipment of the system is damaged or not in operation.
- ⇒ Check the holding brake (option) functions before commissioning.
- ⇒ Contact Bosch Rexroth for missing information or support during commissioning!

### Purging time of the overall system

A specified preliminary purging time of the overall system must be maintained each time the motors are started. The purging time can be determined according to the following information:

## Determination of the purging time

- 60 seconds purging time per connected motor
- 30 seconds purging time per each 10 m of connection hose.

### **Example:**

Connected motors: 2		Purging time
2	x 60 seconds	120 sec.
Length of the scavenging gas lines 14 m		Purging time
2	x 30 seconds	60 sec.
Minimum purging time to be set	180 sec.	

Fig. 13-17: Example for calculation of the purging time of the overall system

### Pressure switching values to be

The BARTEC type 07-3711-2213/1002 has been preset at the factory. This preset can be used to operate a drive system consisting of

- up to 5 motors with
- up to 20 m purging gas lines

Are devices of other manufacturers used, the following pressure switching values are checked on location. The operator must ensure that the pressure switching values are checked on location.

Description	Pressure switching value
DIFF A / DIFF B (flow rate on pressure control device)	2.0 mbar
Min A / MIN B (minimum internal housing pressure, deactivation-value)	1.0 mbar
MIN P (freely selectable preliminary alarm)	2.0 mbar
DP 1 (minimum or command operating pressure)	2.5 mbar
MAX (maximum internal housing pressure)	23.0 mbar
MAX 1 (maximum purging pressure)	20.0 mbar

Fig. 13-18: Pressure switching values



### **Preparation**

- 1. Keep the documentation of all applied products ready.
- 2. Check the products for damage.
- 3. Check all mechanical and electrical connections (incl. the grounding conductor!).
- 4. Activate the safety and monitoring equipment of the system.

### **Execution**

When all prerequisites have been fulfilled, proceed as follows:

- Activate the fan for the MAD motor or the external cooling system to supply the MAF motor. Check the function.
- 2. Check the motor scavenging settings at the control device. Refer to the type label at the motor housing to see the values to be set e.g. for minimum purging times or excess pressure (Fig. 13-5).

**Note:** The pressurized system must only be operated with the setting values specified on the type label.

Activate the control device of the motor purging.
 Check the function.

Check the values shown on the type label on the motor such as the purging volume, the scavenging gas, the purging time, etc. These values must be reached and maintained. Heed the details of the manufacturer of the control device.

- 4. Carry out the commissioning of the drive system according to the instructions of the corresponding product documentation. You can find the respective information in the functional description of the drive-devices.
- 5. Log all measures taken in the commissioning log.

Commissioning of drive controllers and the control unit may require additional steps. The inspection of the functioning and performance of the systems is not discussed in these operating instructions; instead, it is carried out within the framework of the commissioning of the machine as a whole. Observe the information and regulations of the machine manufacturer.

### 13.10 Dismantling



# Danger of explosion! Fatal injury due to errors in activating motors and working on moving elements!

- ⇒ Do not work on unsecured and operating machines.
- ⇒ Before touching the motor, let it cool sufficiently after switching it off. A cooling time up to 140 minutes can be necessary!
- ⇒ Ensure that the power is off and that the motor is disconnected only in an atmosphere that is not capable of explosions.
- ⇒ Before working on the system, always use a suitable measuring instrument (e.g. multimeter) to check whether parts are still under a residual voltage (e.g. due to the residual energies of capacitors in filters, drive devices, etc.); let their discharge times elapse.
- ⇒ Secure the machine against accidental movements and against unauthorized operation.
- ⇒ Before dismantling, secure the motor and power supply against falling or movement before disconnecting the mechanical connections.

## In the case of malfunctions, maintenance or deactivation of the motors, proceed as follows:

- 1. Use the control commands to bring the drive to a controlled standstill.
- 2. Switch off the power and control voltage of the drive device.
- Only for MAD: Switch off the motor protection switch for the motor fan

**Only for MAF**: Switch off of the power supply of the external cooling system.

- 4. Switch off the control device for the motor purging system (observe the notes of the manufacturers regarding deactivation).
- 5. Switch off the main switch of the machine.
- 6. Secure the machine against accidental movements and against unauthorized operation.
- 7. Wait for the cooldown times of the motor and the discharge time of the electrical systems to elapse.
- 8. Disconnect all electrical connections. Disconnect the scavenging lines from the motor at the connection threads
- 9. Before dismantling, secure the motor and power supply against falling or movement before disconnecting the mechanical connections.
- 10. Dismantle the motor from the machine. At the MAF motor, also empty the coolant channels.
- 11. Log all measures taken in the commissioning log.



### 13.11 Maintenance / Repairs

Increase availability with regular preventive maintenance measures. Notice the information in the maintenance schedule of the machine manufacturer and the following details regarding maintenance measures and intervals for the motor.



### Danger of explosion! Death by electrocution possible due to live parts with more than 50V!

- ⇒ Working on parts that are under power while the danger of explosions exists is strictly prohibited.
- ⇒ Before starting work that has to be carried out, observe the important safety regulations according to DIN VDE 530, such as releasing the power; securing against restarting; ensuring that the system is not under power; grounding and short-circuiting; and covering or fencing off neighboring parts that are under power.
- ⇒ Ensure that the measures mentioned above cannot be repealed before the work is completed.

### Maintenance

Measure	Interval
Only for MAF: Check the functioning of the coolant system	According to the guidelines in the machine maintenance plan, but at least every 1,000 operating hours.
Only for MAD: Check the functioning of the fan and the air circulation.	According to the guidelines in the machine maintenance plan, but at least every 1,000 operating hours.
Check the mechanical and electrical connections.	According to the guidelines in the machine maintenance plan, but at least every 1,000 operating hours.
Check the air hoses of the motor purging device for correct positioning and leaks	According to the guidelines in the machine maintenance plan, but at least every 1,000 operating hours.  Note: If the control device issues an error message regarding a loss of pressure in the excess pressure capsule, this can indicate that the shaft sealing ring is worn.
Check the machine for smooth running, vibrations and bearing noises.	According to the guidelines in the machine maintenance plan, but at least every 1,000 operating hours.
Remove dust, chips and other dirt from the motor housing, cooling fins and the connections.	Depending on the degree of soiling, but after one operating year at the latest.

Fig. 13-19: Maintenance measures

### Repairs



### Danger of explosion due to improper repairs!

- ⇒ Repairs on EX motors may only be carried out by Bosch Rexroth or an authorized workshop.
- ⇒ If Rexroth EX motors are repaired, modified or retrofitted in a workshop other than at Bosch Rexroth Electric Drives and Control GmbH, IEC 20034-1 dictates that an additional label is to be attached to the motor after every repair of modification indicating the name of the workshop or of the repairman, the year of the repair and the modifications made.
- ⇒ After repairs and disassembly in the course of the maintenance of safety-relevant motor parts, the motor must be tested individually again according to EN 50014:1997 (section 26) and EN 50016 if the explosion-protection characteristics were changed due to the repairs or disassembly.

Defective EX motors must be sent back to the place of manufacture or to a Bosch Rexroth authorized workshop for EX motors for repairs such as

- Replacing the motor encoder
- Replacing the radial shaft sealing ring
- ..

In no case may they be dismantled or repaired by a workshop not authorized by Bosch Rexroth.



### 13.12 Declaration of Conformity

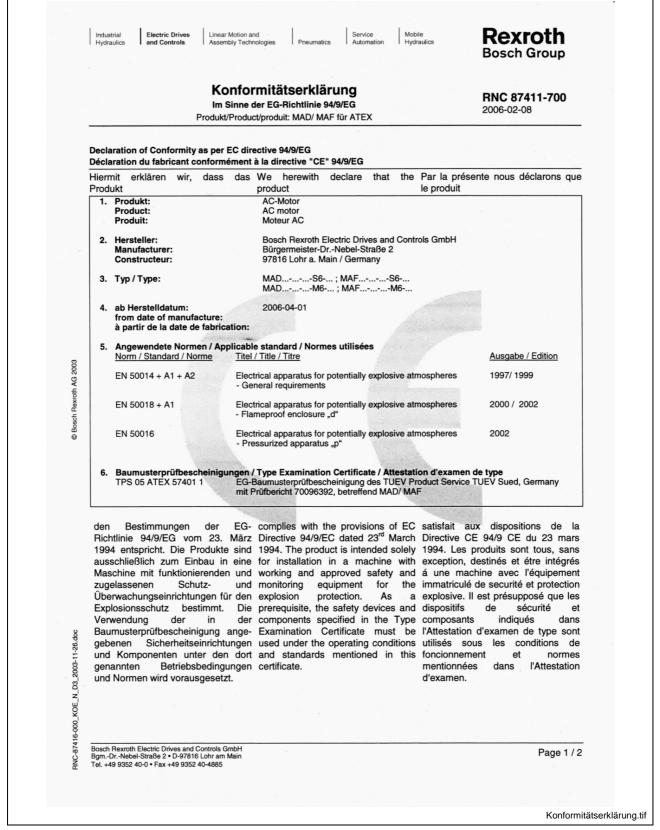


Fig. 13-20: Declaration of conformity (1/2)

MAD/ MAF für ATEX, Konformitätserklärung

Page 2/2 RNC 87411-700: 2006-02-08

den Explosionsschutz erforderlich, in protection included is required. The nécessaire. geprüft wurden.

Richtlinie entspricht.

overall system.

EC Directive.

Für das Gesamtsystem ist eine The approval of the overall system La certification du système entier Zulassung einschließlich der Schutz- with the safety and monitoring avec l'équipement de securité et und Überwachungseinrichtungen für equipment for the explosion protection explosive compris est L'observation des der die Anforderungen der Normen requirements of the standards must exigences normatives dans le auf Einhaltung im Gesamtsystem be approved for compliance in the système entier doit avoir été vérifiée.

Die Inbetriebnahme des Produktes It is prohibited to put the product into La mise en service du produit est ist solange untersagt, bis festgestellt operation until it has been proscrite tant qu'il n'a pas été wurde, dass die Maschine, in die established that the machine in constaté que la machine dans das Produkt eingebaut werden soll, which the product is to be installed laquelle ce produit doit étre monté, den Bestimmungen der EG- complies with the provisions of the répond aux dispositions de la

### Erläuterungen:

Einhaltung der die IDYN\*A\*ATEX-IB02-D5-..) ange- P). geben werden, durch den Anwender voraus.

#### **Explanations:**

bestimmungsgemässe For the product to be used as L'utilisation correcte du produit, Gebrauch des Produktes setzt die intended the user must comply with c'est-á-dire en conformité avec sa Benutzungs- the provisions of use and conditions destination, présuppose le respect bestimmungen und Anwendungs- of application laid down in the par son utilisateur des prescriptions in der documentation "MAD/ MAF motors d'utilisation Dokumentation "MAD/ MAF Motoren for hazardous areas in accordance d'application stipulées für explosionsgefährdete Bereiche with ATEX - Project Planning documentation "MAD/ MAF Moteurs nach ATEX – Betriebsanleitung" Manual" (documentation type DOK- pour atmosphéres (Dokumentationstyp DOK-MOTOR\*- MOTOR\*-IDYN\*A\*ATEX-IB02-D5- suivant ATEX – Guii.

#### Explications:

et dans la suivant ATEX - Guide de projet" (Type de documentation DOK-MOTOR\*-IDYN\*A\*ATEX-IB02-D5-

Der Motor hat die folgende The motor has the following Le moteur a la caractérisation Kennzeichnung:

markings:

CE (Ex) II 2 G EEx p d IIB T3

CE (Ex) II 2 G EEx p d IIB T3 X

CE(Ex) II 2 G EEx p d IIB T3 X

Lohr a. Main , den Ort/place/lieu

2006-02-17 Datum/date

ael Steinbrecher Qualitäts-Management/ Head of Quality Management/

Norbert Neller Produktsicherheitsbeauftragter. Product Safety Supervisor/ Responsable Sécurité des Produits

Änderungen im Inhalt der Konformitätserklärung sind vorbehalten. Derzeit gültige Ausgabe auf Anfrage. We reserve the right to make changes in the conformity declaration. Presently applicable edition can be obtained upon request.

Le fabricant se réserve le droit de modifier le contenu de la déclaration de conformité. Edition actuellement en vigueur sur demande.

Konformitätserklärung2.tif

Fig. 13-21: Declaration of conformity (2/2)

Rexroth IndraDyn A Index 14-1

### 14 Index

### Α Accessories 7-1 Accessory Gearboxes 7-4 Labyrinth seal 7-1 Additional components ATEX motors 13-8 Air humidity 9-2 Ambient temperature 9-1 Application notes 9-1 Appropriate use Introduction 2-1 Uses 2-2 Assembly 11-3 Attachment of ATEX motors 13-9 В Balancing 9-22 Bearing 6-3, 9-25 Bearing for coupling connection 9-38 high-speed bearing 9-38 Reinforced bearing 9-37 Standard bearing 9-37 Wear 9-32 Bearing failure 9-32 Bearings variants 9-37 Brake 13-5 Brake torque 9-17 C Clamp 9-17 Cleaning 9-4, 9-9 Commissioning 12-1 Commissioning ATEX motors 13-17 Compatibility 9-3 Conditions for applications for ATEX motors 13-4 Conditions for use 9-1 Connection of ATEX motors 13-11 Connection of scavenging holes 13-17 Connection techniques 8-1 Bayonet connection 8-4 Brake 8-12 coolant inflow 8-13 coolant outflow 8-13 Cooling connecting thread 8-13 Flange socket 8-4 operating pressure 8-15 Plug 8-4 Power connection 8-2 Connection Techniques Clamp designation 8-7 Connection technology Encoder connection 8-9 Poles 8-11 Snap-on coupling 8-14 Terminal board 8-5 Terminal strip 8-5 Continuous current at standstill 4-4

continuous torque at standstill 4-4

Coolant supply 12-4 Corrosion 10-3 Couplings 9-30 Cycle time 4-3



Cylindrical roller bearing 9-37

### D

Data sheet MAD100 4-5 Data sheet MAD130 4-17 Data sheet MAD160 4-29 Data sheet MAD180 4-35 Data sheet MAD225 4-41 Data sheet MAF100 4-43 Data sheet MAF130 4-55 Data sheet MAF160 4-67 Data sheet MAF180 4-73 Data sheet MAF225 4-79 Deactivation 12-2 Declaration of conformity for ATEX motors 13-23 Deep-groove ball bearing 9-37 De-rating 4-4 Device groups 13-2 Discharge capacity 4-2 Discharge time 13-20 Dismantling 12-2

### Ε

Electrical Connection 11-4
Encoder 9-19
Compatibility 9-19
Connection 9-21
Incremental 9-19
Interface 9-19
Multiturn 9-19
Precision 9-20
Singleturn 9-19

### F

Fan Minimum distance 9-9
Fan housing 10-3
Fastening 11-2
Feedback see Encoder
Fit 11-3, 13-10
Flange assembly 11-2, 13-10
Flow directions 13-16
Foot assembly 11-2, 13-10
Frame shape 9-5

### G

Grease service life 9-32, 9-37 Groove length 9-22 Ground terminal 10-1

### Н

Handling 10-1
Hazardous areas 13-2
High-voltage test, *also see* Inspection 10-1
Holding brake 6-3, 13-5
Clamping delay 9-17
electrically releasing 9-17
electrically clamping 9-17
grinding in 12-5
Maintenance 12-5
Note regarding danger 9-16
Housing painting 9-8

Rexroth IndraDyn A Index 14-3

### I

Identification 10-2
Imbalance 9-22
Inappropriate use 2-2
Consequences, Discharge of liability 2-1
Inspection
High-voltage inspection 10-1
Inspection at factory 10-1
Inspection by customer 10-1
Installation 11-1
Installation position 9-5
Output shaft pointing up 9-6
Insulation resistance 10-1
Introduction to the product 1-1

### Κ

key 6-3 Key 9-21 Key, graduated 9-22 keyway 6-3 Keyway 9-21

### L

Labeling of ATEX motors 13-7 Labyrinth seal 9-23

### M

MAD100 Dimension sheet 5-1 Maintenance 12-2 Mass 4-3 Maximum current 4-2 Maximum output 4-2 Maximum speed 4-2, 4-4 Maximum torque 4-2 Mean speed 9-26, 9-32 Motor bearing, also see Bearing 9-25 Motor coolant Coolant temperature 9-12 Motor cooling 9-9 coolants 9-10 Fan 9-8 Motor cooling 7-5 Motor cooling system 9-8 Motor encoder 6-2 Motor Encoder, also see Encoder 9-19 Motor fan 12-4

### N

Name plate 10-2 Number of pole pairs 4-3

### 0

ON time 4-1 Operating modes 4-1 Operation 12-1 Output shaft 6-2, 9-21

### P

Plain shaft 9-21 Power flange socket see Connection Techniques Processing cycle 9-26 Protection class 9-4 Protective sleeves 10-4

### R

Radial forces 9-6, 9-37
Radial load 9-38
Radial shaft sealing ring 9-22
Rated current 4-2, 4-4
Rated performance 4-2, 4-4
Rated speed 4-2, 4-4
Rated torque 4-2
Redundant bearing 9-29
Residual risks
aging 13-6
overloading 13-6
Resonance 9-40
Rotor moment of inertia 4-3

### S

Safety 11-1
safety instructions for electric drives and controls 3-1
Selection and Labeling of the ATEX motors 13-6
Setup elevation 9-1
Shaft loads 9-25
Shaft sealing ring 9-22
Shock 9-3
Shock-absorbing attachments 9-3
Shock-decoupling attachments 9-3
Sliding friction 9-38
Standards 1-3
Supplied condition 10-1

### Т

Temperature classes 13-3
Terminal box see Connection techniques see Connection Techniques
Thermal time constant 4-3
Tightness 9-6, 9-23
Torque constant 4-2
Transport 10-1, 10-3
Troubleshooting 12-6
Type of cooling 6-1
Types of protection 13-3

### U

Use See appropriate use and inappropriate use Utilization factor 9-1

### V

Ventilation 9-9 Vibration 9-2 Vibration behavior 9-40 Vibration severity level 9-40 Vibration speed 9-40

### W

Winding code 6-1

### Ζ

Zones of hazardous areas 13-2

Rexroth IndraDyn A Index 14-5







Bosch Rexroth AG
Electric Drives and Controls
P.O. Box 13 57
97803 Lohr, Germany
Bgm.-Dr.-Nebel-Str. 2
97816 Lohr, Germany
Phone +49 (0)93 52-40-50 60
Fax +49 (0)93 52-40-49 41

Fax +49 (0)93 52-40-30 60 Fax +49 (0)93 52-40-49 41 service.svc@boschrexroth.de www.boschrexroth.com

