




Date/Time 01/12/2023 11:58:32

Page 1 of 2

Data e ora della misurazione 15/11/2023 09:15:35 , 15:57:24

BUZZI SINISCOLA\AZIONAMENTO MULINO CEMENTO\MOTORE AZIONAMENTO0 MULINO LATO
NUORO\M1V\1063 SPETTRO VELOCITA' 1600 HZ

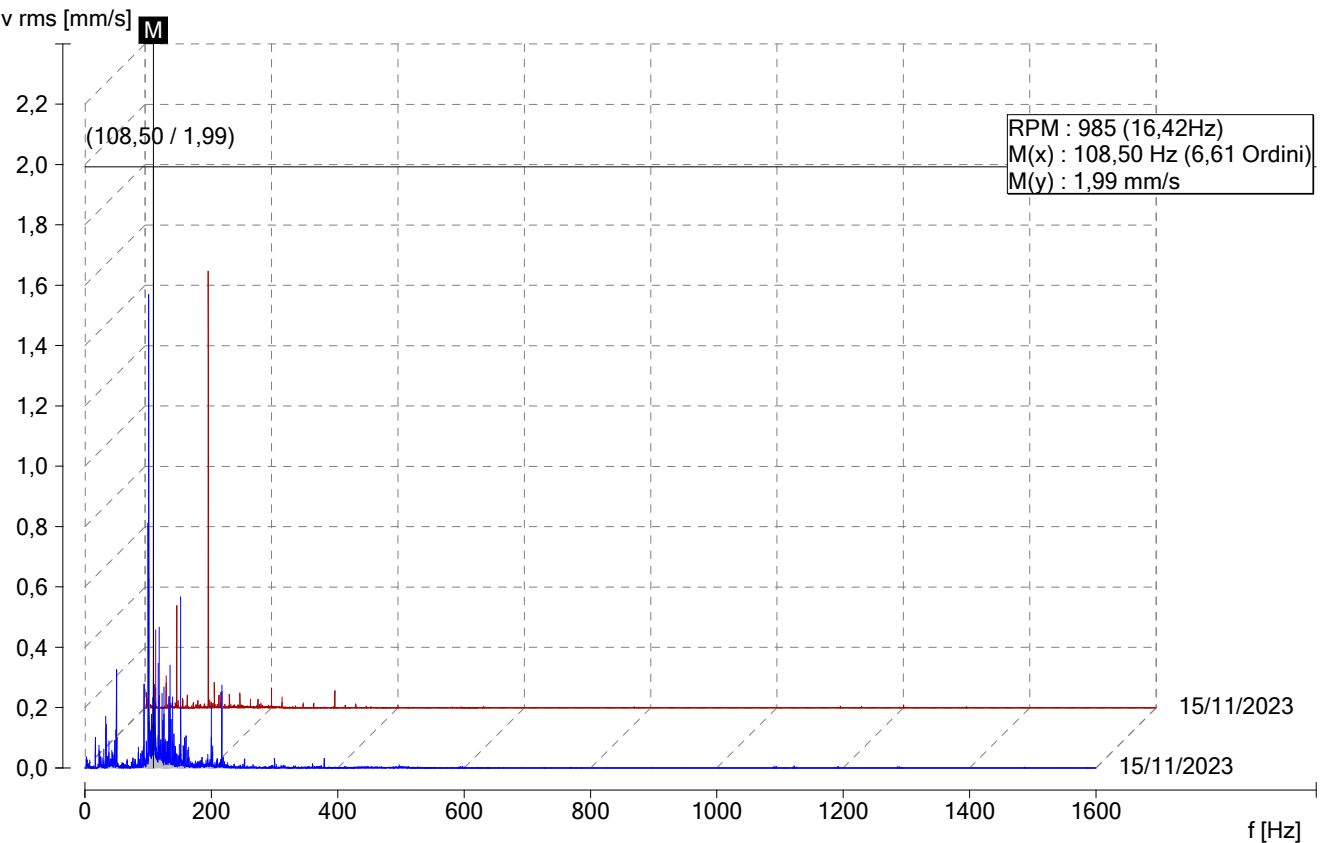

Cursore Principale	X [Hz]	= 108,50	(100,000) Elect. 100 Hz Electrical
	Y [mm/s]	= 1,99	(50,000) Elect. 50 Hz Electrical
	X [Hz]	= Non Attivo	(16,42) Unbalance Unbalance
	Y [mm/s]	= Non Attivo	(16,42) 1.Align Misalignment
		= 985	(32,83) 2.Align Misalignment
			(16,42) 1.Res. RPM Resonance
			(32,83) 2.Res. RPM Resonance
			(49,25) 3.Res. RPM Resonance
			(65,67) 4.Res. RPM Resonance
			(16,42) 1.Rotor NDS Harmonics NDS
			(32,83) 2.Rotor NDS Harmonics NDS

REM SRL
Via Ferruccia, 16a
03010 Patrica FR



Date/Time 01/12/2023 11:58:32

Page 2 of 2

(49,25) 3.Rotor NDS Harmonics NDS
(65,67) 4.Rotor NDS Harmonics NDS
(51,43) BPFO 6326 (FAG)
(79,90) BPFI 6326 (FAG)
(72,15) RPF 6326 (FAG)
(6,44) FTF 6326 (FAG)
(58,48) BPFO 6330 (FAG)
(89,27) BPFI 6330 (FAG)
(75,30) RPF 6330 (FAG)
(6,50) FTF 6330 (FAG)

Data	Ora	Evento	Commento
01/12/2023	11:36:23	Velocità di riferimento modificata.	Vecchio rif. 985, nuovo rif. 985.
01/12/2023	11:23:56	Velocità di riferimento modificata.	Vecchio rif. 985, nuovo rif. 985.
15/11/2023	10:37:24	Velocità di riferimento modificata.	Vecchio rif. 985, nuovo rif. 997.